

---

ASTM Phase I Environmental Site Assessment

---

56 Hamlin Street  
Middletown, Connecticut

---

Prepared for    Mr. William Warner  
                    Department of Planning, Conservation & Development  
                    City of Middletown  
                    245 deKoven Drive  
                    Middletown, Connecticut 06457

Prepared by    **VHB**/Vanassee Hangen Brustlin, Inc.  
                    Transportation, Land Development, Environmental Services  
                    54 Tuttle Place  
                    Middletown, Connecticut 06457

April 2005

---

ASTM Phase I Environmental Site Assessment

56 Hamlin Street  
Middletown, Connecticut

---


Prepared for    Mr. William Warner  
                     Department of Planning, Conservation & Development  
                     City of Middletown  
                     245 deKoven Drive  
                     Middletown, Connecticut 06457

Prepared by    **VHB**/Vanasse Hangen Brustlin, Inc.  
                     Transportation, Land Development, Environmental Services  
                     54 Tuttle Place  
                     Middletown, Connecticut 06457

Project Manager

  
\_\_\_\_\_  
Amy Czerwonska, Project Environmental Scientist

Senior  
Technical Review

  
\_\_\_\_\_  
Michael Libertine, LEP, Director-Environmental Services, CT

# Table of Contents

Executive Summary .....	1
Introduction .....	5
Purpose and Scope of Work .....	5
Project Location/Description.....	6
Site Location and Description .....	6
Site Utilities .....	6
Environmental Setting .....	6
Historical/Records Review .....	9
Summary.....	9
Local Government Agency Record Review .....	9
Site Ownership.....	9
Historical Sanborn Fire Insurance Maps .....	11
Historical City Directories .....	12
Aerial Photography.....	13
Previous Investigations .....	14
Site Reconnaissance.....	15
Current Uses and Activities.....	15
Hazardous Materials/Petroleum Products Storage and Handling .....	16
Waste Generation, Treatment, Storage and Disposal .....	16
Polychlorinated Biphenyls .....	16
Storage Tanks and Piping.....	16
Surface Conditions.....	16
Regulatory File Search .....	18
Adjacent Properties.....	21
Summary of Findings .....	21
References.....	25

# Figures

Figure No.	Title
1	Site Location Map
2	Site Plan

# Appendices

Appendix	Description
A	Limitations
B	Environmental Database Summary Report
C	File Review Information
D	Site Photographs



# Executive Summary

At the request of The City of Middletown (referred to herein as the “Client”) and in accordance with Vanasse Hangen Brustlin, Inc.’s (VHB) proposal dated March 28, 2005, VHB conducted an ASTM Phase I Environmental Site Assessment (ESA) for the property located at 56 Hamlin Street in Middletown, Connecticut, herein referred to as the “Site”.

This Phase I ESA was conducted in conformance with the ASTM E 1527-00 Standard Practice for Environmental Site Assessments to identify Recognized Environmental Conditions (RECs) at and/or in the vicinity of the Site. The scope of services included: a historical records review; a federal and state environmental database search; a state and municipal file review; a drive-by windshield survey to document current site usage and to determine the potential for a release or threat of a release of oil or hazardous materials (OHM); and interviews with people knowledgeable about the Site. This Phase I ESA is subject to the terms of the agreement between VHB and the Client and the Limitations included in Appendix A.

**Site Location and Description** — The Site is located at the intersection of Hamlin Street and College Street and consists of four contiguous parcels of land totaling 0.56 acre. The Site is identified by the City of Middletown Assessors Office on Map 24 as Block 23-29 Lots 4 through 7. A two-story 4,956 square foot masonry building is located on the southwestern corner of the Site. The remaining portions of the Site are paved. The building is currently utilized by Wesleyan University as their Facilities Plant and consists of offices and trade shops (i.e., plumbing, electrical, and carpentry). The southern portion of the building has a basement, the northern portion does not.

The immediate area surrounding the Site consists of residential properties along College Street and Hamlin Street to the north, east, and west side of the Site, and a day care/child learning facility is located to the south. Wesleyan University’s Main Campus is located further west of the Site.

**Site History** — Historical documents reviewed indicate that the current on-Site building was constructed in 1880 and three residences formerly existed along College Street on the north side of the Site until the 1960s. The residences were referred to as 177, 181, and 185 College Street. The existing remaining building was occupied by various carriage manufacturers from 1880 to the 1920s, and by Mohawk Manufactures, makers of metal goods from the 1920s to the early 1970s. The Site has been utilized as the Wesleyan University Facilities Plant since the 1970s.

An addition was constructed on the south end of the manufacturing building sometime between 1913 and 1924.

The 1920 City directory reviewed listed "Forest City Laundry" as the occupant of the Site. However, no other documentation was found to confirm this Site use. Forest City Laundry is currently located approximately 0.10 miles southwest of the Site.

The immediate area surrounding the Site was historically developed for residential purposes with the exception of a former elementary school that occupied the property to the west of the Site (circa 1800s to 1980s). Wesleyan University has historically been located farther west of the Site.

**Site Reconnaissance** — VHB performed a reconnaissance of the Site on March 28, 2005 accompanied by Joyce Topshe of Wesleyan University. Observations made during the Site reconnaissance are summarized below.

The Site is accessed from Hamlin Street. The southwestern corner of the Site is improved with a two-story manufacturing building. A paved parking lot occupies the remaining portions of the Site. Chain link fencing bounds the south side of the Site.

The Site is occupied by the Wesleyan University Facilities Plant. The building is utilized for offices and trade shops (carpentry, plumbing, and electric). The southern portion of the building (circa 1920s addition) has a basement. The original portion of the building has an attic and is constructed on concrete slab.

The southern portion of the building contains a carpenter shop in the basement, storage of supplies on the first floor and a wood/paint shop on the second floor. A freight elevator is located in this area. The northern portion of the building contains offices on the first and second floors, as well as plumbing and electrical shops towards the front of the building. The attic is used for storage of equipment and spare parts.

A 55-gallon drum containing oily/solvent rags was observed outside the wood shop. A floor drain was observed in the basement bathroom. The discharge point for this floor drain is unknown. The furnace room is located adjacent to the carpenter shop. A utility pipe trench was observed in the floor of the furnace room.

Two 275-gallon aboveground storage tanks (ASTs) were observed in a small room adjacent to the furnace room. These ASTs contain heating oil and appeared to be relatively new. Secondary containment was observed beneath both ASTs. Another 275-gallon AST containing heating oil was observed in the plumbing shop. This AST appeared to be in good condition (i.e., no visible leaks, pitting or rust). No secondary containment was observed beneath this AST.

A temporary groundwater monitoring well (one inch in diameter) was observed in the parking lot on the northeast side of the building. The well was capped at the time of the Site reconnaissance. A storage trailer was observed adjacent to the southeast corner of the building. According to Wesleyan employees, the trailer contains plywood and other wood materials.

Other than heating oil in the ASTs, and paint and paint thinner contained in the carpenter shop, no other OHM storage was observed during the Site reconnaissance.

**Regulatory File Search—** VHB performed an environmental database search for listings of the Site and nearby properties having potential environmental concerns. VHB also reviewed available municipal and state files for the Site. The following information was obtained from the database report and the file review.

According to the environmental database report, the Site is reported as having/had three spills, two leaking underground storage tanks (LUSTs), and one registered underground storage tank (UST). The registered UST is listed as a 1,000-gallon gasoline UST that was removed in 1999. One of the spill listings and one of the LUST listings are associated with this UST. The other LUST listing and spill report refers to a 2,000-gallon heating oil UST that was removed in 2002. The remaining spill report identifies a release of power steering fluid at the Site in 1992. All of these Site listings are reported as having a "closed" status.

Two reports regarding former underground storage tanks (USTs) and subsequent sampling were provided by Wesleyan University. According to the 2002 report for the removal of the 2,000-gallon fuel oil UST, low concentrations of polynuclear aromatic hydrocarbons (PAHs) detected in soil indicated a release had occurred from the UST. The concentrations detected were such that soils were not expected to present a risk and PAHs leaching into groundwater was determined unlikely. No further action was recommended. The Connecticut Department of Environmental Protection (CTDEP) was notified of the release (CTDEP case number 2002-05603). The status of this release is listed as "closed" on the CTDEP incident report.

According to the report for the subsurface investigation conducted in the vicinity of the former 1,000-gallon UST removed in 1999, the presence of fuel odor in the soil and volatile organic compound (VOC) measurements during field screening activities indicated a release of gasoline occurred from the UST. Laboratory analyses confirmed the release. VOCs and lead were detected in soil samples collected. None of the concentrations detected in the soil exceeded applicable criteria. VOCs and total lead were also detected in groundwater samples. The initial concentrations of total lead exceeded applicable criteria. Subsequent analyses (following filtering the sample to remove suspended solids) did not detect lead above laboratory detection limits. No further action was recommended. The CTDEP was notified of the release (CTDEP case number 2001-05781). The status of this release is listed as "closed" on the CTDEP incident report.

Two nearby properties up-gradient of the Site were listed as State Spill Sites and LUST sites. These properties are located along College Street and are associated with Wesleyan University. The listings involve releases of fuel oil due to in-ground tank failures. According to the reports, these incidents are considered "closed" by the CTDEP. These documented incidents and the historic urban nature of the vicinity have likely contributed to the area's GB groundwater classification, indicating known degraded conditions.

**Conclusions—** VHB understands that the Client is interested in evaluating this property for potential purchase. Based on our investigation, the following recognized environmental conditions (RECs) were identified at the Site:

- The Site was utilized for manufacturing purposes from 1880 to the 1970s. Former manufacturing processes, OHM storage, and waste disposal practices are unknown.
- Documented soil and groundwater contamination related to fuel oil and gasoline releases exist at the Site.
- A temporary groundwater monitoring well was observed in the parking area on the northeast side of the building.
- Unknown discharge point for the floor drain in the basement.

No documentation or other evidence indicating that this Site qualifies as an "establishment" under Connecticut's Transfer Act (Connecticut General Statute 22a-134) was discovered during this investigation, where "establishment" is defined as *any real property at which or any business from which (A) on or after November 19, 1980 there was generated, except as the result of remediation activities, more than one hundred kilograms of hazardous waste in any one month, (B) hazardous waste generated by another person or municipality was recycled, reclaimed, reused, stored, handled, treated transported or disposed of, (C) the process of dry cleaning was conducted on or after May 1, 1967, (D) furniture stripping was conducted on or after May 1, 1967, or (E) a vehicle body repair shop or vehicle painting shop is or was conducted on or after May 1, 1967.* A 1920 Site listing indicated the presence of Forest City Laundry at that time; however, no additional listings for this business were found associated with the Site. Forest City currently conducts dry cleaning services at a nearby location. Dry cleaning activities conducted on or after May 1962 qualifies properties as "establishments"; however, there is no evidence to support these activities took place on the subject Site.

**Recommendations -** Based on our investigation, VHB recommends a Phase II Subsurface Investigation be conducted at the Site to determine if soil and groundwater has been impacted from historical manufacturing operations.

Since previous investigations detected elevated levels of VOCs in groundwater and established that depth to groundwater beneath the Site is approximately 6 feet below grade, further evaluation may be necessary to determine if remediation/mitigation of documented contamination is required based on future land uses of the Site.

In addition, VHB recommends removing and closing the temporary groundwater monitoring well in accordance with CTDEP regulations, providing secondary containment for the AST located in the plumber's shop, and sealing the floor drain located in the basement.

# 1

## Introduction

---

### Purpose and Scope of Work

At the request of the City of Middletown (referred to herein as the "Client"), Vanasse Hangen Brustlin, Inc. (VHB) conducted an ASTM Phase I Environmental Site Assessment (ESA) for the property located at 56 Hamlin Street in Middletown, Connecticut (referred to herein as the "Site"). The Site is identified by the City of Middletown Assessors Office on Map 24 as Block 23-29 Lots 4, 5, 6, and 7. It is VHB's understanding that the Client is interested in evaluating this property potential purchase.

The Phase I ESA was conducted in conformance with the ASTM E 1527-00 Standard Practice for Environmental Site Assessments to identify Recognized Environmental Conditions (RECs) at and/or in the vicinity of the Site.

The scope of services included: a historical records review; a federal and state environmental database search; a state and municipal file review; a windshield view Site reconnaissance to identify overt evidence of a release or threat of a release of oil or hazardous materials (OHM); and interviews with people knowledgeable about the Site. This Phase I ESA is subject to the terms of the agreement between VHB and the Client and the Limitations included in Appendix A.

# 2

## Project Location/Description

---

### Site Location and Description

The Site consists of approximately 0.56 acre of land at the intersection of Hamlin Street and College Street. A two-story, 4,956 square foot masonry building is located in the southwest corner of the Site. The remaining portions of the Site consist primarily of paved parking areas. The Site is currently utilized by Wesleyan University as their "Facilities Plant". Offices and trade shops (i.e., plumbing, electrical, and carpentry) occupy the building.

The immediate area surrounding the Site consists primarily of residential properties with the exception of the property adjacent to the south side of the Site, which is occupied by a day care/child learning center. Wesleyan University's Main Campus is located further west of the Site. Figure 1 depicts the Site location.

---

### Site Utilities

Overhead electric service is provided to the Site by Connecticut Light and Power (CL&P). Public water and sewer systems provided by the City serve the Site. The connection date of the Site to the municipal system was not observed in the files reviewed. According to personnel at the Middletown Engineering Department, public water and sewer have been available in the Site area since the late 1800's. The Site is heated via fuel oil stored in three 275-gallon ASTs. Vent and fill pipes associated with the ASTs were observed along the east side of the building.

---

### Environmental Setting

---

#### Topography

According to the United States Geological Survey (USGS) 7.5-Minute Quadrangle Middletown, Connecticut topographic map, the Site is located approximately 60 feet above sea level. Based on review of this map, the topography of the Site can be characterized as sloping to the east.

---

## Soils/Geology

Soils in the vicinity of the Site are classified as thick till described as areas where till is greater than 10 to 15 feet thick and including drumlins in which till thickness commonly exceeds 100 feet.

Bedrock geology underlying the Site is identified as the Portland Arkose Formation. This formation/bedrock is described as red-to-brown, medium-to-coarse grained, sandstone-like, sedimentary rock, consisting of quartz, feldspar, and other various rock fragments.

---

## Hydrology

Groundwater below and near the site is classified by the CTDEP as a GB groundwater area. The GB classification indicates groundwater within a historically highly urbanized area or an area of intense industrial activity and where public water supply service is available. Such groundwater may not be suitable for human consumption without treatment due to waste discharges, spills or leaks of chemicals or land use impacts.

Groundwater flow direction may be impacted locally by surface topography, hydrology, hydrogeology and soil characteristics. Based on available hydrogeological references for the Site area, regional groundwater flow is likely to the east towards the Connecticut River. Based on a previous investigation conducted at the Site, depth to groundwater was identified at 6 feet below grade.

---

## Wetlands

Based on Site observations and the State Department of Environmental Protection wetland and watercourse Geographic Information Systems (GIS) data dated 2003, there are no wetlands on the Site. VHB also reviewed a Comprehensive Drainage Study for the City of Middletown dated 1982 prepared by Purcell Associates available at the Planning, Conservation and Development office which confirmed this information. A formal survey by a qualified wetland scientist that would definitively identify such systems is outside the scope of this Phase I ESA and has not been performed.

---

## Surface Waterbodies

The Connecticut River is located approximately one-quarter mile east of the Site. This river has been assigned a Class SC/SB surface water classification by the CTDEP. This classification indicates the tidal influenced water body does not presently meet Water Quality Criteria or does not support one or more assigned designated uses (fish, shellfish, and wildlife habitat, certain aquaculture operations, recreational uses, industrial and other legitimate uses, including navigation) due to pollution. The goal for such waters is to reduce degradation and maintain Class SB quality criteria.

---

**Flood Plains**

According to the Federal Emergency Management Agency (FEMA) National Flood Insurance Program (NFIP) Flood Zone Mapping Community Panel #0900680008B, the Site is not within a flood zone. VHB also reviewed FEMA maps available at the City of Middletown Planning, Conservation and Development office which confirmed this information.



## Historical/Records Review

---

### Summary

File reviews and a historic document search/review indicate that the current on-Site building was constructed in 1880 and was occupied by various carriage manufacturers from 1880 to the 1920s. From the 1920s to the early 1970s the manufacturing building was occupied by Mohawk Manufactures, makers of metal goods. The Wesleyan University Facilities Plant has occupied the Site since the 1970s. An addition was constructed on the south end of the manufacturing building sometime between 1913 and 1924. Three residential structures formerly existed along College Street on the north side of the Site. According to records, the residences were referred to as 177, 181, and 185 College Street and they were demolished in the 1960s.

The 1920 City directory reviewed listed "Forest City Laundry" as occupant of the Site. However, no other documentation was found to confirm this Site use. Forest City Laundry is currently located approximately 0.10 miles southwest of the Site.

The surrounding area was historically developed for residential purposes with the exception of a former elementary school that occupied the property to the west of the Site (circa 1800s to 1980s) with residential properties and Wesleyan University beyond.

---

### Local Government Agency Record Review

VHB personnel visited the Middletown municipal offices in March 2005 to obtain information regarding Site history and use, zoning, and OHM use, storage, release and/or disposal practices that may have occurred at the Site. All pertinent file information is attached in Appendix C.

---

### Site Ownership

According to land records reviewed, Wesleyan University, current owners of the Site, purchased the Site from the Victoria Corporation on October 21, 1957 (Volume 286, page 329). The Victoria Corporation purchased the Site from William Stroud earlier that year (1957). The exact date, volume, and page for this deed are unknown.

No environmental liens were identified during the local file review. A certified title search where environmental liens would be definitively identified is not within the scope of services for this Phase I ESA and was not performed. A title company is capable of completing a full title and environmental lien search.

---

## Assessment Office

VHB reviewed City of Middletown Assessors information available for the Site. The Site is identified by the City of Middletown Assessors Map 24, as Block 23-29, Lots 4, 5, 6, and 7. The following information was obtained from the Assessors cards for each of the Site parcels:

Lot 4 - consists of 0.16 acre of land improved with a two-story, 4,956 square foot, masonry manufacturing building. The original portion of the building (circa 1880) is approximately 2,652 square feet in size. The addition (circa 1913 to 1924) is approximately 2,304 square feet in size.

Lot 5 - consists of 0.16 acre of land occupied by a paved parking lot that was constructed in 1990.

Lot 6 - consists of 0.08 acre of land occupied by a paved parking lot that was constructed in 1990.

Lot 7 - consists of 0.16 acre of land occupied by a paved parking lot that was constructed in 1990.

---

## Fire Marshal

VHB conducted a file review of the Town of Middletown Fire Marshal's records. The following environmentally pertinent information is on file for the Site:

UST Facility Notification Form - indicating a 1,000-gallon UST containing gasoline was removed from the Site. According to the form, the UST was over 20 years of age and was last used in August 1997.

UST Removal Letter - dated August 5, 1998 stating that the Fire Marshall witnessed the removal of a 1,000-gallon gasoline UST from the rear of the Site. The UST was pumped and removed by Shire Corporation of Franklin, CT. According to Fire Marshall notes, the UST was in "new condition". No evidence of leaks was observed and no visible signs of contamination were observed.

UST Removal Letter - dated July 31, 2002 stating that the Fire Marshall witnessed the removal of a 2,000-gallon fuel oil UST at the Site by Jean Tanguay Construction Company of Bristol, Connecticut. According to the Fire Marshal "No visible penetrations were

present and visible examination of the tank grave showed no visible signs of contamination". The letter indicated URS Corporation collected soil samples for field and lab analysis and field results were negative for contamination. Shire Corporation hauled the UST from the Site for proper disposal. The excavation was backfilled and graded.

---

## Building Department

VHB reviewed the Town of Middletown's Building Department files for the Site. The following building permit applications are on file:

Permit #	Date	Description
24060	7/29/98	Remove tank (applicant Canova Construction )
8744	5/29/79	Re-roof with asphalt shingles
Not listed	8/19/63	Demolish dwelling at 181 College Street (Lot 6)
Not listed	3/25/64	Demolish dwelling at 177 College Street (Lot 7)

\* No permit was found on file for the demolition of the dwelling at 186 College Street (Lot 5)

---

## Planning and Zoning Department

VHB visited the City of Middletown's Planning and Zoning Department to review files for the Site. According to personnel, no files exist for the Site.

---

## Department of Health

VHB visited the City of Middletown's Health Department to review files for the Site. According to Vincent Mazzotta, Public Health Sanitarian for the City of Middletown, no files exist for the Site.

---

## Historical Sanborn Fire Insurance Maps

VHB reviewed Sanborn Fire Insurance maps (dated 1889, 1895, 1901, 1907, 1913, 1924, and 1950) for the City of Middletown available at the Connecticut State Library. Below is a description of the Site as depicted in each of the Sanborn Maps reviewed:

1889: Three residential dwellings and associated sheds are depicted along the north side of the Site. The original L-shaped manufacturing building is depicted in the southwest corner of the Site. The building is listed as "J.B. Evans Carriage Manufacturing" and the words "Repository & Wood Shop 1<sup>st</sup> Floor" and "Trimming & Painting 2<sup>nd</sup> Floor" are printed on the Sanborn Map within the footprint of the building. A platform is depicted off the northeast side of the

building. Printed in the southeastern portion of the L-shaped building are the letters "B.S.M" which is listed in the Sanborn Map key as meaning "blacksmith". Lumber sheds and wagon sheds area depicted in the southeast corner of the Site. According to the Sanborn Map the building was heated with steam and coal was used for fuel.

1895: The Site is depicted similar to the 1889 Sanborn Map with the exception of the occupants. The manufacturing building is listed in the 1895 Sanborn Map as being occupied by "Carrier & Smith Carriage Manufacturing".

1901: The Site is depicted similar to the 1889 Sanborn Map except the manufacturing building is listed as being occupied by "L.B. Evans Carriage Manufacturing" and the platform on the northeast side of the building has been extended in a northerly direction.

1907: The Site is depicted similar to the 1901 Sanborn Map.

1913: The Site is depicted similar to the 1901 Sanborn Map.

1924: The three residential dwellings are still depicted on the north side of the Site. An auto storage garage is depicted behind the eastern most dwelling (177 College Street). An addition is depicted on the south side of the manufacturing building and "Factory Building" is printed within the footprint. The building is listed as being occupied by "Mohawk Manufacturing Company, sheet metal products". The platform, lumber sheds, and wagon sheds are no longer depicted. Instead two "storage" structures are depicted in these areas.

1950: The Site is depicted similar to the 1924 Sanborn Map except the storage structure in the southeast corner of the Site is not depicted. In addition, the manufacturing building is listed as being powered by oil. A small black square is depicted on the Sanborn Map in the location of the former 1,000-gallon UST.

Adjacent properties appear to be historically residentially developed with the exception of the property to the west of the Site which was formerly occupied by an elementary school and Wesleyan University located farther west of the Site. In addition, the Good Year Rubber Company formerly existed at the intersection of Hamlin Street and Church Street approximately 0.16 miles south of the Site.

---

## Historical City Directories

According to the City of Middletown Directories dated 1920, 1930, 1935, 1940, 1950, 1960, 1970, 1980, 1990 and 2003 available at the Connecticut State Library, listings for the Site consist of residential listings for the dwellings on the north side of the Site from 1920 to 1960. Forest City Laundry is listed in the 1920 directory as occupying the property at 56-

58 Hamlin Street, which is the address for the on-Site manufacturing building. Mohawk Manufacturing is listed in the 1930, 1940 and 1950 directory as occupying the on-Site manufacturing building. The Wesleyan University Physical Plant is listed in the 1980 directory at 56 Hamlin Street. There was no listing for 56 Hamlin Street in the 1960, 1970, 1990, and 2003 directories

---

## **Aerial Photography**

VHB reviewed aerial photographs for the Site dated 1995, 1990, 1985, 1980, 1970, 1965, 1951 and 1934 available at the Connecticut State Library.

### **1995 Aerial Photographs**

The 1995 aerial photograph depicts the Site similar to current conditions with the manufacturing building located in the southwest corner of the Site, and the remaining portions of the Site consisting of paved parking.

### **1990 Aerial Photographs**

Similar to conditions depicted in the 1995 aerial photograph.

### **1985 Aerial Photograph**

Similar to conditions depicted in the 1990 aerial photograph.

### **1980 Aerial Photograph**

Similar to conditions depicted in the 1990 aerial photograph.

### **1970 Aerial Photograph**

Similar to conditions depicted in the 1990 aerial photograph.

### **1965 Aerial Photograph**

Similar to conditions depicted in the 1990 aerial photograph except the dwelling at 185 College Street is depicted on the northeast corner of the Site.

### **1951 Aerial Photograph**

All three residential dwellings are depicted on the north side of the Site and the manufacturing building is depicted in the southwest corner.

### **1934 Aerial Photograph**

Similar to conditions depicted in the 1951 aerial photograph.

## Previous Investigations

At the time of the Site reconnaissance the Site contact, Joyce Topshe of Wesleyan University provided VHB with two UST Removal Reports both prepared by URS Corporation of Rocky Hill, Connecticut.

The first report is a Subsurface Investigation Report dated April 2002. According to the report, URS collected soil and groundwater samples in the vicinity of the former 1,000-gallon gasoline UST located on the eastern side of the manufacturing building. The presence of fuel odor in the soil at the location of the former UST grave and VOC measurements during field screening activities with a photo-ionization detector (PID) indicate a release of gasoline occurred from the UST. Laboratory analyses confirmed the release. VOCs and lead were detected in soil samples at concentrations below applicable criteria. VOCs and total lead were also detected in groundwater samples. The initial concentrations of total lead exceeded applicable criteria. Analyses following filtering the sample to remove suspended solids did not detect lead above laboratory detection limits. According to the report, none of the VOC concentrations detected in groundwater exceeded the applicable tabulated standards set forth in the CTDEP Remediation Standard Regulations (RSRs). No further action was recommended. The CTDEP was notified of the release (CTDEP case number 2001-05781). The status of this release is listed as "closed" on the CTDEP incident report.

The second report is a UST Closure Report dated September 2002. According to the report a 2,000-gallon fuel oil UST was removed the west side of the building on July 21, 2002. Soil samples were collected from the tank grave and submitted for laboratory analyses in accordance with CTDEP tank closure guidelines. Low concentrations of polynuclear aromatic hydrocarbons (PAHs) detected in soil indicated a release had occurred from the UST. URS concluded the concentrations detected were such that soils were not expected to present a risk and PAHs leaching into groundwater was determined unlikely. No further action was recommended. The CTDEP was notified of the release (CTDEP case number 2002-05603). The status of this release is listed as "closed" on the CTDEP incident report.

No other previous investigations for the Site were provided.

# 4

## Site Reconnaissance

### Current Uses and Activities

VHB performed a Site reconnaissance on March 28, 2005 accompanied by Joyce Topshe of Wesleyan University. No overt evidence of a significant release or threat of a release of OHM was observed on the Site during the Site reconnaissance. Figure 2 depicts the Site configuration; Site photographs are attached in Appendix D.

The southwestern corner of the Site is improved with a two-story manufacturing building. A paved parking lot occupies the remaining portions of the Site. Chain link fencing bounds the south side of the Site.

The Site is occupied by the Wesleyan University Facilities Plant. The building is utilized for offices and trade shops (carpentry, plumbing, and electric). The southern portion of the building (circa 1920s addition) has a basement. The original portion of the building has an attic and is constructed on concrete slab.

The southern portion of the building contains a carpenter shop in the basement, storage of supplies on the first floor and a wood/paint shop on the second floor. A freight elevator is located in this area. The northern portion of the building contains offices on the first and second floors, as well as plumbing and electrical shops towards the front of the building. The attic is used for storage of equipment and spare parts.

A floor drain was observed in the basement bathroom. The discharge point for this floor drain is unknown. The furnace room is located adjacent to the carpenter shop. A utility piping trench was observed in the floor of the furnace room.

A storage trailer was observed adjacent to the southeast corner of the building. According to Wesleyan employees, the trailer contains plywood and other wood materials.

A temporary groundwater monitoring well (one inch in diameter) was observed in the parking lot on the northeast side of the building. The well was capped at the time of the Site reconnaissance.

## Hazardous Materials/Petroleum Products Storage and Handling

Other than heating oil in the ASTs, and paint and paint thinner contained in the carpenter shop, no other OHM or storage was observed during the Site reconnaissance. The paint and paint thinner appeared to be properly stored at the time of the Site reconnaissance.

## Waste Generation, Treatment, Storage and Disposal

A 55-gallon drum containing oily/solvent rags was observed outside the wood shop. According to Wesleyan employees, the rags are picked up on an as-needed basis by Coyne Cleaning Service. No other wastes that would be considered hazardous are generated at the Site.

## Polychlorinated Biphenyls

No hydraulic lifts, transformers, or other equipment suspected to contain polychlorinated biphenyls (PCBs) was observed at the Site. According to Wesleyan employees, the existing freight elevator is a mechanical, cable-actuated elevator. It does not appear as though the elevator uses hydraulic equipment.

## Storage Tanks and Piping

Two 275-gallon ASTs were observed in a small room adjacent to the furnace room. These ASTs contain heating oil and appeared to be relatively new. Secondary containment was observed beneath both ASTs. Another 275-gallon AST containing heating oil was observed in the plumbing shop. This AST appeared to be in good condition (i.e., no visible leaks, pitting or rust). No secondary containment was observed beneath this AST. Vent and fill pipes associated with these ASTs were observed on the east side of the building. No leaks or staining were observed in association with these pipes.

According to documentation on file at the City of Middletown's Fire Marshal Office, two USTs were removed from the Site. A 1,000-gallon gasoline UST was removed from the east side of the building in August 1998, and a 2,000-gallon fuel oil UST was removed from the west side of the building in July 2002.

## Surface Conditions

The Site is improved with a masonry manufacturing building. The building occupies approximately 40% of the Site. Pavement occupies the remaining 60% of the Site. The pavement was observed to be cracked in several areas exposing surface soils. There is a strip of overgrown vegetation along the south side of the building.



At the time of the Site reconnaissance, no distressed vegetation or stained soils were observed.

## 5

## Regulatory File Search

VHB conducted file reviews to evaluate the potential for the Site and surrounding properties in the vicinity of the Site to have had a release or pose a threat of release of OHM, and which may impact the environmental quality of the Site. VHB reviewed federal and state environmental information sources using FirstSearch™ databases.

VHB reviewed the following the FirstSearch™ environmental databases: Emergency Response Notification System (ERNS) National Priority List (NPL) sites; Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS); Resource Conservation and Recovery Act (RCRA) Treatment, Storage, and Disposal (TSD) facilities list; RCRA hazardous waste generators and no longer registered (NLR) hazardous waste generators; state list of hazardous waste sites; state list of spills sites; Active Solid Waste Landfill (SWL) facilities; registered USTs; and LUSTs. The FirstSearch™ report is attached as Appendix B. Database search radii were chosen generally in accordance with the ASTM E 1527-00 Standard Practice for Environmental Site Assessments:

DATABASE	ASTM SEARCH RADIUS	NUMBER OF SITES WITHIN SEARCH RADIUS
ERNS sites	0.25 mile	1
NPL sites	1 mile	0
CERCLIS sites	0.5 mile	0
RCRA TSD	0.5 mile	0
RCRA COR	1 mile	2
RCRA Generators	0.25 mile	2
RCRA NLR Generators	0.25 mile	0
State Hazardous Waste Sites	1 mile	22
State Spills	0.25 mile	73*
SWL facilities	0.5 mile	0
Registered USTs	0.25 mile	13*
LUSTs	0.5 mile	43*

\* Includes Site listing

According to the FirstSearch™ report, the Site is listed as having had three spills, two LUSTs, and one registered UST. The following is a description of each Site listing:

LUST listing – a release of No. 2 fuel oil was reported at the Site on August 14, 2002 due to an in-ground tank failure. According to the report, a 2,000-gallon UST was removed. The status of this release is listed as "closed".

LUST listing – a release of gasoline was reported at the Site on August 2, 2001 due to an in-ground tank failure. According to the report, a 1,000-gallon UST was removed in the mid 1990s and the tank grave was re-excavated. Test showed previously unreported contaminants, however, the concentrations were below applicable criteria. The status of this release is listed as "closed".

State Spill site listing – I.D# 2001-05781 involves the previously mentioned 1,000-gallon LUST. No new information is provided. The status of this spill report is listed as "closed".

State Spill site listing – I.D# 926575 involves a release of approximately one gallon of power steering fluid on December 23, 1992. According to the report, the spill was contained and removed. The status of this spill report is listed as "closed".

State Spill site listing – I.D# 2002-05603 involves the previously mentioned 2,000-gallon LUST. No new information is provided. The status of this spill report is listed as "closed".

Registered UST listing – I.D# 02879 involves the previously mentioned 1,000-gallon UST. According to the report, the UST was installed in 1950 and was last used in 1997. The UST is listed as having been removed from the Site.

No other listings for the Site were identified in the database report.

Two nearby properties up-gradient of the Site were listed as State Spill Sites and LUST sites. Three properties are located along College Street and are associated with Wesleyan University. The listings involve releases of fuel oil due to in-ground tank failures. According to the reports, these incidents are considered "closed" by the CTDEP. These documented incidents and the historic urban nature of the vicinity have likely contributed to the area's GB groundwater classification, indicating known degraded conditions. No other properties identified in the FirstSearch™ report are considered to be up-gradient of the Site, and therefore, none are believed to pose a significant risk of impact to the Site.

FirstSearch™ identified a total of twenty-two non-geocoded sites, which are sites with minimal or no address information located within the Site zip code area. VHB personnel has reviewed these non-geocoded site listings to determine which listings, if any, could be associated with the Site or is located within the specified search radii. Based on our review, none of these listings appear be associated with the Site; none of these listing are expected to directly impact environmental conditions at the Site.

---

## Department of Environmental Protection

VHB conducted a file review at the CTDEP's Bureau of Waste Management and Bureau of Water Management public file room on March 31, 2005. CTDEP file information is attached in Appendix C.

There were no files for the Site at the CTDEP Bureau of Water Management. Three Emergency Incident Reports and an UST Notification Form were observed on file for the Site at the CTDEP Bureau of Waste Management. The following is a description of these documents:

Emergency Incident Report dated August 2, 2001 – This report involves the previously mentioned gasoline release from the 1,000-gallon UST that was removed from the Site. No new information was deemed from this report. The status of this incident is listed as “closed” by the CTDEP.

Emergency Incident Report dated August 14, 2002 – This report involves the previously mentioned fuel oil release from the 2,000-gallon UST that was removed from the Site. No new information was deemed from this report. The status of this incident is listed as “closed” by the CTDEP.

Emergency Incident Report dated December 23, 1992 – This report involves the previously mentioned power steering fluid release. According to the report three gallons of this material was released. No further information was provided in the report.

UST Notification Form (date unknown) – This form identifies the previously mentioned UST as containing unleaded fuel and its last date of use a July 1987. The form identifies the UST as being over 20 years in age.

No further information was found on file at the CTDEP for the Site.

# 6

## Adjacent Properties

The immediate area surrounding the Site consists of residential properties (single-family and multifamily homes) along College Street and Hamlin Street to the north, east, and west sides of the Site, and a day care/child learning facility is located to the south. Hamlin Court Condominiums are located across Hamlin Street to the west of the Site. Wesleyan University's Main Campus is located further west of the Site. There are no land uses of environmental concern in the immediate vicinity of the Site. Forest City Dry- Cleaners is located approximately 0.10 mile southwest of the Site, however, due to the distance from the Site and its cross-gradient location relative to the Site, this property is not considered to pose a significant risk of impact to the Site.

## 7

## Summary of Findings

**Site Location and Description** — The Site is located at the intersection of Hamlin Street and College Street and consists of four contiguous parcels of land totaling 0.56 acre. The Site is identified by the City of Middletown Assessors Office on Map 24 as Block 23-29 Lots 4 through 7. A two-story 4,956 square foot masonry building is located on the southwestern corner of the Site. The remaining portions of the Site are paved. The building is currently utilized by Wesleyan University as their Facilities Plant and consists of offices and trade shops (i.e., plumbing, electrical, and carpentry). The southern portion of the building has a basement, the northern portion does not.

The immediate area surrounding the Site consists of residential properties along College Street and Hamlin Street to the north, east, and west side of the Site, and a day care/child learning facility is located to the south. Wesleyan University's Main Campus is located further west of the Site.

**Site History** — Historical documents reviewed indicate that the current on-Site building was constructed in 1880 and three residences formerly existed along College Street on the north side of the Site until the 1960s. The residences were referred to as 177, 181, and 185 College Street. The existing remaining building was occupied by various carriage manufacturers from 1880 to the 1920s, and by Mohawk Manufactures, makers of metal goods from the 1920s to the early 1970s. The Site has been utilized as the Wesleyan University Facilities Plant since the 1970s.

An addition was constructed on the south end of the manufacturing building sometime between 1913 and 1924.

The 1920 City directory reviewed listed "Forest City Laundry" as the occupant of the Site. However, no other documentation was found to confirm this Site use. Forest City Laundry is currently located approximately 0.10 miles southwest of the Site.

The immediate area surrounding the Site was historically developed for residential purposes with the exception of a former elementary school that occupied the property to the west of the Site (circa 1800s to 1980s). Wesleyan University has historically been located farther west of the Site.

**Site Reconnaissance** — VHB performed a reconnaissance of the Site on March 28, 2005 accompanied by Joyce Topshe of Wesleyan University. Observations made during the Site reconnaissance are summarized below.

The Site is accessed from Hamlin Street. The southwestern corner of the Site is improved with a two-story manufacturing building. A paved parking lot occupies the remaining portions of the Site. Chain link fencing bounds the south side of the Site.

The Site is occupied by the Wesleyan University Facilities Plant. The building is utilized for offices and trade shops (carpentry, plumbing, and electric). The southern portion of the building (circa 1920s addition) has a basement. The original portion of the building has an attic and is constructed on concrete slab.

The southern portion of the building contains a carpenter shop in the basement, storage of supplies on the first floor and a wood/paint shop on the second floor. A freight elevator is located in this area. The northern portion of the building contains offices on the first and second floors, as well as plumbing and electrical shops towards the front of the building. The attic is used for storage of equipment and spare parts.

A 55-gallon drum containing oily/solvent rags was observed outside the wood shop. A floor drain was observed in the basement bathroom. The discharge point for this floor drain is unknown. The furnace room is located adjacent to the carpenter shop. A utility pipe trench was observed in the floor of the furnace room.

Two 275-gallon aboveground storage tanks (ASTs) were observed in a small room adjacent to the furnace room. These ASTs contain heating oil and appeared to be relatively new. Secondary containment was observed beneath both ASTs. Another 275-gallon AST containing heating oil was observed in the plumbing shop. This AST appeared to be in good condition (i.e., no visible leaks, pitting or rust). No secondary containment was observed beneath this AST.

A temporary groundwater monitoring well (one inch in diameter) was observed in the parking lot on the northeast side of the building. The well was capped at the time of the Site reconnaissance. A storage trailer was observed adjacent to the southeast corner of the building. According to Wesleyan employees, the trailer contains plywood and other wood materials.

Other than heating oil in the ASTs, and paint and paint thinner contained in the carpenter shop, no other OHM storage was observed during the Site reconnaissance.

**Regulatory File Search**— VHB performed an environmental database search for listings of the Site and nearby properties having potential environmental concerns. VHB also reviewed available municipal and state files for the Site. The following information was obtained from the database report and the file review.

According to the environmental database report, the Site is reported as having/had three spills, two leaking underground storage tanks (LUSTs), and one registered underground

storage tank (UST). The registered UST is listed as a 1,000-gallon gasoline UST that was removed in 1999. One of the spill listings and one of the LUST listings are associated with this UST. The other LUST listing and spill report refers to a 2,000-gallon heating oil UST that was removed in 2002. The remaining spill report identifies a release of power steering fluid at the Site in 1992. All of these Site listings are reported as having a "closed" status.

Two reports regarding former underground storage tanks (USTs) and subsequent sampling were provided by Wesleyan University. According to the 2002 report for the removal of the 2,000-gallon fuel oil UST, low concentrations of polynuclear aromatic hydrocarbons (PAHs) detected in soil indicated a release had occurred from the UST. The concentrations detected were such that soils were not expected to present a risk and PAHs leaching into groundwater was determined unlikely. No further action was recommended. The Connecticut Department of Environmental Protection (CTDEP) was notified of the release (CTDEP case number 2002-05603). The status of this release is listed as "closed" on the CTDEP incident report.

According to the report for the subsurface investigation conducted in the vicinity of the former 1,000-gallon UST removed in 1999, the presence of fuel odor in the soil and volatile organic compound (VOC) measurements during field screening activities indicated a release of gasoline occurred from the UST. Laboratory analyses confirmed the release. VOCs and lead were detected in soil samples collected. None of the concentrations detected in the soil exceeded applicable criteria. VOCs and total lead were also detected in groundwater samples. The initial concentrations of total lead exceeded applicable criteria. Subsequent analyses (following filtering the sample to remove suspended solids) did not detect lead above laboratory detection limits. No further action was recommended. The CTDEP was notified of the release (CTDEP case number 2001-05781). The status of this release is listed as "closed" on the CTDEP incident report.

Two nearby properties up-gradient of the Site were listed as State Spill Sites and LUST sites. These properties are located along College Street and are associated with Wesleyan University. The listings involve releases of fuel oil due to in-ground tank failures. According to the reports, these incidents are considered "closed" by the CTDEP. These documented incidents and the historic urban nature of the vicinity have likely contributed to the area's GB groundwater classification, indicating known degraded conditions.

**Conclusions—** VHB understands that the Client is interested in evaluating this property for potential purchase. Based on our investigation, the following recognized environmental conditions (RECs) were identified at the Site:

- The Site was utilized for manufacturing purposes from 1880 to the 1970s. Former manufacturing processes, OHM storage, and waste disposal practices are unknown.
- Documented soil and groundwater contamination related to fuel oil and gasoline releases exist at the Site.



- A temporary groundwater monitoring well was observed in the parking area on the northeast side of the building.
- Unknown discharge point for the floor drain in the basement.


No documentation or other evidence indicating that this Site qualifies as an "establishment" under Connecticut's Transfer Act (Connecticut General Statute 22a-134) was discovered during this investigation, where "establishment" is defined as *any real property at which or any business from which (A) on or after November 19, 1980 there was generated, except as the result of remediation activities, more than one hundred kilograms of hazardous waste in any one month, (B) hazardous waste generated by another person or municipality was recycled, reclaimed, reused, stored, handled, treated transported or disposed of, (C) the process of dry cleaning was conducted on or after May 1, 1967, (D) furniture stripping was conducted on or after May 1, 1967, or (E) a vehicle body repair shop or vehicle painting shop is or was conducted on or after May 1, 1967.* A 1920 Site listing indicated the presence of Forest City Laundry at that time; however, no additional listings for this business were found associated with the Site. Forest City currently conducts dry cleaning services at a nearby location. Dry cleaning activities conducted on or after May 1962 qualifies properties as "establishments"; however, there is no evidence to support these activities took place on the subject Site.

# References

- Assessor's Office, City of Middleton, file review, March 2005.
- Building Department, City of Middletown, file review, March 2005
- Middletown Land Records, file review, March 2005.
- Middletown Health Department, file review, March 2005.
- Fire Marshall, City of Middletown, file review, March 2005.
- Building Department, City of Middletown, file review, March 2005.
- Environmental FirstSearch™ Report, FirstSearch Technology Corporation, March 2005
- CTDEP, Division of Waste Management, file review, March 2005.
- CTDEP, Division of Water Management, file review, March 2005.
- Connecticut State Library Archives, Aerial Photographs dated 1934, 1951, 1965, 1970, 1980, 1985, 1990, and 1995.
- Connecticut State Library Archives, City Directories dated 1920, 1930, 1940, 1950, 1960, 1970, 1980, 1990, and 2003
- USGS 7.5-Minute Middletown Quadrangle topographic map, 1956, photorevised 1984.
- Bedrock Geological Map of Connecticut, USGS, 1985.
- Surficial Materials Map of Connecticut, Stone 1992.
- Water Quality Classification Map of Connecticut, CTDEP, 1997.
- Comprehensive Drainage Study for the City of Middletown dated July 1982 prepared by Purcell Associates.
- Federal Emergency Management Agency, Federal Insurance Rate Map Panel 090068-0006C dated March 7, 2001.
- Subsurface Investigation Report dated April 2002 prepared by URS.
- UST Closure Report dated September 2002 prepared by URS.
- Environmental GIS Data for Connecticut 2003 Edition, CTDEP Bulletin 37.

---

# Figures

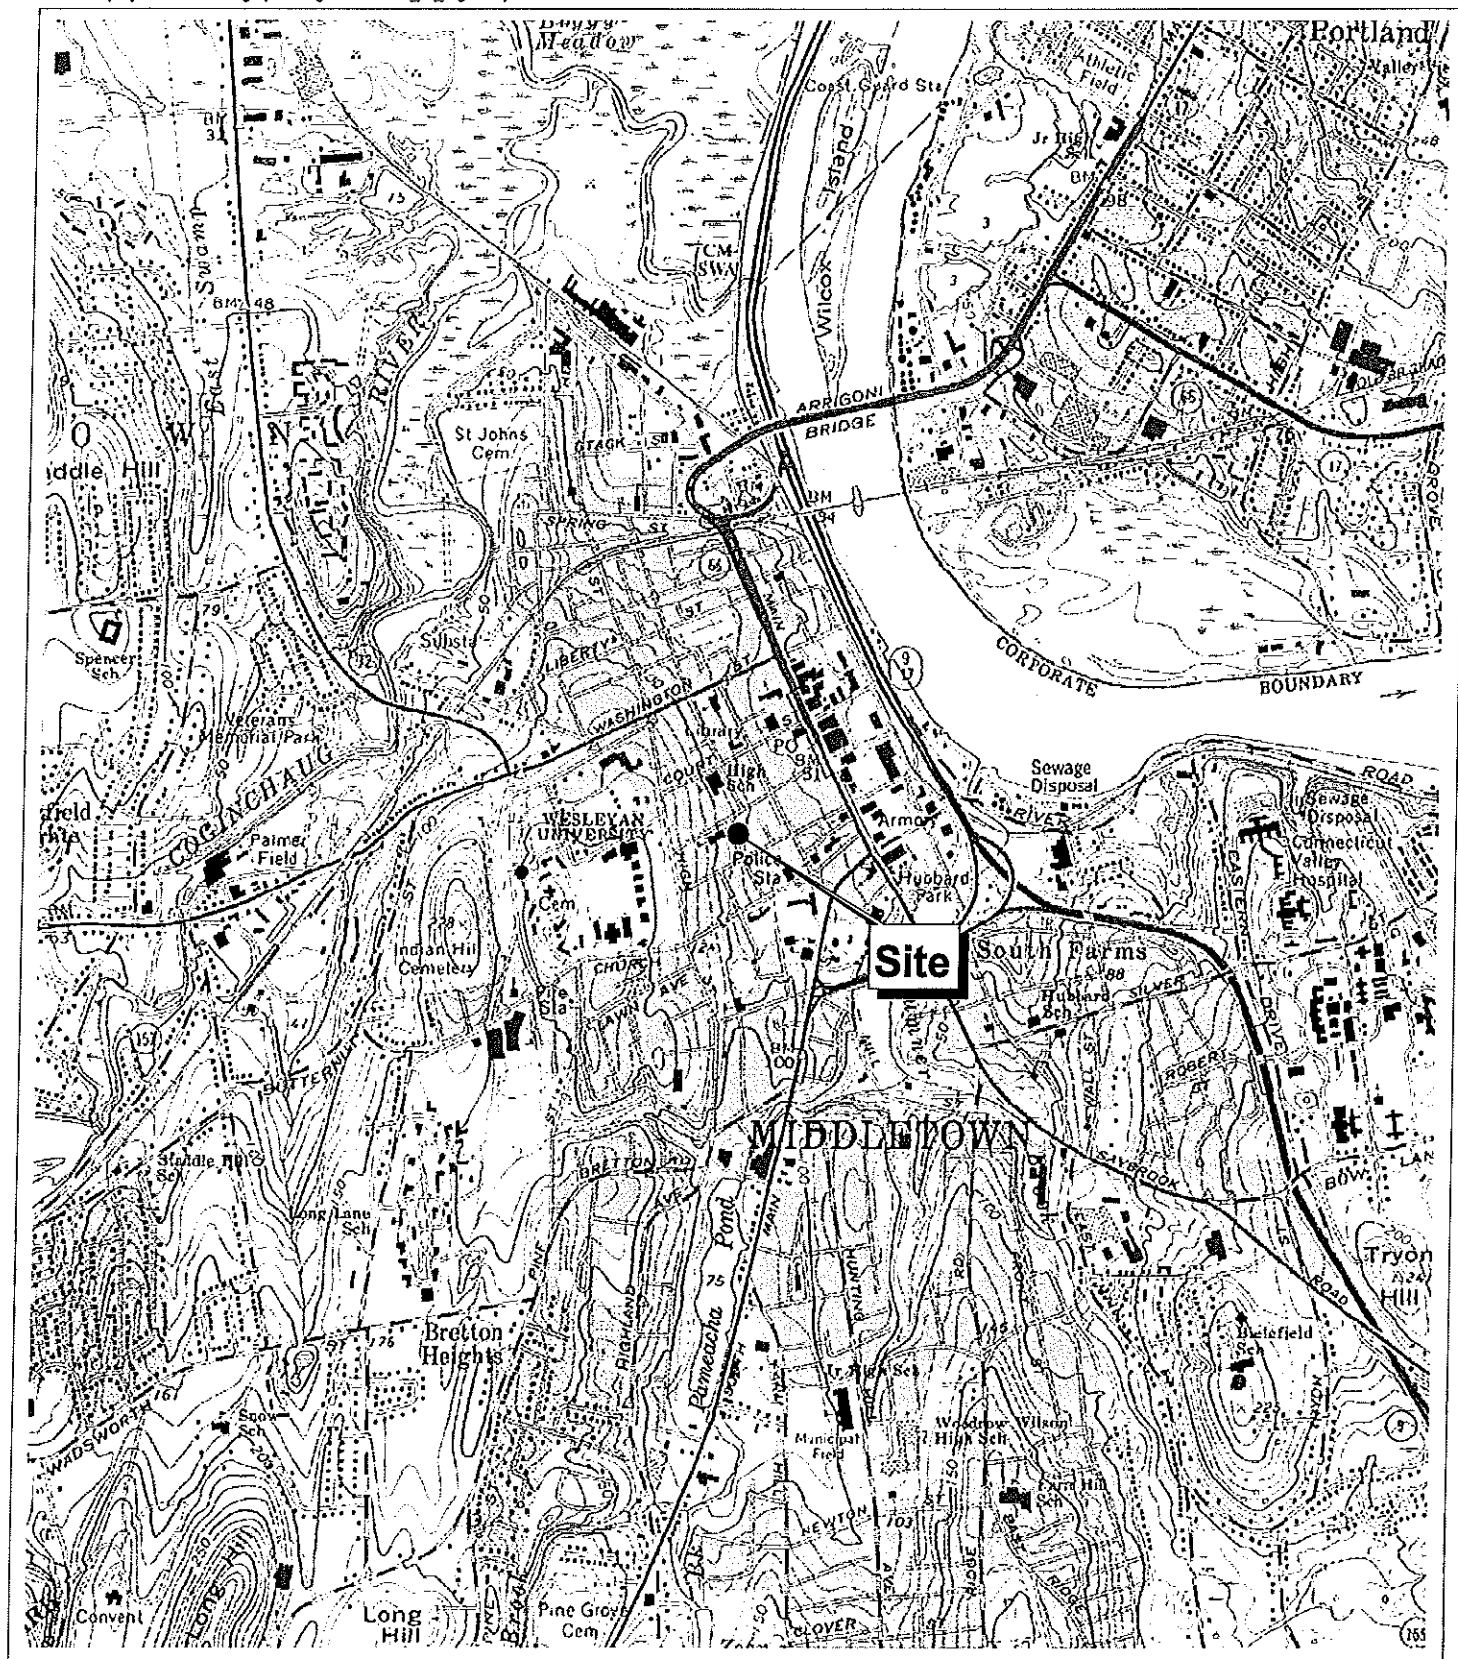


Source: U.S.G.S Quadrangle Middletown, Conn. (1992)


Vanasse Hangen Brustlin, Inc.

**Figure 1**  
**Site Location Map**  
**56 Hamlin Street**  
**Middletown, Connecticut**



Quadrangle Location

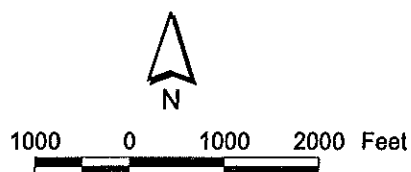

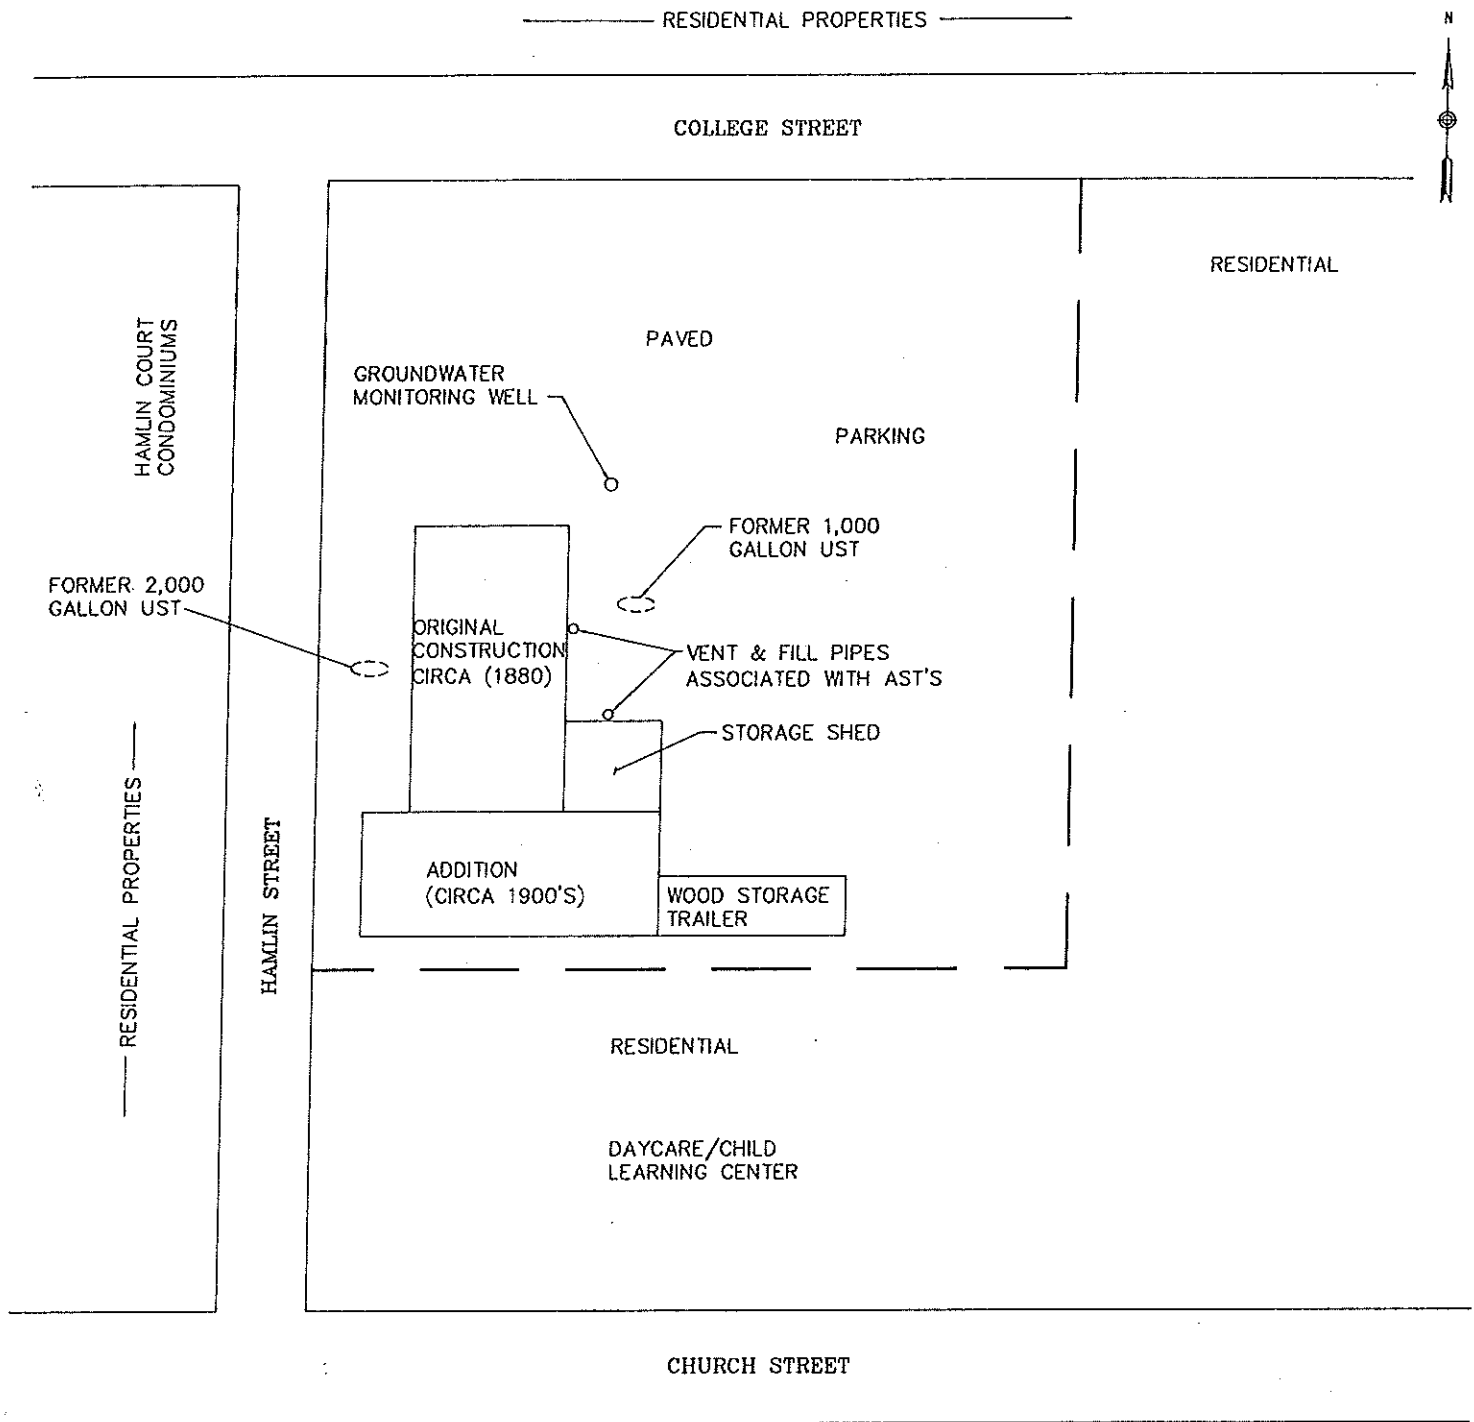

NOT TO SCALE

SOURCE(S):  
ON SITE OBSERVATION

Vanasse Hangen Brustlin, Inc.

56 Hamlin Street  
Middletown, Connecticut

Figure 2  
April 15, 2005

LEGEND

○ UST - UNDERGROUND STORAGE TANK

---

# Appendix A Limitations

---

**56 Hamlin Street****Middletown, Connecticut**

- This report has been prepared for the sole and exclusive use of The City of Middletown, its affiliates and subsidiaries and their successors, assigns and grantees. It is subject to and issued in connection with the Agreement and the provisions thereof. Any use or reliance upon information provided in this report, without the specific written authorization of the Client and VHB, shall be at the User's sole risk.
- In conducting this assessment, VHB has obtained and relied upon information from multiple sources to form certain conclusions regarding potential environmental issues at and in the vicinity of the subject property. Except as otherwise noted, no attempt has been made to verify the accuracy or completeness of such information.
- The objectives of the assessment described in this report were to assess the physical characteristics of the subject property with respect to overt evidence of past or present use, storage, and/or disposal of oil or hazardous materials, as defined in applicable state and federal environmental laws and regulations, and to gather information regarding current and past operations and environmental conditions at and in the vicinity of the subject property.
- No attempt has been made to assess the compliance status of any past or present Owner or Operator of the Site with any federal, state, or local laws or regulations.
- The findings, observations, and conclusions presented in this report are limited by the scope of services outlined in our Agreement, which reflects schedule and budgetary constraints imposed by the Client for the current phase of environmental assessment. Furthermore, the assessment has been performed in accordance with generally accepted engineering practices and standards set forth in ASTM E 1527-00. No other warranty, expressed or implied, is made.
- The assessment presented in this report is based solely upon information gathered to date. Should further environmental or other relevant

information be developed at a later date, Client should bring the information to the attention of VHB as soon as possible. Based upon an evaluation, VHB may modify the report and its conclusions.

- The FirstSearch Technology Corporation Environmental FirstSearch™ Report was conducted under the Notice of Disclaimer/Waiver of Liability included in the summary report.



---

# Appendix B

## Environmental Database Summary Report

# ***FirstSearch Technology Corporation***

## **Environmental FirstSearch<sup>™</sup> Report**

**TARGET PROPERTY:**

**56 HAMLIN ST**

**MIDDLETOWN CT 06457**

**Job Number: 40990.00**

**PREPARED FOR:**

**VHB**

**54 Tuttle Place**

**Middletown, CT 06457**

**03-30-05**



***Tel: (781) 551-0470***

***Fax: (781) 551-0471***

# Environmental FirstSearch Search Summary Report

Target Site: 56 HAMLIN ST  
MIDDLETOWN CT 06457

## FirstSearch Summary

Database	Sel	Updated	Radius	Site	1/8	1/4	1/2	1/2>	ZIP	TOTALS
NPL	Y	02-14-05	1.00	0	0	0	0	0	0	0
CERCLIS	Y	01-18-05	0.50	0	0	0	0	-	0	0
NFRAP	Y	06-23-04	0.25	0	0	0	-	-	0	0
RCRA TSD	Y	02-14-05	0.50	0	0	0	0	-	0	0
RCRA COR	Y	02-14-05	1.00	0	0	0	0	2	0	2
RCRA GEN	Y	02-14-05	0.25	0	1	1	-	-	0	2
ERNS	Y	12-31-04	0.25	0	1	0	-	-	0	1
State Sites	Y	02-22-05	1.00	0	0	1	4	17	0	22
Spills-1990	Y	03-16-05	0.25	0	13	42	-	-	18	73
SWL	Y	01-01-04	0.50	0	0	0	0	-	3	3
REG UST/AST	Y	01-11-05	0.25	1	2	10	-	-	0	13
Leaking UST	Y	03-07-05	0.50	1	6	12	23	-	1	43
- TOTALS -				2	23	66	27	19	22	159

### Notice of Disclaimer

Due to the limitations, constraints, inaccuracies and incompleteness of government information and computer mapping data currently available to FirstSearch Technology Corp., certain conventions have been utilized in preparing the locations of all federal, state and local agency sites residing in FirstSearch Technology Corp.'s databases. All EPA NPL and state landfill sites are depicted by a rectangle approximating their location and size. The boundaries of the rectangles represent the eastern and western most longitudes; the northern and southern most latitudes. As such, the mapped areas may exceed the actual areas and do not represent the actual boundaries of these properties. All other sites are depicted by a point representing their approximate address location and make no attempt to represent the actual areas of the associated property. Actual boundaries and locations of individual properties can be found in the files residing at the agency responsible for such information.

### Waiver of Liability

Although FirstSearch Technology Corp. uses its best efforts to research the actual location of each site, FirstSearch Technology Corp. does not and can not warrant the accuracy of these sites with regard to exact location and size. All authorized users of FirstSearch Technology Corp.'s services proceeding are signifying an understanding of FirstSearch Technology Corp.'s searching and mapping conventions, and agree to waive any and all liability claims associated with search and map results showing incomplete and or inaccurate site locations.

*Environmental FirstSearch  
Site Information Report*

**Request Date:** 03-30-05  
**Requestor Name:** Amy Czerwonka  
**Standard:** ASTM

**Search Type:** COORD  
**Job Number:** 40990.00  
**Filtered Report**

**TARGET ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

*Demographics*

<b>Sites:</b> 159	<b>Non-Geocoded:</b> 22	<b>Population:</b> NA
<b>Radon:</b> 0 - 3.3 PCIL		

*Site Location*

	<u>Degrees (Decimal)</u>	<u>Degrees (Min/Sec)</u>		<u>UTMs</u>
<b>Longitude:</b>	-72.65232	-72:39:8	<b>Easting:</b>	695783.23
<b>Latitude:</b>	41.557248	41:33:26	<b>Northing:</b>	4603068.655
			<b>Zone:</b>	18

*Comment*

**Comment:**

*Additional Requests/Services*

**Adjacent ZIP Codes:** 1 Mile(s)

**Services:**

<u>ZIP</u>					
<u>Code</u>	<u>City Name</u>	<u>ST</u>	<u>Dist/Dir</u>	<u>Sel</u>	
06459	MIDDLETOWN	CT	0.04 NW	Y	
06480	PORTLAND	CT	0.61 NE	Y	

	<u>Requested?</u>	<u>Date</u>
Sanborns	No	
Aerial Photographs	No	
Topographical Maps	No	
City Directories	No	
Title Search	No	
Municipal Reports	No	
Online Topos	No	

# Environmental FirstSearch

## Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
28	LUST	WESLYAN UNIVERSITY 200205603/CLOSED	56 HANLON ST MIDDLETOWN CT 06457	0.02 NE	1
28	LUST	WESLEYAN UNIVERSITY 200105781/CLOSED	56 HAMLIN ST MIDDLETOWN CT 06457	0.02 NE	2
28	SPILLS	WESLEYAN UNIVERSITY 200105781/CLOSED	56 HAMLIN ST MIDDLETOWN CT	0.02 NE	3
28	SPILLS	AUTOMATIC TLC 926575/CLOSED	56 HAMLIN ST MIDDLETOWN CT 06457	0.02 NE	4
28	SPILLS	WESLYAN UNIVERSITY 200205603/CLOSED	56 HANLON ST MIDDLETOWN CT 06457	0.02 NE	6
28	UST	PHYSICAL PLANT 02879	56 HAMLIN ST MIDDLETOWN CT 06457	0.02 NE	7
94	UST	WESLEYAN UNIVERSITY 01389	186 COLLEGE ST. MIDDLETOWN CT 06457	0.03 NE	8
55	LUST	TONY SCHIANO 200405935/CLOSED	180 COLLEGE STREET MIDDLETOWN CT 06457	0.03 NW	11
55	SPILLS	TONY SCHIANO 200405935/CLOSED	180 COLLEGE STREET MIDDLETOWN CT 06457	0.03 NW	12
39	LUST	MIDFIELD CORPORATION 200104817/CLOSED	190 COLLEGE STREET MIDDLETOWN CT 06457	0.04 NE	13
39	SPILLS	MIDFIELD CORPORATION 200104817/CLOSED	190 COLLEGE STREET MIDDLETOWN CT 06457	0.04 NE	14
85	SPILLS	200207253/CLOSED	175 COLLEGE STREET APARTMEN MIDDLETOWN CT 06457	0.06 NE	15
66	LUST	WESLEYAN UNIVERSITY 200106180/CLOSED	170 COLLEGE ST MIDDLETOWN CT 06457	0.07 NE	16
87	SPILLS	925659/CLOSED	11 PEARL ST MIDDLETOWN CT 06457	0.07 NE	17
66	SPILLS	WESLEYAN UNIVERSITY 200106180/CLOSED	170 COLLEGE ST MIDDLETOWN CT	0.07 NE	19
65	LUST	WESLEYAN UNIV.      HARRY KINNE 200105891/CLOSED	212 COLLEGE ST. MIDDLETOWN CT 06457	0.07 SW	20
65	SPILLS	WESLEYAN UNIV.      HARRY KINNE 200105891/CLOSED	212 COLLEGE ST. MIDDLETOWN CT	0.07 SW	21
75	LUST	WESLEYAN UNIVERSITY 1502/YES	POWER PLANT MIDDLETOWN CT 06457	0.09 SW	22
75	SPILLS	WESLYAN UNIVERSITY 924515/CLOSED	WILLIAMS ST/WESLYAN UNIV MIDDLETOWN CT 06457	0.09 SW	23
4	ERNS	SAFETY KLEEN 516006/FIXED FACILITY	250 WILLIAMS ST FORREST CIT MIDDLETOWN CT 06457	0.10 SW	25
4	RCRAGN	FOREST CITY CLEANERS & LAUNDERERS CTD018714303/VGN	250 WILLIAM ST MIDDLETOWN CT 06457	0.10 SW	26

# Environmental FirstSearch Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
4	SPILLS	SAFETY-KLEEN 9606100/CLOSED	250 WILLIAMS STREET MIDDLETOWN CT 06457	0.10 SW	28
4	UST	FOREST CITY CLEANERS 01444	250 WILLIAM ST MIDDLETOWN CT 06457	0.10 SW	29
29	SPILLS	BUCKLEY ENERGY 200200924/CLOSED	280 WILLIAMS ST MIDDLETOWN CT	0.12 SW	30
29	SPILLS	WESLEYAN UNIVERSITY 200110706/CLOSED	280 WILLIAMS STREET MIDDLETOWN CT	0.12 SW	31
23	STATE	SNET 4497/SUSPECTED	70 BROAD STREET MIDDLETOWN CT 06457	0.13 NE	32
23	SPILLS	SNET 200110496/CLOSED	70 BROAD STREET, SNET MIDDLETOWN CT	0.13 NE	34
23	UST	MIDDLETOWN CENTRAL OFFICE (7601) 01419	70 BROAD STREET MIDDLETOWN CT 06457	0.13 NE	35
42	LUST	OLD MIDDLETOWN HIGH SCHOOL ASSOC. 200207512/CLOSED	251 COURT STREET MIDDLETOWN CT 06457	0.13 NW	36
42	SPILLS	OLD MIDDLETOWN HIGH SCHOOL ASSOC. 200207512/CLOSED	251 COURT STREET MIDDLETOWN CT	0.13 NW	37
42	SPILLS	TOWN OF MIDDLETOWN 925658/CLOSED	251 COURT ST MIDDLETOWN CT 06457	0.13 NW	38
36	SPILLS	MARK 4 CONSTRUCTION 9803440/CLOSED	HIGH/WYLLIS ST MIDDLETOWN CT 06457	0.13 NW	40
42	UST	OLD MIDDLETOWN HIGH SCHOOL APTS. 12381	251 COURT STREET MIDDLETOWN CT 06457	0.13 NW	41
83	SPILLS	9805005/CLOSED	BP STATION ON BROAD ST. & W MIDDLETOWN CT 06457	0.13 SE	42
48	LUST	SAA 200105982/CLOSED	237 HIGH STREET MIDDLETOWN CT 06457	0.13 SW	43
48	SPILLS	SAA 200105982/CLOSED	237 HIGH STREET MIDDLETOWN CT	0.13 SW	44
26	SPILLS	AMERICAN RED CROSS 923391/CLOSED	97 BROAD ST MIDDLETOWN CT 06457	0.14 NE	45
44	SPILLS	PRIVATE VEHICLE 200003353/CLOSED	BROAD & COLLEGE ST. MIDDLETOWN CT 06457	0.14 NE	47
49	LUST	SAA 200106448/CLOSED	294 HIGH STREET MIDDLETOWN CT 06457	0.14 NW	48
49	SPILLS	SAA 200106448/CLOSED	294 HIGH STREET MIDDLETOWN CT	0.14 NW	49
43	SPILLS	PETERSON OIL 200201241/CLOSED	272 COURT STREET MIDDLETOWN CT	0.14 NW	51

# Environmental FirstSearch

## Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
91	UST	DIDATO S B.P. 01440	28 BROAD ST. MIDDLETOWN CT 06457	0.14 SE	52
37	SPILLS	MIDDLETOWN POLICE DEPT 91664/CLOSED	CHURCH ST MIDDLETOWN CT 06457	0.15 SE	54
34	LUST	HARBOR HILL CARE CENTER 9905933/CLOSED	111 CHURCH STREET MIDDLETOWN CT 06457	0.16 SE	56
34	SPILLS	HARBOR HILL CARE CENTER 9905933/CLOSED	111 CHURCH STREET MIDDLETOWN CT 06457	0.16 SE	57
34	SPILLS	915172/CLOSED	111 CHURCH ST MIDDLETOWN CT 06457	0.16 SE	59
34	SPILLS	941707/CLOSED	111 CHURCH ST MIDDLETOWN CT 06457	0.16 SE	61
34	UST	HARBOR HILL CARE CENTER 01516	111 CHURCH ST MIDDLETOWN CT 06457	0.16 SE	63
31	SPILLS	TOWN OF MIDDLETOWN RISCOLL LIBRARY 200008159/CLOSED	123 BROAD STREET MIDDLETOWN CT	0.17 NE	64
31	SPILLS	CITY OF MIDDLETOWN 9706499/CLOSED	123 BROAD ST. MIDDLETOWN CT 06457	0.17 NE	65
68	LUST	WESLEYAN UNIVERSITY 200105260/CLOSED	330 HIGH STREET MIDDLETOWN CT 06457	0.17 NW	66
68	SPILLS	WESLEYAN UNIVERSITY 200105260/CLOSED	330 HIGH STREET MIDDLETOWN CT	0.17 NW	67
38	LUST	UNKNOWN 200103432/CLOSED	66 CHURCH STREET MIDDLETOWN CT 06457	0.17 SE	69
38	SPILLS	UNKNOWN 200103432/CLOSED	66 CHURCH STREET MIDDLETOWN CT	0.17 SE	70
82	SPILLS	9604175/CLOSED	66 CHURCH STREET (POLICE DE MIDDLETOWN CT 06457	0.17 SE	71
38	SPILLS	MIDDLETOWN POLICE DEPT 957196/CLOSED	66 CHURCH ST MIDDLETOWN CT 06457	0.17 SE	72
67	SPILLS	WESLEYAN UNIVERSITY 200106252/CLOSED	190 HIGH STREET MIDDLETOWN CT	0.19 SW	74
86	SPILLS	200401639/CLOSED	138 BROAD ST MIDDLETOWN CT 06457	0.20 NE	75
45	LUST	SAA 200205380/CLOSED	WESLYN UNIVERSITY - 327 HIG MIDDLETOWN CT 06457	0.20 NW	76
45	SPILLS	SAA 200205380/CLOSED	WESLYN UNIVERSITY - 327 HIG MIDDLETOWN CT 06457	0.20 NW	77
69	LUST	WESLEYAN UNIVERSITY 200106651/CLOSED	350 HIGH STREET MIDDLETOWN CT 06457	0.21 NW	78

# Environmental FirstSearch Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
69	SPILLS	WESLEYAN UNIVERSITY 200106651/CLOSED	350 HIGH STREET MIDDLETOWN CT	0.21 NW	79
92	UST	FIRST CHURCH OF CHRIST CONGREGATIO 01507	190 COURT ST MIDDLETOWN CT 06457	0.22 NE	80
56	SPILLS	UNKNOWN 200108199/CLOSED	100 RIVERVIEW CENTER MIDDLETOWN CT 06457	0.23 NE	81
90	UST	BOB S, INC. 10095	343 MAIN STREET MIDDLETOWN CT 06457	0.23 NE	82
56	UST	RIVERVIEW CENTER 01527	100 RIVERVIEW CENTER MIDDLETOWN CT 06457	0.23 NE	83
89	UST	BACON BROTHERS INC 01512	359 MAIN ST MIDDLETOWN CT 06457	0.23 NE	84
81	LUST	WESLYAN UNOVERSITY 200105599/CLOSED	CROWELL MUSIC HALL/WESLYAN MIDDLETOWN CT 06457	0.23 NW	85
81	SPILLS	WESLYAN UNOVERSITY 200105599/CLOSED	CROWELL MUSIC HALL/WESLYAN MIDDLETOWN CT	0.23 NW	86
63	LUST	WESLEYAN UNIVERSITY 4136/YES	157 CHURCH STREET MIDDLETOWN CT 06457	0.23 SW	87
63	SPILLS	WESLEYAN UNIV 923578/CLOSED	CHURCH ST MIDDLETOWN CT 06457	0.23 SW	88
63	SPILLS	WESLEYAN UNIVERSITY 943498/CLOSED	157 CHURCH ST MIDDLETOWN CT 06457	0.23 SW	90
63	SPILLS	WESLEYAN UNIVERSITY 93735/CLOSED	CHURCH ST MIDDLETOWN CT 06457	0.23 SW	92
63	SPILLS	WESLEYAN UNIVERSITY 200004886/CLOSED	CHURCH STREET MIDDLETOWN CT 06457	0.23 SW	94
30	LUST	CHURCH OF HOLLY TRINITY 200002786/CLOSED	381 MAIN ST. MIDDLETOWN CT 06457	0.24 NE	95
7	RCRAGN	YOUNGS PRINTING CTR000002956/VGN	182 COURT ST MIDDLETOWN CT 06457	0.24 NE	96
47	SPILLS	SAA 200305074/CLOSED	405 MAIN STREET MIDDLETOWN CT 06457	0.24 NE	98
30	SPILLS	CHURCH OF HOLLY TRINITY 200002786/CLOSED	381 MAIN ST. MIDDLETOWN CT 06457	0.24 NE	99
27	SPILLS	ANATO S 200203212/CLOSED	395 MAIN ST MIDDLETOWN CT	0.24 NE	100
33	SPILLS	FORD NEWS 952915/CLOSED	358 MAIN ST MIDDLETOWN CT 06457	0.24 NE	101
58	SPILLS	VALLEY OIL 9706778/CLOSED	393 MAIN STREET MIDDLETOWN CT 06457	0.24 NE	103



# *Environmental FirstSearch*

## *Sites Summary Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
54	SPILLS	SCHOOL BUS 200103959/CLOSED	CORNER OF MAIN STREET& COLL MIDDLETOWN CT 06457	0.24 NE	104
27	UST	AMATO S INC. 01521	395 MAIN ST MIDDLETOWN CT 06457	0.24 NE	105
35	SPILLS	LEPIETAS BUILDING 951812/CLOSED	392 MAIN ST MIDDLETOWN CT 06457	0.25 NE	106
74	SPILLS	WESLYAN 200106388/CLOSED	95 PEARL ST MIDDLETOWN CT	0.25 NW	108
84	SPILLS	9606589/CLOSED	41 HOTCHKISS STREET MIDDLETOWN CT 06457	0.25 SE	109
57	SPILLS	UNKNOWN SOURCE 9903347/CLOSED	HUBBARD STREET MIDDLETOWN CT 06457	0.25 SE	110
93	UST	NATIONAL GUARD ARMORY 09079	70 MAIN ST MIDDLETOWN CT 06457	0.25 SE	111
64	LUST	WESLEYAN UNIV. 9805125/CLOSED	WESLEYAN UNIV./156 HIGH ST MIDDLETOWN CT 06457	0.25 SW	112
64	SPILLS	WESLEYAN UNIV. 9805125/CLOSED	WESLEYAN UNIV./156 HIGH ST MIDDLETOWN CT 06457	0.25 SW	113
88	SPILLS	200105371/CLOSED	WESLEYAN UNIVERSITY - C-LOT MIDDLETOWN CT	0.25 SW	114
14	STATE	GILLETTI GARAGE & AUTO BODY 4483/SUSPECTED	310 MAIN STREET MIDDLETOWN CT 06457	0.27 NE	115
78	LUST	WESLYAN UNIVERSITY 200106386/CLOSED	159 HIGH ST MIDDLETOWN CT 06457	0.27 SW	117
53	LUST	SAME 200206396/CLOSED	172 WASHINGTON STREET - WES MIDDLETOWN CT 06457	0.28 NW	118
72	LUST	WESLEYAS UNIVERSITY 200105318/CLOSED	132 HIGH ST. MIDDLETOWN CT 06457	0.30 SW	119
60	LUST	WESELYAN UNIVERSITY 200106650/CLOSED	34 LAWN AVENUE MIDDLETOWN CT 06457	0.30 SW	120
80	LUST	WESLYAN UNIVERSITY 200106681/CLOSED	48-50 WYLLYS AVE/WESLYAN UN MIDDLETOWN CT 06457	0.30 SW	121
62	LUST	WESLEYAN U 200106514/CLOSED	240 WASHINGTON ST MIDDLETOWN CT 06457	0.32 NW	122
73	LUST	WESLEYN UNIVERSITY 200106445/CLOSED	128 PEARL STREET MIDDLETOWN CT 06457	0.32 NW	123
59	LUST	WESELYAN UNIVERSITY 200205237/CLOSED	256 WASHINGTON STREET MIDDLETOWN CT 06457	0.33 NW	124
61	LUST	WESLEYAN U 200106512/CLOSED	130 MOUNT VERNON ST MIDDLETOWN CT 06457	0.34 NW	125

# Environmental FirstSearch Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
32	LUST	WESLEYAN UNIVERSITY 200105535/CLOSED	202 WASHINGTON STREET MIDDLETOWN CT 06457	0.34 NW	126
5	LUST	MIDDLESEX HOSPITAL /TIM KAVANAUGH 200207145/CLOSED	8 CRESCENT ST MIDDLETOWN CT 06457	0.36 SE	127
51	LUST	SAA 200404030/CLOSED	WESLEYAN UNIVERSITY 125 MOU MIDDLETOWN CT 06457	0.37 NW	128
46	LUST	TOWN 200008459/CLOSED	TOWN HALL MIDDLETOWN CT 06457	0.38 NE	129
40	LUST	MR. SARACENO 200107179/CLOSED	143 LIBERTY ST MIDDLETOWN CT 06457	0.42 NW	130
77	LUST	WESLYAN UNIVERSITY 200305734/CLOSED	36 MANSFIELD TERRACE MIDDLETOWN CT 06457	0.43 SW	131
50	LUST	SAA 200106450/CLOSED	48 HOME AVE MIDDLETOWN CT 06457	0.45 SW	132
70	LUST	WESLEYAN UNIVERSITY(DAVID HALL) 200105900/CLOSED	346 WASHINGTON ST MIDDLETOWN CT 06457	0.46 NW	133
16	STATE	JAS MUFFLER, INC. 4484/SUSPECTED	380 WASHINGTON STREET MIDDLETOWN CT 06457	0.46 NW	134
6	STATE	MIDDLETOWN PRESS PUBLISHING 4488/SUSPECTED	2 MAIN STREET MIDDLETOWN CT 06457	0.46 SE	136
76	LUST	WESLYAN UNIVERSITY 200205602/CLOSED	69 HIGH S/WESLYAN UNIV. MIDDLETOWN CT 06457	0.47 SW	139
52	LUST	SAINT PAUL LUTHERAN CHURCH 200407828/CLOSED	76 HIGH STREET MIDDLETOWN CT 06457	0.48 SW	140
17	LUST	THE CONNECTION INC. 4418/YES	605 MAIN STREET MIDDLETOWN CT 06457	0.49 NE	141
17	STATE	LIBERTY LTD. PARTNERSHIP 2526/SUSPECTED	605 MAIN STREET MIDDLETOWN CT 06457	0.49 NE	142
71	LUST	WESLEYAN UNIVERSITY--DAVE HALL 200205379/CLOSED	356 WASHINGTON STREET MIDDLETOWN CT 06457	0.49 NW	143
41	LUST	TILLER ASSOCIATES 200108767/CLOSED	127 GRAND STREET MIDDLETOWN CT 06457	0.49 NW	144
79	LUST	WESLYAN UNIVERSITY 200106226/CLOSED	49 BRAINARD AVE MIDDLETOWN CT 06457	0.50 SW	145
21	STATE	ROUTE 17 OVERPASS 3261/SUSPECTED	UNDER THE OVERPASS SOUTH OF MIDDLETOWN CT 06457	0.52 SE	146
8	STATE	C. B. STONE INC. 4477/SUSPECTED	53 WARWICK STREET MIDDLETOWN CT 06457	0.56 SE	147
9	STATE	CL&P 1007/SUSPECTED	DEKOVEN DRIVE MIDDLETOWN CT 06457	0.59 NE	149

# *Environmental FirstSearch*

## *Sites Summary Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
3	RCRACOR	NORTH & JUDD INC CTD021814207/CA	56 PAMEACHA AVE MIDDLETOWN CT 06457	0.64 SW	150
3	STATE	NORTH & JUDD FOUNDRY 236/SUSPECTED	56 PAMEACHA AVENUE MIDDLETOWN CT 06457	0.64 SW	153
1	STATE	MARINO PROPERTY 950/SUSPECTED	50 WALNUT STREET MIDDLETOWN CT 06457	0.71 SE	155
18	STATE	LONGWORTH-CARLSON INC. 4485/SUSPECTED	55 NORTH MAIN STREET MIDDLETOWN CT 06457	0.75 NW	157
11	STATE	CT VALLEY COACH & FRAME, LTD. 4479/SUSPECTED	52 NORTH MAIN STREET MIDDLETOWN CT 06457	0.75 NW	159
20	STATE	REMINGTON RAND FACILITY 2595/SUSPECTED	180 JOHNSON STREET MIDDLETOWN CT 06457	0.77 NW	161
13	STATE	EGETER BATTERY CO. 4481/SUSPECTED	90 NORTH MAIN STREET MIDDLETOWN CT 06457	0.78 NW	162
22	STATE	SHUCK PETROLEUM 2689/SUSPECTED	405 SOUTH MAIN STREET MIDDLETOWN CT 06457	0.81 SE	164
19	STATE	PALMER FIELD 754/SUSPECTED	BERNIE O ROURKE DRIVE MIDDLETOWN CT 06457	0.85 SW	165
12	STATE	CUMBERLAND FARMS PROPERTY 1948/SUSPECTED	533 WASHINGTON STREET MIDDLETOWN CT 06457	0.85 SW	166
24	STATE	SUNOCO # 0266-2138 2282/SUSPECTED	427 SOUTH MAIN STREET MIDDLETOWN CT 06457	0.88 SE	167
25	STATE	TOWN YARD 790/SUSPECTED	THAMES STREET MIDDLETOWN CT 06457	0.90 SW	168
15	STATE	JACKSON CORRUGATED CONTAINER 233/SUSPECTED	RIVER ROAD MIDDLETOWN CT 06457	0.92 NE	169
2	RCRACOR	FENNER AMERICAN LTD CTD052542669/CA	400 E MAIN ST MIDDLETOWN CT 06457	0.98 SE	170
2	STATE	FENNER AMERICA, LTD. 707/SUSPECTED	400 EAST MAIN STREET MIDDLETOWN CT 06457	0.98 SE	173
10	STATE	CONNECTICUT DEPARTMENT OF CHILDREN 3747/SUSPECTED	170 LONG LANE MIDDLETOWN CT 06457	0.98 SW	176

# Environmental FirstSearch

## Sites Summary Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	LUST	HUDSON UNITED BANK 200202979/CLOSED	128-134 MAIN ST. EXT. MIDDLETOWN CT	NON GC	N/A
	SPILLS	9907876/CLOSED	600 COLLEGE ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	200403725/CLOSED	MAIN ST AND RT 66 MIDDLETOWN CT	NON GC	N/A
	SPILLS	NORTHEAST UTILITIES 925631/CLOSED	MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	DANIELS OIL 926221/CLOSED	SOUTH MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	DIDANO S FUEL OIL 9900854/CLOSED	NEW BROAD ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	HUDSON UNITED BANK 200202979/CLOSED	128-134 MAIN ST. EXT. MIDDLETOWN CT	NON GC	N/A
	SPILLS	921036/CLOSED	RT 17/SOUTH MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	200203069/CLOSED	84 MAIN STREET EXTENSION MIDDLETOWN CT	NON GC	N/A
	SPILLS	NORTHEAST UTILITIES 944403/CLOSED	SOUTH MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	SAME 9804173/CLOSED	MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	UNKNOWN MOTORIST 200206740/CLOSED	HIGH STREET AREA MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	9902834/CLOSED	MAIN STREET MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	9806765/CLOSED	WESYLAN HILLS (OFF RT 17 SO MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	946220/CLOSED	SOUTH MAIN ST MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	C.L. & P 9902753/CLOSED	CHURCH STREET MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	200300040/CLOSED	OLD FARM RD/ SOUTH MAIN ST MIDDLETOWN CT	NON GC	N/A
	SPILLS	NORTHEAST UTILITIES 926034/CLOSED	SOUTH MAIN ST EXT MIDDLETOWN CT 06457	NON GC	N/A
	SPILLS	NORTHEAST UTILITIES 952811/CLOSED	HIGH ST MIDDLETOWN CT 06457	NON GC	N/A
	SWL	MIDDLETOWN, CITY OF CTSW-PE-01-104/PERMIT	JOHNSON/NORTH MAIN STREET MIDDLETOWN CT	NON GC	N/A

***Environmental FirstSearch  
Sites Summary Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**TOTAL:** 159      **GEOCODED:** 137      **NON GEOCODED:** 22      **SELECTED:** 1

Map ID	DB Type	Site Name/ID/Status	Address	Dist/Dir	Page No.
	SWL	CTSW-CL-01-90/CLOSED	NEWFIELD STREET MIDDLETOWN CT	NON GC	N/A
	SWL	CTSW-CL-01-88/CLOSED	HIGH ST & CT RIVER MIDDLETOWN CT	NON GC	N/A



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 133

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 56 HANLON ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205603  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2002  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLYAN UNIVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/14/2002 4:20:35 PM  
**REPORTED BY:** CHRISTINE MATHERLY  
**REPORTER S PHONE:** 5298882

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF 2K UST

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 123

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105781  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/2/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLEYAN UNIVERSITY  
186 college st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** GASOLINE 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/2/2001 10:49:56 AM  
**REPORTED BY:** SIDNEY MBER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** LUST REMOVED MID 90 S, LEVEL BELOW RSR IN PPB, 1000G LUST, REEXCAVATION AND  
**TESTING SHOWED THESE PREVIOUSLY UNREPORTED CONTAMINANTS**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 62

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105781  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/2/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** WESLEYAN UNIVERSITY  
186 college st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/2/2001 10:49:56 AM  
**REPORTED BY:** SIDNEY MEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** GASOLINE  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** LUST REMOVED MID 90 S, LEVEL BELOW RSR IN PPB, 1000G LUST, REEXCAVATION AND TESTING  
SHOWED THESE PREVIOUSLY UNREPORTED CONTAMINANTS

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 30

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** AUTOMATIC TLC  
**ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT  
**CONTACT:** AUTOMATIC TLC

**REV:** 3/13/01  
**ID1:** 926575  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 12/23/92  
**ACTUAL TIME:** 12  
**REPORTER:** ALEXANDER PSECHMICK  
AUTOMATIC TLC  
64 OAKLAND AVE  
EAST HARTFORD CT

**REPORT TIME:** 9

**WORK PHONE:** 203 568 1200

**HOME PHONE:**

**POLE NUMBER:**

**INCIDENT TYPE:** PETROLEUM

**GALLONS:** 1

**POUNDS:**

**DRUMS:**

**CERCLA:**

**EMERGENCY CLEANUP:**

**TOTAL POUNDS:**

**DISCHARGED:** POWER STEERING FLUID

**YARDS:**

**CON:**

**FEDRAL:**

**ACROSS PROPERTY LINES:**

**REP QUAN:**

**DESCRIPTION:**

**DATE:** 12/23/92

**CONTINUOUS SPILL:**

**RELEASE TERMINATED:** Y

**UNKNOWN:**

**DATE UNKNOWN:**

**SPILL TIME:** 90

**ONGOING RELEASE:**

**CONTAINED:** Y

**ADDITIONAL INFORMATION:**

**WATERBODY:**

**LIS:**

**CATCH BASIN:**

**AIR:**

**GROUND WATER:**

**INSIDE BUILDING:**

**TOTAL IN WATER:**

**TOTAL RECOVERED:**

**RESPONSIBLE PARTY:** AUTOMATIC TLC  
64 OAKLAND ST  
EAST HARTFORD CT

**RIVER:**

**TRIBUTARY:**

**POND:**

**SURFACE WATER:**

**GROUND SURFACE:** Y

**OTHER AREA:**

**TOTAL RECOVERED FROM WATER:**

**PHONE:**

**POLLUTER UNKNOWN:**

**CLEANUP ACTION TAKEN:**

**DUN BRAD:**

**NOTIFIED COAST GAURD:**

**NOTIFIED LOCAL FIRE DEPT:**

**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y

**NOTIFIED FEDERAL GOVERNMENT:**

**NOTIFIED FIRE MARSHALL:** Y

**NOTIFIED POLICE:**

**NOTIFIED AQUACULTURE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 30

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** AUTOMATIC TLC  
**ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 926575  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** AUTOMATIC TLC

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**CAUSE:** HOSE FAILURE

**CORRECTIVE ACTION TAKEN:** CONTAINED/REMOVED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** PORTER  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 71

**DIST/DIR:** 0.02 NE

**MAP ID:** 28

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 56 HANLON ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200205603  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2002

**TIME OF RELEASE:**

**ACTION:** REMOVED TANK

**DISHCHARGER:** WESLYAN UNIVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/14/2002 4:20:35 PM  
**REPORTED BY:** CHRISTINE MATHERLY  
**REPORTER S PHONE:** 5298882

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** REMOVAL OF 2K UST

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

<b>SEARCH ID:</b> 93	<b>DIST/DIR:</b> 0.02 NE	<b>MAP ID:</b> 28
----------------------	--------------------------	-------------------

**NAME:** PHYSICAL PLANT  
**ADDRESS:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 02879  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 1

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b> 1/1/1950	<b>DATE LAST USED:</b> 8/1/1997
<b>SUBSTANCE STORED:</b> GASOLINE	<b>CAPACITY (GALS):</b> 1000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> UNKNOWN	<b>PIPE PROTECTION:</b> NONE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 95                      **DIST/DIR:** 0.03 NE                      **MAP ID:** 94

<b>NAME:</b> WESLEYAN UNIVERSITY <b>ADDRESS:</b> 186 COLLEGE ST. MIDDLETOWN CT 06457	<b>REV:</b> 1/11/05 <b>ID1:</b> 01389 <b>ID2:</b> <b>STATUS:</b> <b>PHONE:</b>
<b>CONTACT:</b>	

**TOTAL NUMBER OF TANKS:** 18

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 2/1/1973 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 6/1/1992 <b>CAPACITY (GALS):</b> 30000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	--

**TANK ID:** 10  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b> 1/1/1950 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 2/1/1988 <b>CAPACITY (GALS):</b> 3000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	---

**TANK ID:** 11  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 6/1/1969 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 9/1/1988 <b>CAPACITY (GALS):</b> 3000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	---

**TANK ID:** 12  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b> 1/1/1950 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 7/1/1989 <b>CAPACITY (GALS):</b> 5000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	---

**TANK ID:** 13  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 1/1/1950 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 3/1/1989 <b>CAPACITY (GALS):</b> 3000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	---

**TANK ID:** 14  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

- Continued on next page -

# Environmental FirstSearch Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

## REGISTERED UNDERGROUND STORAGE TANKS

**SEARCH ID:** 95                      **DIST/DIR:** 0.03 NE                      **MAP ID:** 94

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 186 COLLEGE ST.  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01389  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

<b>DATE INSTALLED:</b> 1/1/1950 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 12/1/1983 <b>CAPACITY (GALS):</b> 3000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	--

**TANK ID:** 15  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b> 1/1/1950 <b>SUBSTANCE STORED:</b> GASOLINE <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 6/1/1996 <b>CAPACITY (GALS):</b> 2000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
--	---

**TANK ID:** 16  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b> 8/1/1992 <b>SUBSTANCE STORED:</b> DIESEL <b>TANK MATERIAL:</b> CATHODICALLY PROTECTED STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> <b>CAPACITY (GALS):</b> 550 <b>TANK PROTECTION:</b> DOUBLE-WALLED <b>PIPE PROTECTION:</b> NONE
--	--

**TANK ID:** 17  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b> 1/1/1987 <b>SUBSTANCE STORED:</b> GASOLINE <b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 1/1/1998 <b>CAPACITY (GALS):</b> 1000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
--	---

**TANK ID:** 18  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b> 1/1/1987 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> CATHODICALLY PROTECTED STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> 6/3/2003 <b>CAPACITY (GALS):</b> 20000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> NONE
---	--

**TANK ID:** 2  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b> 12/1/1992 <b>SUBSTANCE STORED:</b> HEATING OIL <b>TANK MATERIAL:</b> CATHODICALLY PROTECTED STEEL <b>PIPE MATERIAL:</b> BARE STEEL	<b>DATE LAST USED:</b> <b>CAPACITY (GALS):</b> 30000 <b>TANK PROTECTION:</b> NONE <b>PIPE PROTECTION:</b> SECONDARY CONTAINMENT
--	--

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 95

**DIST/DIR:** 0.03 NE

**MAP ID:** 94

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 186 COLLEGE ST.  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01389  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TANK ID:** 3  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 2/1/1973	<b>DATE LAST USED:</b> 6/1/1992
<b>SUBSTANCE STORED:</b> HEATING OIL	<b>CAPACITY (GALS):</b> 30000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> NONE

**TANK ID:** 4  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b> 12/1/1992	<b>DATE LAST USED:</b>
<b>SUBSTANCE STORED:</b> HEATING OIL	<b>CAPACITY (GALS):</b> 30000
<b>TANK MATERIAL:</b> CATHODICALLY PROTECTED STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> SECONDARY CONTAINMENT

**TANK ID:** 5  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 1/1/1950	<b>DATE LAST USED:</b> 8/1/1987
<b>SUBSTANCE STORED:</b> GASOLINE	<b>CAPACITY (GALS):</b> 20000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> NONE

**TANK ID:** 6  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 1/1/1950	<b>DATE LAST USED:</b> 8/1/1987
<b>SUBSTANCE STORED:</b> GASOLINE	<b>CAPACITY (GALS):</b> 20000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> NONE

**TANK ID:** 7  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b> 1/1/1959	<b>DATE LAST USED:</b> 3/1/1989
<b>SUBSTANCE STORED:</b> HEATING OIL	<b>CAPACITY (GALS):</b> 5000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> NONE

**TANK ID:** 8  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

- More Details Exist For This Site; Max Page Limit Reached -



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 111

**DIST/DIR:** 0.03 NW

**MAP ID:** 55

**NAME:** TONY SCHIANO  
**ADDRESS:** 180 COLLEGE STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200405935  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/27/2004  
**TIME OF RELEASE:**

**DISCHARGER:** TONY SCHIANO  
CT

**DISCHARGER S PHONE:** 203 4571461  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/27/2004 12:16:33 PM  
**REPORTED BY:** JIM WICKAM  
**REPORTER S PHONE:** 4817668

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** 1000 GAL LUST, NO FREE PRODUCT OR GROUNDWATER, MINOR CONTAMINATION,  
**REMEDATION TO OCCUR**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 51

**DIST/DIR:** 0.03 NW

**MAP ID:** 55

**NAME:** TONY SCHIANO  
**ADDRESS:** 180 COLLEGE STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200405935  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/27/2004  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISCHARGER:** TONY SCHIANO  
CT

**DISCHARGER S PHONE:** 4571461  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/27/2004  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISCHARGER:** TONY SCHIANO  
CT

**DISCHARGER S PHONE:** 4571461  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/27/2004  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** TONY SCHIANO  
CT

**DISCHARGER S PHONE:** 4571461  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/27/2004 12:16:33 PM  
**REPORTED BY:** JIM WICKAM  
**REPORTER S PHONE:** 4817668

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 1000 GAL LUST, NO FREE PRODUCT OR GROUNDWATER, MINOR CONTAMINATION, REMEDIATION TO OCCUR

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 99

**DIST/DIR:** 0.04 NE

**MAP ID:** 39

**NAME:** MIDFIELD CORPORATION  
**ADDRESS:** 190 COLLEGE STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200104817  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 6/29/2001  
**TIME OF RELEASE:**

**DISCHARGER:** MIDFIELD CORPORATION  
213 COURT STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6385189  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 6/29/2001 3:25:24 PM  
**REPORTED BY:** JEFF MERK  
**REPORTER S PHONE:** 3421559

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**EMERGENCY MEASURES:** 550 LUST, TANK REMOVED, NO GROUND WATER OR FREE PRODUCT, CITY WATER,  
**REMEDATION TO OCCUR**

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 40

**DIST/DIR:** 0.04 NE

**MAP ID:** 39

**NAME:** MIDFIELD CORPORATION  
**ADDRESS:** 190 COLLEGE STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200104817  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 6/29/2001  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISCHARGER:** MIDFIELD CORPORATION  
213 COURT STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6385189  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 6/29/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** MIDFIELD CORPORATION  
213 COURT STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6385189  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 6/29/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISCHARGER:** MIDFIELD CORPORATION  
213 COURT STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6385189  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 6/29/2001 3:25:24 PM  
**REPORTED BY:** JEFF MERK  
**REPORTER S PHONE:** 3421559

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 550 LUST, TANK REMOVED, NO GROUND WATER OR FREE PRODUCT, CITY WATER, REMEDIATION TO OCCUR

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 77

**DIST/DIR:** 0.06 NE

**MAP ID:** 85

**NAME:**  
**ADDRESS:** 175 COLLEGE STREET APARTMENT 1F  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200207253  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** CAPUANO, MIKE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/15/2002  
**TIME OF RELEASE:** 8:28:00 PM  
**ACTION:** NONE REQUIRED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 10/15/2002 8:28:59 PM  
**REPORTED BY:** JESSICA STEELE  
**REPORTER S PHONE:** 3439222

**MATERIAL RELEASED:** METALLIC BEADS  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** NONE REQUIRED NOT MERCURY

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 122

**DIST/DIR:** 0.07 NE

**MAP ID:** 66

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 170 COLLEGE ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106180  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN UNIVERSITY  
college st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/14/2001 12:14:36 PM  
**REPORTED BY:** PETE CANOVA  
**REPORTER S PHONE:** 5842085

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** 550 LUST, SOIL REMOVAL

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 81                      **DIST/DIR:** 0.07 NE                      **MAP ID:** 87

<b>NAME:</b> <b>ADDRESS:</b> 11 PEARL ST MIDDLETOWN CT	<b>REV:</b> 3/13/01 <b>ID1:</b> 925659 <b>ID2:</b> <b>STATUS:</b> CLOSED <b>PHONE:</b>
<b>CONTACT:</b>	

**SITE INFORMATION**

<b>INSPECTOR S BADGE NUMBER:</b> NR		
<b>REPORT DATE:</b> 11/05/92	<b>REPORT TIME:</b>	22
<b>ACTUAL TIME:</b> 26		
<b>REPORTER:</b> FIRE DEPT		

<b>WORK PHONE:</b> 203 346 8623		
<b>HOME PHONE:</b>		
<b>POLE NUMBER:</b>		
<b>INCIDENT TYPE:</b> PETROLEUM	<b>DISCHARGED:</b>	GASOLINE
<b>GALLONS:</b> 1	<b>YARDS:</b>	
<b>POUNDS:</b>	<b>CON:</b>	
<b>DRUMS:</b>	<b>FEDRAL:</b>	
<b>CERCLA:</b>	<b>ACROSS PROPERTY LINES:</b>	
<b>EMERGENCY CLEANUP:</b>	<b>REP QUAN:</b>	
<b>TOTAL POUNDS:</b>		

**DESCRIPTION:**

<b>DATE:</b> 11/05/92	<b>DATE UNKNOWN:</b>
<b>CONTINUOUS SPILL:</b>	<b>SPILL TIME:</b>
<b>RELEASE TERMINATED:</b>	<b>ONGOING RELEASE:</b>
<b>UNKNOWN:</b>	<b>CONTAINED:</b>

**ADDITIONAL INFORMATION:**

<b>WATERBODY:</b>	<b>RIVER:</b>
<b>LIS:</b>	<b>TRIBUTARY:</b>
<b>CATCH BASIN:</b> Y	<b>POND:</b>
<b>AIR:</b>	<b>SURFACE WATER:</b> Y
<b>GROUND WATER:</b>	<b>GROUND SURFACE:</b>
<b>INSIDE BUILDING:</b>	<b>OTHER AREA:</b>
<b>TOTAL IN WATER:</b>	<b>TOTAL RECOVERED FROM WATER:</b>
<b>TOTAL RECOVERED:</b> 1	
<b>RESPONSIBLE PARTY:</b>	

<b>PHONE:</b>	<b>ACCEPT RESPONSIBILITY:</b>
<b>POLLUTER UNKNOWN:</b>	
<b>CLEANUP ACTION TAKEN:</b> FLUSHED	
<b>DUN BRAD:</b>	<b>NOTIFIED FEDERAL GOVERNMENT:</b>
<b>NOTIFIED COAST GAURD:</b>	<b>NOTIFIED FIRE MARSHALL:</b>
<b>NOTIFIED LOCAL FIRE DEPT:</b>	<b>NOTIFIED POLICE:</b>
<b>NOTIFIED ATTORNEY GENERAL:</b>	<b>NOTIFIED AQUACULTURE:</b>

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 81

**DIST/DIR:** 0.07 NE

**MAP ID:** 87

**NAME:**  
**ADDRESS:** 11 PEARL ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 925659  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:**

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

PRIVATE

**CAUSE:**

DUMPING

**CORRECTIVE ACTION TAKEN:**

DISSIPATED EVAPORATED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** KELLEY  
**ASSIGNED DATE:** 11/05/92  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:** 21 27  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 61

**DIST/DIR:** 0.07 NE

**MAP ID:** 66

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 170 COLLEGE ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200106180  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2001  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISCHARGER:** WESLEYAN UNIVERSITY  
college st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** WESLEYAN UNIVERSITY  
college st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 8/14/2001 12:14:36 PM  
**REPORTED BY:** PETE CANOVA  
**REPORTER S PHONE:** 5842085

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 10 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 550 LUST, SOIL REMOVAL

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 119                      **DIST/DIR:** 0.07 SW                      **MAP ID:** 65

<b>NAME:</b> WESLEYAN UNIV.    HARRY KINNE DIR. <b>ADDRESS:</b> 212 COLLEGE ST. MIDDLETOWN CT 06457	<b>REV:</b> 3/7/05 <b>ID1:</b> 200105891 <b>ID2:</b> <b>STATUS:</b> CLOSED <b>PHONE:</b>
<b>CONTACT:</b> NO RESPONSE	

**SITE INFORMATION**

**DATE OF RELEASE:** 8/1/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLEYAN UNIV.    HARRY KINNE DIR. FACILITIES  
SAME  
CT

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8:30:00 AM  
**REPORTED BY:** SIDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 20 - OTHER  
**OTHER:** PREVIOUSLY

**EMERGENCY MEASURES:** 550 UST PULLED MANY YEARS AGO IN GB AREA/ HUMAN RESOURCES BUILDING

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 60

**DIST/DIR:** 0.07 SW

**MAP ID:** 65

**NAME:** WESLEYAN UNIV. HARRY KINNE DIR. FACILITIES  
**ADDRESS:** 212 COLLEGE ST.  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105891  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/1/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** WESLEYAN UNIV. HARRY KINNE DIR. FACILITIES  
SAME  
CT

**DISCHARGER S PHONE:** 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/1/2001  
**TIME OF RELEASE:**  
**ACTION:** OTHER

**DISCHARGER:** WESLEYAN UNIV. HARRY KINNE DIR. FACILITIES  
SAME  
CT

**DISCHARGER S PHONE:** 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8:30:00 AM  
**REPORTED BY:** SIDNEY NEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 550 UST PULLED MANY YEARS AGO IN GB AREA/ HUMAN RESOURCES BUILDING

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 121                      **DIST/DIR:** 0.09 SW                      **MAP ID:** 75

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** POWER PLANT  
MIDDLETOWN CT 06457

**REV:**  
**ID1:** 1502  
**ID2:**  
**STATUS:** YES  
**PHONE:**

**CONTACT:**

**REPORT DATE:** 09-10-92  
**MATERIAL:** STBEL  
**LOW CAPACITY:** 30000  
**PRODUCT:** HF6

**FED REG:** NO  
**NUMBER OF TANKS:** 1  
**HIGH CAPACITY:** 30000

**TANK REMOVED:** YES                      **UNCONTROLLED RELEASE:** YES                      **EMERGENCY:** UNK  
**TANK RELEASE:**                      **PIPING RELEASE:** UNK                      **OVERFILL RELEASE:** UNK

**REMEDATION:** SOIL REMOVAL                      **COMPLETE:** YES  
**REFERRED:**  
**COMMENT:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 72                      **DIST/DIR:** 0.09 SW                      **MAP ID:** 75

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** WILLIAMS ST/WESLYAN UNIV  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 924515  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLYAN UNIVERSITY

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 917  
**REPORT DATE:** 09/09/92  
**ACTUAL TIME:** 0  
**REPORTER:** TIM GAZDA  
C P UTILITIES  
119 SANFORD  
HAMDEN CT 6514

**REPORT TIME:** 16

**WORK PHONE:** 203 248 8612

**HOME PHONE:**

**POLE NUMBER:**

**INCIDENT TYPE:** PETROLEUM

**GALLONS:**

**POUNDS:**

**DRUMS:**

**CERCLA:**

**EMERGENCY CLEANUP:**

**TOTAL POUNDS:**

**DISCHARGED:** #6 OIL

**YARDS:**

**CON:**

**FEDRAL:**

**ACROSS PROPERTY LINES:**

**REP QUAN:**

**DESCRIPTION:**

**DATE:**

**CONTINUOUS SPILL:**

**RELEASE TERMINATED:**

**UNKNOWN:**

**DATE UNKNOWN:** Y

**SPILL TIME:**

**ONGOING RELEASE:**

**CONTAINED:**

**ADDITIONAL INFORMATION:**

**WATERBODY:**

**LIS:**

**CATCH BASIN:**

**AIR:**

**GROUND WATER:**

**INSIDE BUILDING:**

**TOTAL IN WATER:**

**TOTAL RECOVERED:**

**RESPONSIBLE PARTY:** WESLYAN UNIVERSITY

**RIVER:**

**TRIBUTARY:**

**POND:**

**SURFACE WATER:**

**GROUND SURFACE:** Y

**OTHER AREA:**

**TOTAL RECOVERED FROM WATER:**

**PHONE:**

**POLLUTER UNKNOWN:**

**CLEANUP ACTION TAKEN:** TANK/SOIL REMOVED

**DUN BRAD:**

**NOTIFIED COAST GAURD:**

**NOTIFIED LOCAL FIRE DEPT:**

**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y

**NOTIFIED FEDERAL GOVERNMENT:**

**NOTIFIED FIRE MARSHALL:**

**NOTIFIED POLICE:**

**NOTIFIED AQUACULTURE:**

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### STATE SPILLS SITE

**SEARCH ID:** 72

**DIST/DIR:** 0.09 SW

**MAP ID:** 75

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** WILLIAMS ST/WESLYAN UNIV  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 924515  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLYAN UNIVERSITY

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:** 160  
**DISCHARGE CLASS:** PRIVATE

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:** Y  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:** 09/09/92

**CAUSE:** INGROUND TANK FAILURE OVERFILL

**CORRECTIVE ACTION TAKEN:** PUMPED OUT REMOVED TANK SOIL REMOVAL

**CONTRACTOR:** Y  
**DID DEP HIRE CONT:** N  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** YORKE  
**ASSIGNED DATE:** 09/09/92

**CONT NAME:** C P UTILITIES  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 917  
**ASSIGNED TIME:** 16 15

#### TANK INFORMATION

**TANK 1 SIZE:** 30000  
**PRODUCT:**  
**OVERFILL:**  
**TANK:**  
**REMED:**  
**REFER:**

**LEAK:**  
**EMERGENCY:**  
**REMOVAL:**  
**PIPING:**  
**COMPLET:**

**TANK 2 SIZE:** 30000  
**PRODUCT:**  
**OVERFILL:**  
**TANK:**  
**REMED:**  
**REFER:**

**LEAK:**  
**EMERGENCY:**  
**REMOVAL:**  
**PIPING:**  
**COMPLET:**

**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:** Y  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 72

**DIST/DIR:** 0.09 SW

**MAP ID:** 75

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** WILLIAMS ST/WESLYAN UNIV  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 924515  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLYAN UNIVERSITY

**DATE UPDATED:** 09/09/92  
**QUAN FET:**

**COPY:** 2

**MISCELLANEOUS INFORMATION:** (2) 30K TANKS REMOVED 2K YDS SOIL TRANSPORTED TO MASS TPH LEVELS 1500 PPM

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**EMERGENCY RESPONSE NOTIFICATION SITE**

**SEARCH ID:** 5

**DIST/DIR:** 0.10 SW

**MAP ID:** 4

**NAME:** SAFETY KLEEN  
**ADDRESS:** 250 WILLIAMS ST FORREST CITY CLEANERS  
MIDDLETOWN CT 06457

**REV:** 11/22/96  
**ID1:** 516006  
**ID2:**  
**STATUS:** FIXED FACILITY  
**PHONE:**

**CONTACT:**

**SPILL INFORMATION**

**DATE OF SPILL:** 11/22/96 **TIME OF SPILL:** 0920

**PRODUCT RELEASED (1):** TETRACHLOROETHYLENE  
**QUANTITY (1):** 10  
**UNITS (1):** GAL

**PRODUCT RELEASED (2):**  
**QUANTITY (2):**  
**UNITS (2):**

**PRODUCT RELEASED (3):**  
**QUANTITY (3):**  
**UNITS (3):**

**MEDIUM/MEDIA AFFECTED**

<b>AIR:</b>	NO	<b>GROUNDWATER:</b>	NO
<b>LAND:</b>	YES	<b>FIXED FACILITY:</b>	NO
<b>WATER:</b>	NO	<b>OTHER:</b>	NO
<b>WATERBODY AFFECTED BY RELEASE:</b>		<b>ASPHALT</b>	

**CAUSE OF RELEASE**

<b>DUMPING:</b>	NO	<b>EQUIPMENT FAILURE:</b>	NO
<b>NATURAL PHENOMENON:</b>	NO	<b>OPERATOR ERROR:</b>	NO
<b>OTHER CAUSE:</b>	NO	<b>TRANSP. ACCIDENT:</b>	NO
<b>UNKNOWN:</b>	NO		

**ACTIONS TAKEN:** THE MATERIAL WAS A WASTE MIXTURE / A CONTRACTOR IS EN ROUTE FOR CLEANUP THE MATERIAL HAS BEEN CONTAINED

**RELEASE DETECTION:** 15 GALLON PLASTIC CONTAINER / THE CONTAINER WAS BEING OVERPACKED WHEN IT WAS ACCIDENTALLY OVERTURNED RELEASING THE MATERIAL

**MISC. NOTES:** THE CALLER HAD NO OTHER INFORMATION

**DISCHARGER INFORMATION**

**DISCHARGER ID:** 516006  
**TYPE OF DISCHARGER:** PRIVATE ENTERPRISE  
**NAME OF DISCHARGER:** SAFETY KLEEN  
**ADDRESS:** 11 TIPPING DRIVE  
BRANFORD CT

**DUN & BRADSTREET #:**



*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

RCRA GENERATOR SITE

**SEARCH ID:** 3                      **DIST/DIR:** 0.10 SW                      **MAP ID:** 4

**NAME:** FOREST CITY CLEANERS & LAUNDERERS INC  
**ADDRESS:** 250 WILLIAM ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD018714303  
**ID2:**  
**STATUS:** VGN  
**PHONE:** 2033474419

**CONTACT:** BRIAN MULARSKI

**SITE INFORMATION**

**UNIVERSE INFORMATION:**

SNC:	N - NO
BOYSNC:	N - NO
GPRA PERMIT:	N - NO
GPRA POSTCLOSURE:	N - NO
GPRA CA:	N - NO
GPRA CME:	N - NO
PERM PROG:	----
PREM WRKLD:	----
CLOSURE WRKLD:	----
P C WRKLD:	----
SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO
CA WRKLD:	N - NO
GEN STATUS:	CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZARDOUS WASTE

IMPORTER ACTIVITY:	U - UNKNOWN	MIX WASTE GEN:	U - UNKNOWN
RECYCLER ACT:	N - NO	TRANS ACT:	N - NO
TSD ACT:	N - NO	U GRND INJ ACT:	N - NO
UNIV WASTE FAC:		TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN

**USED OIL INFORMATION**

BURNER:	N - NO	PROCESSOR:	N - NO
REFINER:	N - NO	MARKET BURNER:	N
SPEC MARKETER:	N - NO	TRANSFER FAC:	N - NO
TRANSPORTER:	N - NO		

**NAIC INFORMATION**

SECOND ID:		OFF SITE RECEIPT:	U - UNKNOWN
ACCESSIBILITY:		COUNTY OWNER:	
FED WSTE GEN OWNER:	HQ	FED WASTE GEN:	3
STATE WSTE GEN OWNER:		STATE WSTE GEN:	

**ENFORCEMENT INFORMATION:**

**VIOLATION INFORMATION:**

- Continued on next page -

***Environmental FirstSearch***  
***Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA GENERATOR SITE**

**SEARCH ID:** 3

**DIST/DIR:** 0.10 SW

**MAP ID:** 4

**NAME:** FOREST CITY CLEANERS & LAUNDERERS INC  
**ADDRESS:** 250 WILLIAM ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD018714303  
**ID2:**  
**STATUS:** VGN  
**PHONE:** 2033474419

**CONTACT:** BRIAN MULARSKI

**HAZARDOUS WASTE INFORMATION:**

The following spent halogenated solvents: Tetrachloroethylene, methylene chloride, trichloroethylene, 1,1,1-trichloroethane, chlorobenzene, 1,1,2-trichloro-1,2,2-trifluoroethane, ortho-dichlorobenzene, trichlorofluoromethane

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 48

**DIST/DIR:** 0.10 SW

**MAP ID:** 4

**NAME:** SAFETY-KLEEN  
**ADDRESS:** 250 WILLIAMS STREET  
MIDDLETOWN CT

**REV:** 3/16/04  
**ID1:** 9606100  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** 0

**SITE INFORMATION**

**DATE OF RELEASE:** 11/22/1996  
**TIME OF RELEASE:** 9:20:00 AM  
**ACTION:** CONTRACTED

**DISCHARGER:** SAFETY-KLEEN  
11 TIPPING DRIVE  
BRANFORD CT 06405

**DISCHARGER S PHONE:** 4884299  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 9:45:00 AM  
**REPORTED BY:** TOM HEATON  
**REPORTER S PHONE:** 4884299

**MATERIAL RELEASED:** DRY CLEANING WASTE CONTAINING TETRA CHLOR  
**QUANTITY SPILLED:** 10 GAL

**CAUSE OF INCIDENT:** CONTAINER FAILURE

**EMERGENCY MEASURES:** DRUM OVERTURNED / A.E.T ENROUTE

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 88

**DIST/DIR:** 0.10 SW

**MAP ID:** 4

**NAME:** FOREST CITY CLEANERS  
**ADDRESS:** 250 WILLIAM ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01444  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 4

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b>	5/1/1950	<b>DATE LAST USED:</b>	6/1/1980
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	150
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b>	8/1/1950	<b>DATE LAST USED:</b>	11/1/1963
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	2000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	11/1/1963	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	6200
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 4  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	12/1/1988	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	6000
<b>TANK MATERIAL:</b>	CATHODICALLY PROTECTED STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 31

**DIST/DIR:** 0.12 SW

**MAP ID:** 29

**NAME:** BUCKLEY ENERGY  
**ADDRESS:** 280 WILLIAMS ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200200924  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 2/13/2002  
**TIME OF RELEASE:**  
**ACTION:** CLEANED

**DISHCHARGER:** BUCKLEY ENERGY  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 2/13/2002  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISHCHARGER:** BUCKLEY ENERGY  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 2/13/2002 10:43:49 AM  
**REPORTED BY:** JEFF MILLER  
**REPORTER S PHONE:** 6852568

**MATERIAL RELEASED:** #6 FUEL OIL  
**QUANTITY SPILLED:** 2 GAL

**CAUSE OF INCIDENT:** VALVE FAILURE

**EMERGENCY MEASURES:** VALVE DIDN T SEAL PROPERLY DURING DELIVERY, WASTE DRUMMED FOR PROPER DISPOSAL

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 63

**DIST/DIR:** 0.12 SW

**MAP ID:** 29

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 280 WILLIAMS STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200110706  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 12/17/2001  
**TIME OF RELEASE:**  
**ACTION:** SANDED

**DISHCHARGER:** WESLEYAN UNIVERSITY  
280 WILLIAMS STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 12/17/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISHCHARGER:** WESLEYAN UNIVERSITY  
280 WILLIAMS STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 12/17/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISHCHARGER:** WESLEYAN UNIVERSITY  
280 WILLIAMS STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 12/17/2001 3:55:39 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** TPH OF 4,000 PARTS PER MILLION DISCOVERED IN FORMER TANK - TO BE ADDRESSED

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 25

**DIST/DIR:** 0.13 NE

**MAP ID:** 23

**NAME:** SNET  
**ADDRESS:** 70 BROAD STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4497  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

SOUTHERN NEW ENGLAND TELEPHONE CO.

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** SNET  
**SELLER:** SNET  
**BUYER:** SBC COMMUNICATIONS INC.

**FORM:** FORM 1  
**ACKNOWLEDGED:** 6/18/1999  
**CERTIFIED:**  
**ECAF RECEIVED:**

**RECEIVED:** 11/4/1998  
**RETURNED:**  
**REVISED:**  
**ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:** SNET, TRANSFEROR  
DONALD SHASSIAN

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 25

**DIST/DIR:** 0.13 NE

**MAP ID:** 23

**NAME:** SNET  
**ADDRESS:** 70 BROAD STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4497  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>RECEIVED:</b>	11/4/1998
<b>STAFF:</b>	
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	11/4/1998
<b>OUTCOME:</b>	PTP



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 50

**DIST/DIR:** 0.13 NE

**MAP ID:** 23

**NAME:** SNET  
**ADDRESS:** 70 BROAD STREET, SNET  
MIDDLETOWN CT

**REV:** 3/16/05  
**IDI:** 200110496  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** EMANUELSON, BRIAN

**SITE INFORMATION**

**DATE OF RELEASE:** 12/10/2001  
**TIME OF RELEASE:**  
**ACTION:** OTHER

**DISCHARGER:** SNET  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 12/10/2001 10:38:34 AM  
**REPORTED BY:** CAPT LA ROSA  
**REPORTER S PHONE:** 3472541

**MATERIAL RELEASED:** WHITE POWDER  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** PACKAGE WITH COMPUTER EQUIPMENT HAS WHITE POWDER INSIDE PACKAGE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 90

**DIST/DIR:** 0.13 NE

**MAP ID:** 23

**NAME:** MIDDLETOWN CENTRAL OFFICE (7601)  
**ADDRESS:** 70 BROAD STREET  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01419  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 4

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	6/1/1974	<b>DATE LAST USED:</b>	7/1/1995
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	5000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b>	6/1/1950	<b>DATE LAST USED:</b>	10/1/1987
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	10000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1987	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	10000
<b>TANK MATERIAL:</b>	FIBERGLASS REINFORCED PLASTIC	<b>TANK PROTECTION:</b>	EXCAVATION LINER
<b>PIPE MATERIAL:</b>	OTHER	<b>PIPE PROTECTION:</b>	SECONDARY CONTAINMENT

**TANK ID:** 4  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1995	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	KEROSENE	<b>CAPACITY (GALS):</b>	4000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	DOUBLE-WALLED
<b>PIPE MATERIAL:</b>	FIBERGLASS REINFORCED PLASTIC	<b>PIPE PROTECTION:</b>	SECONDARY CONTAINMENT

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 101                      **DIST/DIR:** 0.13 NW                      **MAP ID:** 42

**NAME:** OLD MIDDLETOWN HIGH SCHOOL ASSOC.  
**ADDRESS:** 251 COURT STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200207512  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/25/2002  
**TIME OF RELEASE:**

**DISCHARGER:** OLD MIDDLETOWN HIGH SCHOOL ASSOC.  
CT

**DISCHARGER S PHONE:** 860 6383602  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 10/25/2002 1:25:32 PM  
**REPORTED BY:** JEFF MERK  
**REPORTER S PHONE:** 2502050

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** 5000 GALLON LUST REMOVED, SOIL TO BE REMOVED.

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 41

**DIST/DIR:** 0.13 NW

**MAP ID:** 42

**NAME:** OLD MIDDLETOWN HIGH SCHOOL ASSOC.  
**ADDRESS:** 251 COURT STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200207512  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/25/2002

**TIME OF RELEASE:**

**ACTION:** REMOVED TANK

**DISHCHARGER:** OLD MIDDLETOWN HIGH SCHOOL ASSOC.  
CT

**DISCHARGER S PHONE:** 6383602

**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 10/25/2002

**TIME OF RELEASE:**

**ACTION:** SOIL REMOVED

**DISHCHARGER:** OLD MIDDLETOWN HIGH SCHOOL ASSOC.  
CT

**DISCHARGER S PHONE:** 6383602

**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 10/25/2002 1:25:32 PM

**REPORTED BY:** JEFF MERK

**REPORTER S PHONE:** 2502050

**MATERIAL RELEASED:** #2 FUEL OIL

**QUANTITY SPILLED:** 100 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 5000 GALLON LUST REMOVED, SOIL TO BE REMOVED.

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 52                      **DIST/DIR:** 0.13 NW                      **MAP ID:** 42

**NAME:** TOWN OF MIDDLETOWN  
**ADDRESS:** 251 COURT ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 925658  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** TOWN OF MIDDLETOWN

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 11/05/92  
**ACTUAL TIME:** 34  
**REPORTER:** FIRE DEPT

**REPORT TIME:** 22

**WORK PHONE:** 203 346 8623  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** PETROLEUM  
**GALLONS:** 10  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** OIL  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 11/05/92  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:**  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:** ADVISED THAT NO ACTION HAS BEEN TAKEN TO CLEAN UP ITS IN BASEMENT OF  
FORMER HIGH SCHOOL

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:** Y  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:** 10  
**RESPONSIBLE PARTY:** TOWN OF MIDDLETOWN

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:**  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:** LINE REPAIRED  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**

**ACCEPT RESPONSIBILITY:** Y  
  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 52

**DIST/DIR:** 0.13 NW

**MAP ID:** 42

**NAME:** TOWN OF MIDDLETOWN  
**ADDRESS:** 251 COURT ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 925658  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** TOWN OF MIDDLETOWN

**NOTIFIED ATTORNEY GENERAL:**  
**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

GOVERNMENTAL

**NOTIFIED AQUACULTURE:**  
**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** TRANSFER LINE FAILURE

**CORRECTIVE ACTION TAKEN:** CLEANED REPAIRED LINE

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** KELLEY  
**ASSIGNED DATE:** 11/05/92  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:** 22 38  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 37

**DIST/DIR:** 0.13 NW

**MAP ID:** 36

**NAME:** MARK 4 CONSTRUCTION  
**ADDRESS:** HIGH/WYLLIS ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9803440  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 6/2/1998  
**TIME OF RELEASE:**  
**ACTION:** CLEANED

**DISHCHARGER:** MARK 4 CONSTRUCTION  
1137 seaview ave.  
BRIDGEPORT CT 06602

**DISCHARGER S PHONE:** 3352161  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 6/2/1998  
**TIME OF RELEASE:**  
**ACTION:** REPAIRED TANK

**DISHCHARGER:** MARK 4 CONSTRUCTION  
1137 seaview ave.  
BRIDGEPORT CT 06602

**DISCHARGER S PHONE:** 3352161  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 6/2/1998  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISHCHARGER:** MARK 4 CONSTRUCTION  
1137 seaview ave.  
BRIDGEPORT CT 06602

**DISCHARGER S PHONE:** 3352161  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 6/2/1998 1:32:11 PM  
**REPORTED BY:** WARREN  
**REPORTER S PHONE:** 3468623

**MATERIAL RELEASED:** DIESEL FUEL  
**QUANTITY SPILLED:** 5 GAL

**CAUSE OF INCIDENT:** FUEL TANK FAILURE

**EMERGENCY MEASURES:** SADDLE TANK FELL OFF DUMP TRUCK, RIGHTED, SPILLED <5 GALS., COMPANY WILL CLEANUP

- Continued on next page -

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 37

**DIST/DIR:** 0.13 NW

**MAP ID:** 36

**NAME:** MARK 4 CONSTRUCTION  
**ADDRESS:** HIGH/WYLLIS ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9803440  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

SMALL SPILL AND REPAIR TANK



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 92

**DIST/DIR:** 0.13 NW

**MAP ID:** 42

**NAME:** OLD MIDDLETOWN HIGH SCHOOL APTS.  
**ADDRESS:** 251 COURT STREET  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 12381  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 3

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>		<b>DATE LAST USED:</b>	10/2/2002
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	10000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	NOT LISTED	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>		<b>DATE LAST USED:</b>	10/2/2002
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	5000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	NOT LISTED	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	10/2/2002	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	10000
<b>TANK MATERIAL:</b>	CATHODICALLY PROTECTED STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	NOT LISTED	<b>PIPE PROTECTION:</b>	NONE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 75

**DIST/DIR:** 0.13 SE

**MAP ID:** 83

**NAME:**  
**ADDRESS:** BP STATION ON BROAD ST. & WILLIAM ST.  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9805005  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** EMANUELSON, BRIAN

**SITE INFORMATION**

**DATE OF RELEASE:** 7/31/1998  
**TIME OF RELEASE:** 10:15:00 AM  
**ACTION:** CONTAINED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**SITE INFORMATION**

**DATE OF RELEASE:** 7/31/1998  
**TIME OF RELEASE:** 10:15:00 AM  
**ACTION:** SANDED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 7/31/1998 10:21:03 AM  
**REPORTED BY:** WILLIAM MIERZEJEWSKI  
**REPORTER S PHONE:** 3469940

**MATERIAL RELEASED:** GASOLINE  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 105                      **DIST/DIR:** 0.13 SW                      **MAP ID:** 48

**NAME:** SAA  
**ADDRESS:** 237 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105982  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/9/2001  
**TIME OF RELEASE:**

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #6 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/9/2001 9:17:10 AM  
**REPORTED BY:** URS  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 20 - OTHER  
**OTHER:** NONE

**EMERGENCY MEASURES:** BELOW STATE REMEDIAL STANDARDS

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 46

**DIST/DIR:** 0.13 SW

**MAP ID:** 48

**NAME:** SAA  
**ADDRESS:** 237 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105982  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/9/2001  
**TIME OF RELEASE:**  
**ACTION:** OTHER

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/9/2001 9:17:10 AM  
**REPORTED BY:** URS  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #6 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** BELOW STATE REMEDIAL STANDARDS

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 28

**DIST/DIR:** 0.14 NE

**MAP ID:** 26

**NAME:** AMERICAN RED CROSS  
**ADDRESS:** 97 BROAD ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 923391  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** AMERICAN RED CROSS

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 917  
**REPORT DATE:** 07/13/92  
**ACTUAL TIME:** 10  
**REPORTER:** DISP KRONENBERGER  
MIDDLETOWN F D

**REPORT TIME:** 16

**WORK PHONE:** 203 346 8623  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** PETROLEUM  
**GALLONS:**  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** #2 FUEL OIL  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 07/13/92  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:** TANK PUMPED/PULLED

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:**  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:** AMERICAN RED CROSS  
97 BROAD ST  
MIDDLETOWN CT 6457

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:** Y  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:** SOIL REMOVAL  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**  
**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y  
  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**  
**NOTIFIED AQUACULTURE:**

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### STATE SPILLS SITE

**SEARCH ID:** 28      **DIST/DIR:** 0.14 NE      **MAP ID:** 26

**NAME:** AMERICAN RED CROSS  
**ADDRESS:** 97 BROAD ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 923391  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** AMERICAN RED CROSS

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:** PRIVATE

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** INGROUND TANK FAILURE

**CORRECTIVE ACTION TAKEN:** REMOVED TANK SOIL REMOVAL

**CONTRACTOR:** Y  
**DID DEP HIRE CONT:** N  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** SANTACROCE  
**ASSIGNED DATE:** 07/13/92  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:** ABELY S WASTE OIL  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 917  
**ASSIGNED TIME:** 16 15  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:** 07/13/92  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y  
**COPY:** 2

**MISCELLANEOUS INFORMATION:** MIDDLETOWN F D REQUESTED IMMEDIATE RESPONSTO FACILITATE TANK REMOVAL  
AT AMERICAN RED CROSS TNAK WAS LOCATED ALONG BLDG EXCAVATION OF TANK ALSO BLOCKING VEHICLES WHICH ARE  
USED TO TRANSPORT ELDERLY

APPRX 40 YDS SOIL REMOVED REMAINING CONTAM SOIL LEFT IN GRAVE FURTHER EXCAVA- TION MAY HAVE JEOPARDIZED  
STRUCTURE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 43

**DIST/DIR:** 0.14 NE

**MAP ID:** 44

**NAME:** PRIVATE VEHICLE  
**ADDRESS:** BROAD & COLLEGE ST.  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200003353  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 5/16/2000  
**TIME OF RELEASE:** 3:50:00 PM  
**ACTION:** SANDED

**DISCHARGER:** PRIVATE VEHICLE  
CT

**DISCHARGER S PHONE:** 0000000  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 5/16/2000 4:01:38 PM  
**REPORTED BY:** DISP. #1709  
**REPORTER S PHONE:** 3472541

**MATERIAL RELEASED:** ANTIFREEZE  
**QUANTITY SPILLED:** 1 GAL

**CAUSE OF INCIDENT:** MV ACCIDENT

**EMERGENCY MEASURES:** SANDED

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 106

**DIST/DIR:** 0.14 NW

**MAP ID:** 49

**NAME:** SAA  
**ADDRESS:** 294 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106448  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**

**DISCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/23/2001 10:08:53 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 11 - CLEANED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 2 - REMOVED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**EMERGENCY MEASURES:** 83 PPM TANK GRAVE 2K LUST

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 47

**DIST/DIR:** 0.14 NW

**MAP ID:** 49

**NAME:** SAA  
**ADDRESS:** 294 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200106448  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISHCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED

**DISHCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISHCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISHCHARGER:** SAA  
MIDDLETOWN CT 06457

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 47

**DIST/DIR:** 0.14 NW

**MAP ID:** 49

**NAME:** SAA  
**ADDRESS:** 294 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200106448  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** CLEANED

**DISCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/23/2001 10:08:53 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 2 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 83 PPM TANK GRAVE 2K LUST

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 42

**DIST/DIR:** 0.14 NW

**MAP ID:** 43

**NAME:** PETERSON OIL  
**ADDRESS:** 272 COURT STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200201241  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 2/28/2002  
**TIME OF RELEASE:**  
**ACTION:** CLEANED

**DISCHARGER:** PETERSON OIL  
CT

**DISCHARGER S PHONE:** 3423560  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 2/28/2002 11:42:24 AM  
**REPORTED BY:** JEFF MILLER  
**REPORTER S PHONE:** 6852568

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 2 GAL

**CAUSE OF INCIDENT:** OVERFILL

**EMERGENCY MEASURES:** OVERFILL BY OIL COMPANY, ALREADY CLEANED BY OIL COMPANY, SPILLED TO CONCRETE, NO DRAINS INVOLVED

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 86

**DIST/DIR:** 0.14 SE

**MAP ID:** 91

**NAME:** DIDATO S B.P.  
**ADDRESS:** 28 BROAD ST.  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01440  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 9

**TANK ID:** 1  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1968	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	3000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	GALVANIZED STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1968	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	3000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	GALVANIZED STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1968	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	4000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	GALVANIZED STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 4  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	6/1/1975	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	4000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	GALVANIZED STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 5  
**TANK STATUS:** CURRENTLY IN USE-

<b>DATE INSTALLED:</b>	7/1/1983	<b>DATE LAST USED:</b>	
<b>SUBSTANCE STORED:</b>	DIESEL	<b>CAPACITY (GALS):</b>	3000
<b>TANK MATERIAL:</b>	CATHODICALLY PROTECTED STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	OTHER	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 6  
**TANK STATUS:** CURRENTLY IN USE-

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 86

**DIST/DIR:** 0.14 SE

**MAP ID:** 91

**NAME:** DIDATO S B.P.  
**ADDRESS:** 28 BROAD ST.  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01440  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**DATE INSTALLED:** 8/1/1988  
**SUBSTANCE STORED:** GASOLINE  
**TANK MATERIAL:** CATHODICALLY PROTECTED STEEL  
**PIPE MATERIAL:** OTHER

**DATE LAST USED:**  
**CAPACITY (GALS):** 8000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 7  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 8/1/1988  
**SUBSTANCE STORED:** GASOLINE  
**TANK MATERIAL:** CATHODICALLY PROTECTED STEEL  
**PIPE MATERIAL:** OTHER

**DATE LAST USED:**  
**CAPACITY (GALS):** 8000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 8  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 8/1/1988  
**SUBSTANCE STORED:** GASOLINE  
**TANK MATERIAL:** CATHODICALLY PROTECTED STEEL  
**PIPE MATERIAL:** OTHER

**DATE LAST USED:**  
**CAPACITY (GALS):** 8000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 9  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 8/1/1988  
**SUBSTANCE STORED:** USED OIL  
**TANK MATERIAL:** CATHODICALLY PROTECTED STEEL  
**PIPE MATERIAL:** OTHER

**DATE LAST USED:**  
**CAPACITY (GALS):** 550  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 38

**DIST/DIR:** 0.15 SE

**MAP ID:** 37

**NAME:** MIDDLETOWN POLICE DEPT  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 91664  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** MIDDLETOWN POLICE DEPT

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 914  
**REPORT DATE:** 02/20/91  
**ACTUAL TIME:** 45  
**REPORTER:** SGT WARD  
MIDDLETOWN POLICE DEPT  
**REPORT TIME:** 13

**WORK PHONE:** 203 347 6941

**HOME PHONE:**

**POLE NUMBER:**

**INCIDENT TYPE:** PETROLEUM

**GALLONS:**

**POUNDS:**

**DRUMS:**

**CERCLA:**

**EMERGENCY CLEANUP:**

**TOTAL POUNDS:**

**DISCHARGED:** GASOLINE

**YARDS:**

**CON:**

**FEDRAL:**

**ACROSS PROPERTY LINES:**

**REP QUAN:**

**DESCRIPTION:**

**DATE:** 02/20/91  
**CONTINUOUS SPILL:** Y  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**  
**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:** SYSTEM INS TESTED (628-0891) LOSING 40 GPH

**WATERBODY:**

**LIS:**

**CATCH BASIN:**

**AIR:**

**GROUND WATER:**

**INSIDE BUILDING:**

**TOTAL IN WATER:**

**TOTAL RECOVERED:**

**RESPONSIBLE PARTY:**

ST

POSSIBLE GROUNDWATER

Y

MIDDLETOWN POLICE DEPT

MIDDLETOWN CT 6457

**RIVER:**

**TRIBUTARY:**

**POND:**

**SURFACE WATER:**

**GROUND SURFACE:**

**OTHER AREA:**

**TOTAL RECOVERED FROM WATER:**

**PHONE:**

**POLLUTER UNKNOWN:**

**CLEANUP ACTION TAKEN:**

**DUN BRAD:**

**NOTIFIED COAST GAURD:**

**NOTIFIED LOCAL FIRE DEPT:**

**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y

TANKS WILL BE RETESTED 2/27/91 TANK PULL

**NOTIFIED FEDERAL GOVERNMENT:**

**NOTIFIED FIRE MARSHALL:**

**NOTIFIED POLICE:**

**NOTIFIED AQUACULTURE:**

- Continued on next page -

# *Environmental FirstSearch* *Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

## STATE SPILLS SITE

**SEARCH ID:** 38                      **DIST/DIR:** 0.15 SE                      **MAP ID:** 37

**NAME:** MIDDLETOWN POLICE DEPT  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 91664  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** MIDDLETOWN POLICE DEPT

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:** 1345  
**DISCHARGE CLASS:** GOVERNMENTAL

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:** 02/26/91

**CAUSE:** INGROUND TANK FAILURE

**CORRECTIVE ACTION TAKEN:** REMOVED TANK OTHER RETEST SEPARATE

**CONTRACTOR:**  
**DID DEP HIRE CONT:** N  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** WILCOX  
**ASSIGNED DATE:** 02/26/91  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:** PUBLIC WORKS  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 914  
**ASSIGNED TIME:** 14 0  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:** 2

**CITY OF MIDDLETOWN**  
**CHURCH ST**  
**MIDDLETOWN CT 6457**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:** 02/20/91  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:** SAME  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y  
**COPY:** P

**MISCELLANEOUS INFORMATION:** TANK FAILURE TANK WAS REMOVED & CONTAM SOIL EXCAVATED & REMOVED TO  
HYDRO CARBON LANDFILL

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 97

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:** HARBOR HILL CARE CENTER  
**ADDRESS:** 111 CHURCH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 9905933  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 9/3/1999  
**TIME OF RELEASE:**

**DISCHARGER:** HARBOR HILL CARE CENTER  
111 CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 9/3/1999 9:08:46 AM  
**REPORTED BY:** SHAUN MAGEE  
**REPORTER S PHONE:** 6463348

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL

**OTHER:**

**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP

**OTHER:**

**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF A 10,000 - GALLON # 2 FUEL OIL L.U.S.T / GB AREA / FIRE MARSHAL ON SITE  
**/ NO FREE PRODUCT**

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 4 - GROUND SURFACE



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 35                      **DIST/DIR:** 0.16 SE                      **MAP ID:** 34

**NAME:** HARBOR HILL CARE CENTER  
**ADDRESS:** 111 CHURCH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9905933  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 9/3/1999  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISHCHARGER:** HARBOR HILL CARE CENTER  
111 CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 9/3/1999  
**TIME OF RELEASE:**  
**ACTION:** PUMPED OUT

**DISHCHARGER:** HARBOR HILL CARE CENTER  
111 CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 9/3/1999  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISHCHARGER:** HARBOR HILL CARE CENTER  
111 CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 9/3/1999  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISHCHARGER:** HARBOR HILL CARE CENTER  
111 CHURCH STREET  
MIDDLETOWN CT 06457

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 35

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:** HARBOR HILL CARE CENTER  
**ADDRESS:** 111 CHURCH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9905933  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 9/3/1999 9:08:46 AM  
**REPORTED BY:** SHAUN MAGEE  
**REPORTER S PHONE:** 6463348

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 70 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** REMOVAL OF A 10,000 - GALLON # 2 FUEL OIL L.U.S.T / GB AREA / FIRE MARSHAL ON SITE / NO  
**FREE PRODUCT**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 79

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:**  
**ADDRESS:** 111 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 915172  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 12/08/91  
**ACTUAL TIME:** 18  
**REPORTER:** P D

**REPORT TIME:** 11

**WORK PHONE:** 203 317 6941  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** GASEOUS  
**GALLONS:**  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** METHANE  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 12/08/91  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:** 110  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:** THIS WAS NOT A SPILL UNTIMELY DEATH IN A MANHOLE MIDDLETOWN P D WAS  
LOOKING FOR PHONE NUMBER FOR OSHA P D DID NOT REQUEST ASSISON SCENE

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:** Y  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:**  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:**

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:**  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:**  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**

**ACCEPT RESPONSIBILITY:**

**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 79

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:**  
**ADDRESS:** 111 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 915172  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:**

**NOTIFIED ATTORNEY GENERAL:**  
**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:** PRIVATE

**NOTIFIED AQUACULTURE:**  
**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** UNKNOWN

**CORRECTIVE ACTION TAKEN:** UNKNOWN

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** KELLEY  
**ASSIGNED DATE:** 12/08/91  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:** 11 19  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 80

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:**  
**ADDRESS:** 111 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 941707  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 04/12/94  
**ACTUAL TIME:**  
**REPORTER:** SALAFIA (FIRE DEPT)  
HARBOR HILL HEALTH CARE CENTER

**REPORT TIME:**

**WORK PHONE:** 203 346 8623  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** PETROLEUM  
**GALLONS:**  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** #2 FUEL OIL  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 04/12/94  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:** Y

**ADDITIONAL INFORMATION:** 10K UST TAKING ON WATER TANK 20 YRS OLD BILL GREEN 347-7286

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:**  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:**

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:** Y  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:**  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**  
**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:**

**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**  
**NOTIFIED AQUACULTURE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 80

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:**  
**ADDRESS:** 111 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 941707  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:**

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** INGROUND TANK FAILURE

**CORRECTIVE ACTION TAKEN:** OTHER TANK TESTED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** STAVOLA  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 89

**DIST/DIR:** 0.16 SE

**MAP ID:** 34

**NAME:** HARBOR HILL CARE CENTER  
**ADDRESS:** 111 CHURCH ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01516  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 2

**TANK ID:** 1  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 7/1/1977  
**SUBSTANCE STORED:** GASOLINE  
**TANK MATERIAL:** ASPHALT COATED OR BARE STEEL  
**PIPE MATERIAL:** BARE STEEL

**DATE LAST USED:**  
**CAPACITY (GALS):** 10000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 2  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 7/1/1977  
**SUBSTANCE STORED:** OTHER  
**TANK MATERIAL:** EPOXY COATED STEEL  
**PIPE MATERIAL:** BARE STEEL

**DATE LAST USED:**  
**CAPACITY (GALS):** 1500  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 53

**DIST/DIR:** 0.17 NE

**MAP ID:** 31

**NAME:** TOWN OF MIDDLETOWN RISCOLL LIBRARY  
**ADDRESS:** 123 BROAD STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200008159  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** EMANUELSON, BRIAN

**SITE INFORMATION**

**DATE OF RELEASE:** 10/26/2000

**TIME OF RELEASE:**

**ACTION:** OTHER

**DISCHARGER:** TOWN OF MIDDLETOWN RISCOLL LIBRARY  
123 BROAD STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 2:45:00 PM  
**REPORTED BY:** MIDDLETOWN DISP.  
**REPORTER S PHONE:** 3472541

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** POSSIBLE UNDERGROUND TANK LEAKING



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 33

**DIST/DIR:** 0.17 NE

**MAP ID:** 31

**NAME:** CITY OF MIDDLETOWN  
**ADDRESS:** 123 BROAD ST.  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9706499  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** STAVOLA, ROSANNE

**REPORT TIME:** 9:49:00 AM  
**REPORTED BY:** FIREFIGHTER SCOTT  
**REPORTER S PHONE:** 3468622

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 30 GAL

**EMERGENCY MEASURES:** LEAK INTO ELAVATOR SHAFT WITH IN BUILDING.

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 124

**DIST/DIR:** 0.17 NW

**MAP ID:** 68

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 330 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105260  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 7/16/2001 11:10:30 AM  
**REPORTED BY:** PETE CANOVA  
**REPORTER S PHONE:** 7475945

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF A 1,000 - GALLON L.U.S.T / FIRE MARSHAL ON SITE / GB AREA / NO FREE  
**PRODUCT**

- Continued on next page -

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 124

**DIST/DIR:** 0.17 NW

**MAP ID:** 68

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 330 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105260  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 4 - GROUND SURFACE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 68

**DIST/DIR:** 0.17 NW

**MAP ID:** 68

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 330 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105260  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001

**TIME OF RELEASE:**

**ACTION:** CONTRACTED

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6853764

**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001

**TIME OF RELEASE:**

**ACTION:** SOIL REMOVED

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6853764

**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001

**TIME OF RELEASE:**

**ACTION:** REMOVED TANK

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6853764

**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001

**TIME OF RELEASE:**

**ACTION:** CONTAINED

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

- Continued on next page -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 68

**DIST/DIR:** 0.17 NW

**MAP ID:** 68

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 330 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105260  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**DISCHARGER S PHONE:** 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/16/2001  
**TIME OF RELEASE:**  
**ACTION:** PUMPED OUT

**DISCHARGER:** WESLEYAN UNIVERSITY  
330 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 7/16/2001 11:10:30 AM  
**REPORTED BY:** PETE CANOVA  
**REPORTER S PHONE:** 7475945

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 40 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** REMOVAL OF A 1,000 - GALLON L.U.S.T / FIRE MARSHAL ON SITE / GB AREA / NO FREE PRODUCT

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 113

**DIST/DIR:** 0.17 SE

**MAP ID:** 38

**NAME:** UNKNOWN  
**ADDRESS:** 66 CHURCH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200103432  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 5/18/2001  
**TIME OF RELEASE:**

**DISCHARGER:** UNKNOWN  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** GASOLINE 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 2:25:00 PM  
**REPORTED BY:** DISPATCHER 1125  
**REPORTER S PHONE:** 3472541

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** 2K LUST DISCOVERED DURING BUILDING DEMO, MARIN ENV. ON SITE, PETER SHEA  
345-4578, SAMPLES TAKEN AND HOLE LINED WITH POLY AND BACKFILLED

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 6 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 55

**DIST/DIR:** 0.17 SE

**MAP ID:** 38

**NAME:** UNKNOWN  
**ADDRESS:** 66 CHURCH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200103432  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 5/18/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** UNKNOWN  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 2:25:00 PM  
**REPORTED BY:** DISPATCHER 1125  
**REPORTER S PHONE:** 3472541

**MATERIAL RELEASED:** GASOLINE  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** 2K LUST DISCOVERED DURING BUILDING DEMO, MARIN ENV. ON SITE, PETER SHEA 345-4578,  
SAMPLES TAKEN AND HOLE LINED WITH POLY AND BACKFILLED

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 74

**DIST/DIR:** 0.17 SE

**MAP ID:** 82

**NAME:**

**ADDRESS:** 66 CHURCH STREET (POLICE DEPT. PARKING AREA)  
MIDDLETOWN CT

**REV:** 3/16/04

**ID1:** 9604175

**ID2:**

**STATUS:** CLOSED

**CONTACT:** 916

**PHONE:**

**REPORT TIME:** 9:14:00 PM

**REPORTED BY:** LT. DRACHENBERG

**REPORTER S PHONE:** 3468623

**MATERIAL RELEASED:**

**EMERGENCY MEASURES:**



# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### STATE SPILLS SITE

**SEARCH ID:** 39

**DIST/DIR:** 0.17 SE

**MAP ID:** 38

**NAME:** MIDDLETOWN POLICE DEPT  
**ADDRESS:** 66 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 957196  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** MIDDLETOWN POLICE DEPT

#### SITE INFORMATION

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 12/22/95  
**ACTUAL TIME:** 4  
**REPORTER:** FIREFIGHTER SALAFIA  
FIRE DEPT

**REPORT TIME:** 17

**WORK PHONE:** 203 346 8623  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** CHEMICAL  
**GALLONS:** 3  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** TOILET CLEANER/CHLORINE MIX  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

#### **DESCRIPTION:**

**DATE:** 12/22/95  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:** 160  
**ONGOING RELEASE:**  
**CONTAINED:** Y

**ADDITIONAL INFORMATION:** JANITOR CLEANED TOILET W TOILET CLEANER & CHLORINE THEY DON'T KNOW HOW TO GET RID OF SOLUTION

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:** Y  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:** MIDDLETOWN POLICE DEPT

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:**  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:**  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**

**ACCEPT RESPONSIBILITY:** Y  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### STATE SPILLS SITE

**SEARCH ID:** 39

**DIST/DIR:** 0.17 SE

**MAP ID:** 38

**NAME:** MIDDLETOWN POLICE DEPT  
**ADDRESS:** 66 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 957196  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** MIDDLETOWN POLICE DEPT

**NOTIFIED ATTORNEY GENERAL:**  
**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:** GOVERNMENTAL

**NOTIFIED AQUACULTURE:**  
**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** OTHER CHEMICAL REACTION

**CORRECTIVE ACTION TAKEN:** DISPERSED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:**  
**ASSIGNED DATE:** 12/22/95  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:** 12 9  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:** MIXTURE OF CLEANING MATERIALS REACTED OUT & WAS FLUSHED TO SANITARY SEWER SYSTEM

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 64                      **DIST/DIR:** 0.19 SW                      **MAP ID:** 67

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 190 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200106252  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/15/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** WESLEYAN UNIVERSITY  
190 HIGH STREET  
MIDDLETON CT

**DISCHARGER S PHONE:** 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/15/2001  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISCHARGER:** WESLEYAN UNIVERSITY  
190 HIGH STREET  
MIDDLETON CT

**DISCHARGER S PHONE:** 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/15/2001 5:27:11 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 30 YARDS

**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** 1000 GALLON TANK--GW SOIL CONTAMANT REVIEW

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 78

**DIST/DIR:** 0.20 NE

**MAP ID:** 86

**NAME:**  
**ADDRESS:** 138 BROAD ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200401639  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 3/16/2004  
**TIME OF RELEASE:**  
**ACTION:** REFERRED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 3/16/2004 8:09:00 PM  
**REPORTED BY:** BARBRA KRACHT  
**REPORTER S PHONE:** 3441415

**MATERIAL RELEASED:** MERCURY  
**CAUSE OF INCIDENT:** CONTAINER FAILURE

**EMERGENCY MEASURES:** ADVISED ON CLEAN UP & REMOVAL

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 104

**DIST/DIR:** 0.20 NW

**MAP ID:** 45

**NAME:** SAA  
**ADDRESS:** WESLYN UNIVERSITY - 327 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205380  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/6/2002  
**TIME OF RELEASE:**

**DISHCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/6/2002 4:15:50 PM  
**REPORTED BY:** CHRISTENE MATHERLY  
**REPORTER S PHONE:** 5298882

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** TANK REMOVED, SAMPLES SHOWED 270 PPM TPH, NO FREE PRODUCT OR  
**GROUNDWATER**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 44

**DIST/DIR:** 0.20 NW

**MAP ID:** 45

**NAME:** SAA  
**ADDRESS:** WESLYN UNIVERSITY - 327 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200205380  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/6/2002  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/6/2002  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/6/2002 4:15:50 PM  
**REPORTED BY:** CHRISTENE MATHERLY  
**REPORTER S PHONE:** 5298882

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** TANK REMOVED, SAMPLES SHOWED 270 PPM TPH, NO FREE PRODUCT OR GROUNDWATER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 126                      **DIST/DIR:** 0.21 NW                      **MAP ID:** 69

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 350 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106651  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/29/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN UNIVERSITY  
350 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/29/2001 4:11:14 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**EMERGENCY MEASURES:** SUB - SURFACE INVESTIGATION OF FORMER 3,000 - GALLON U.S.T SITE - NO  
**CONTAMINATION DETECTED**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 69

**DIST/DIR:** 0.21 NW

**MAP ID:** 69

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 350 HIGH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200106651  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/29/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISCHARGER:** WESLEYAN UNIVERSITY  
350 HIGH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 8/29/2001 4:11:14 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** #2 FUEL OIL  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** SUB - SURFACE INVESTIGATION OF FORMER 3,000 - GALLON U.S.T SITE - NO CONTAMINATION  
**DETECTED**



***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

<b>SEARCH ID:</b> 87	<b>DIST/DIR:</b> 0.22 NE	<b>MAP ID:</b> 92
----------------------	--------------------------	-------------------

**NAME:** FIRST CHURCH OF CHRIST CONGREGATIONAL  
**ADDRESS:** 190 COURT ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01507  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 1

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b> 11/1/1969	<b>DATE LAST USED:</b> 10/1/1988
<b>SUBSTANCE STORED:</b> HEATING OIL	<b>CAPACITY (GALS):</b> 10000
<b>TANK MATERIAL:</b> ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b> NONE
<b>PIPE MATERIAL:</b> BARE STEEL	<b>PIPE PROTECTION:</b> NONE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 54

**DIST/DIR:** 0.23 NE

**MAP ID:** 56

**NAME:** UNKNOWN  
**ADDRESS:** 100 RIVERVIEW CENTER  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200108199  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/17/2001  
**TIME OF RELEASE:**  
**ACTION:** OTHER

**DISCHARGER:** UNKNOWN  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 10/17/2001 11:04:28 AM  
**REPORTED BY:** CHIEF CHIP ROSS  
**REPORTER S PHONE:** 8937219

**MATERIAL RELEASED:** SHEET ROCK DUST (WHITE POWDER)  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** REPORTED WHITE POWDER INSIDE ELEVATOR - DETERMINED TO BE SHEET ROCK DUST

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 85                      **DIST/DIR:** 0.23 NE                      **MAP ID:** 90

**NAME:** BOB S, INC.  
**ADDRESS:** 343 MAIN STREET  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 10095  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 2

**TANK ID:** 1  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 1/1/1950  
**SUBSTANCE STORED:** GASOLINE  
**TANK MATERIAL:** UNKNOWN  
**PIPE MATERIAL:** UNKNOWN

**DATE LAST USED:**  
**CAPACITY (GALS):** 3000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 2  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 7/1/1990  
**SUBSTANCE STORED:** HEATING OIL  
**TANK MATERIAL:** CATHODICALLY PROTECTED STEEL  
**PIPE MATERIAL:** OTHER

**DATE LAST USED:**  
**CAPACITY (GALS):** 2000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 94

**DIST/DIR:** 0.23 NE

**MAP ID:** 56

**NAME:** RIVERVIEW CENTER  
**ADDRESS:** 100 RIVERVIEW CENTER  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01527  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 3

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b>	5/1/1965	<b>DATE LAST USED:</b>	12/1/1988
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	7000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** PERMANENTLY OUT OF USE-CLOSED IN PLACE

<b>DATE INSTALLED:</b>	5/1/1965	<b>DATE LAST USED:</b>	12/1/1988
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	4000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** PERMANENTLY OUT OF USE-REMOVED

<b>DATE INSTALLED:</b>	1/1/1950	<b>DATE LAST USED:</b>	3/1/1991
<b>SUBSTANCE STORED:</b>	USED OIL	<b>CAPACITY (GALS):</b>	500
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	BARE STEEL	<b>PIPE PROTECTION:</b>	NONE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

REGISTERED UNDERGROUND STORAGE TANKS

**SEARCH ID:** 84

**DIST/DIR:** 0.23 NE

**MAP ID:** 89

**NAME:** BACON BROTHERS INC  
**ADDRESS:** 359 MAIN ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01512  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 4

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	11/1/1982	<b>DATE LAST USED:</b>	12/1/1997
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	1000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	UNKNOWN	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 2  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	11/1/1982	<b>DATE LAST USED:</b>	12/1/1997
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	1000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	UNKNOWN	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 3  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	1/1/1970	<b>DATE LAST USED:</b>	10/1/1987
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	550
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	UNKNOWN	<b>PIPE PROTECTION:</b>	NONE

**TANK ID:** 4  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	1/1/1970	<b>DATE LAST USED:</b>	10/1/1987
<b>SUBSTANCE STORED:</b>	GASOLINE	<b>CAPACITY (GALS):</b>	250
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	NONE
<b>PIPE MATERIAL:</b>	UNKNOWN	<b>PIPE PROTECTION:</b>	NONE

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 137

**DIST/DIR:** 0.23 NW

**MAP ID:** 81

**NAME:** WESLYAN UNOVERSITY  
**ADDRESS:** CROWELL MUSIC HALL/WESLYAN UNIVERSITY  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105599  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/26/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLYAN UNOVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** GASOLINE 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 7/26/2001 2:19:06 PM  
**REPORTED BY:** CINDY DEERE  
**REPORTER S PHONE:** 7211424

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF 550 GAL UST AND IMPACTED SOIL

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 73

**DIST/DIR:** 0.23 NW

**MAP ID:** 81

**NAME:** WESLYAN UNOVERSITY  
**ADDRESS:** CROWELL MUSIC HALL/WESLYAN UNIVERSITY  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105599  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/26/2001  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISHCHARGER:** WESLYAN UNOVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/26/2001  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISHCHARGER:** WESLYAN UNOVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 7/26/2001 2:19:06 PM  
**REPORTED BY:** CINDY DEERE  
**REPORTER S PHONE:** 7211424

**MATERIAL RELEASED:** GASOLINE  
**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** REMOVAL OF 550 GAL UST AND IMPACTED SOIL

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 125

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 157 CHURCH STREET  
MIDDLETOWN CT 06457

**REV:**  
**ID1:** 4136  
**ID2:**  
**STATUS:** YES  
**PHONE:**

**CONTACT:**

**REPORT DATE:** 06-30-94  
**MATERIAL:** STEEL  
**LOW CAPACITY:** 1000  
**PRODUCT:** HF2

**FED REG:** NO  
**NUMBER OF TANKS:** 1  
**HIGH CAPACITY:** 1000

**TANK REMOVED:** YES  
**TANK RELEASE:**

**UNCONTROLLED RELEASE:** YES  
**PIPING RELEASE:** YES

**EMERGENCY:**  
**OVERFILL RELEASE:**

**REMEDICATION:** SOIL REMOVAL  
**REFERRED:**  
**COMMENT:**

**COMPLETE:** YES



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 58

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIV  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 923578  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIV

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 07/20/92  
**ACTUAL TIME:** 29  
**REPORTER:** JOHN SCHUKOSKE

**REPORT TIME:** 11

**WORK PHONE:**  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:**  
**GALLONS:**  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

GASEOUS

50

**DISCHARGED:** FREON 11  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 07/20/92  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:** Y

**ADDITIONAL INFORMATION:**

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:** Y  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:** WESLEYAN UNIV  
186 COLLEGE ST  
MIDDLETOWN CT 6457

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:**  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:**  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**  
**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y  
  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:** Y  
**NOTIFIED POLICE:**  
**NOTIFIED AQUACULTURE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 58

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIV  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 923578  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIV

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**CAUSE:**

VALVE FAILURE

**CORRECTIVE ACTION TAKEN:**

DISSIPATED REPAIRED LINE

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** CAPUANO  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 66

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 157 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 943498  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIVERSITY

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 916  
**REPORT DATE:** 06/29/94  
**ACTUAL TIME:** 19  
**REPORTER:** JOHN SCHUKOSKE  
WESYLAN UNIVERSITY

**REPORT TIME:** 10

**WORK PHONE:** 203 344 8544  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** PETROLEUM  
**GALLONS:**  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** #2 FUEL OIL  
**YARDS:** 15  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 06/29/94  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:** Y

**ADDITIONAL INFORMATION:** 1K LUST W SOIL CONTAM

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:**  
**AIR:**  
**GROUND WATER:** Y  
**INSIDE BUILDING:**  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:** 15  
**RESPONSIBLE PARTY:** WESLEYAN UNIVERSITY

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:**  
**GROUND SURFACE:** Y  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:** TANK/SOIL REMOVED  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**  
**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**  
**NOTIFIED AQUACULTURE:**

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### STATE SPILLS SITE

**SEARCH ID:** 66

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 157 CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 943498  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIVERSITY

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

PRIVATE

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** INGROUND TANK FAILURE

**CORRECTIVE ACTION TAKEN:** REMOVED TANK SOIL REMOVAL

**CONTRACTOR:** Y  
**DID DEP HIRE CONT:** N  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** GOTHBERG  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:** CON-TEST  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 916  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:** 06/30/94  
**QUAN PET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y  
**COPY:** 2

**MISCELLANEOUS INFORMATION:** 1K LUST REMOVED W 15 YDS CONTAM SOIL TO PHOENIX SOIL SAMPLES TAKEN  
**ANALYSES ATTACHED**

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 67

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 93735  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIVERSITY

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** NR  
**REPORT DATE:** 02/17/93  
**ACTUAL TIME:** 37  
**REPORTER:** JOHN SCHUKASKE  
WESLEYAN UNIVERSITY  
186 COLLEGE ST  
MIDDLETOWN CT 6457

**REPORT TIME:** 15

**WORK PHONE:** 203 347 9411

**HOME PHONE:**

**POLE NUMBER:**

**INCIDENT TYPE:**

CHEMICAL

**GALLONS:**

**POUNDS:**

1

**DRUMS:**

**CERCLA:**

**EMERGENCY CLEANUP:**

**TOTAL POUNDS:**

**DISCHARGED:** FREON 22

**YARDS:**

**CON:**

**FEDRAL:**

**ACROSS PROPERTY LINES:**

**REP QUAN:**

**DESCRIPTION:**

**DATE:** 02/17/93

**CONTINUOUS SPILL:**

**RELEASE TERMINATED:**

**UNKNOWN:**

**DATE UNKNOWN:**

**SPILL TIME:**

**ONGOING RELEASE:**

**CONTAINED:**

**ADDITIONAL INFORMATION:**

**WATERBODY:**

**LIS:**

**CATCH BASIN:**

**AIR:**

**GROUND WATER:**

**INSIDE BUILDING:**

Y

**TOTAL IN WATER:**

**TOTAL RECOVERED:**

**RESPONSIBLE PARTY:**

WESLEYAN UNIVERSITY  
186 COLLEGE ST  
MIDDLETOWN CT 6457

**RIVER:**

**TRIBUTARY:**

**POND:**

**SURFACE WATER:**

**GROUND SURFACE:**

**OTHER AREA:**

**TOTAL RECOVERED FROM WATER:**

**PHONE:**

**POLLUTER UNKNOWN:**

**CLEANUP ACTION TAKEN:**

**DUN BRAD:**

**NOTIFIED COAST GAURD:**

**NOTIFIED LOCAL FIRE DEPT:**

**NOTIFIED ATTORNEY GENERAL:**

**ACCEPT RESPONSIBILITY:** Y

**NOTIFIED FEDERAL GOVERNMENT:**

**NOTIFIED FIRE MARSHALL:**

**NOTIFIED POLICE:**

**NOTIFIED AQUACULTURE:**

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 67

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** CHURCH ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 93735  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** WESLEYAN UNIVERSITY

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** VALVE FAILURE PUMPING

**CORRECTIVE ACTION TAKEN:** NONE REQUIRED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** PORTER  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:**  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:**  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:**  
**COPY:** W

**MISCELLANEOUS INFORMATION:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 65

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** CHURCH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200004886  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/5/2000  
**TIME OF RELEASE:**  
**ACTION:** PUMPED OUT

**DISHCHARGER:** WESLEYAN UNIVERSITY  
CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/5/2000  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISHCHARGER:** WESLEYAN UNIVERSITY  
CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/5/2000  
**TIME OF RELEASE:**  
**ACTION:** CONTRACTED

**DISHCHARGER:** WESLEYAN UNIVERSITY  
CHURCH STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 7/5/2000 11:21:26 AM  
**REPORTED BY:** CHRIS GAVES  
**REPORTER S PHONE:** 6838895

**MATERIAL RELEASED:** CHLORINE  
**QUANTITY SPILLED:** 200 GAL

**CAUSE OF INCIDENT:** OVERFILL

**EMERGENCY MEASURES:** 15% LIQUID CHLORINE, OVERFILL IN POOL HOUSE CONTAINED ON SITE - D-TOX ENVIRONMENTAL

- Continued on next page -

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 65

**DIST/DIR:** 0.23 SW

**MAP ID:** 63

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** CHURCH STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200004886  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

ON SITE



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 96

**DIST/DIR:** 0.24 NE

**MAP ID:** 30

**NAME:** CHURCH OF HOLLY TRINITY  
**ADDRESS:** 381 MAIN ST.  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200002786  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 4/28/2000  
**TIME OF RELEASE:**

**DISHCHARGER:** CHURCH OF HOLLY TRINITY  
CT

**DISCHARGER S PHONE:** 860 3430096  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 4/28/2000 8:46:23 AM  
**REPORTED BY:** JEFF MARK  
**REPORTER S PHONE:** 3421559

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**

**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** TANK OUT OF SERVICE FOR TWO YEARS/1K UST REMOVAL/SAMPLE RESULTS PENDING

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA GENERATOR SITE**

**SEARCH ID:** 4

**DIST/DIR:** 0.24 NE

**MAP ID:** 7

**NAME:** YOUNGS PRINTING  
**ADDRESS:** 182 COURT ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTR000002956  
**ID2:**  
**STATUS:** VGN  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**UNIVERSE INFORMATION:**

SNC:	N - NO
BOYSNC:	N - NO
GPRA PERMIT:	N - NO
GPRA POSTCLOSURE:	N - NO
GPRA CA:	N - NO
GPRA CME:	N - NO
PERM PROG:	----
PREM WRKLD:	----
CLOSURE WRKLD:	----
P C WRKLD:	----
SUBJCA:	N - NO
SUBJCA TSD 3004:	N - NO
SUBJCA NON TSD:	N - NO
CA WRKLD:	N - NO
GEN STATUS:	CEG - CONDITIONALLY EXEMPT SMALL QUANTITY GENERATORS: GENERATES LESS THAN 100 KG/MONTH OF HAZARDOUS WASTE

IMPORTER ACTIVITY:	U - UNKNOWN	MIX WASTE GEN:	U - UNKNOWN
RECYCLER ACT:	N - NO	TRANS ACT:	N - NO
TSD ACT:	N - NO	U GRND INJ ACT:	N - NO
UNIV WASTE FAC:		TRANSFER FAC:	U - UNKNOWN
OS BURNER EXEMPT:	U - UNKNOWN	FURNACE EXEMP:	U - UNKNOWN

**USED OIL INFORMATION**

BURNER:	N - NO	PROCESSOR:	N - NO
REFINER:	N - NO	MARKET BURNER:	N
SPEC MARKETER:	N - NO	TRANSFER FAC:	N - NO
TRANSPORTER:	N - NO		
SECOND ID:		OFF SITE RECEIPT:	U - UNKNOWN
ACCESSIBILITY:		COUNTY OWNER:	
FED WSTE GEN OWNER:	HQ	FED WASTE GEN:	3
STATE WSTE GEN OWNER:		STATE WSTE GEN:	

**NAIC INFORMATION**

**ENFORCEMENT INFORMATION:**

**VIOLATION INFORMATION:**

- Continued on next page -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

RCRA GENERATOR SITE

**SEARCH ID:** 4                      **DIST/DIR:** 0.24 NE                      **MAP ID:** 7

**NAME:** YOUNGS PRINTING  
**ADDRESS:** 182 COURT ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTR000002956  
**ID2:**  
**STATUS:** VGN  
**PHONE:**

**CONTACT:**

<b>VIOLATION NUMBER:</b>	0001	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	2/7/1996	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	22a-449(c)-102(a)	<b>RESOLVED:</b>	5/10/1996
<b>TYPE:</b>	GHW		

<b>VIOLATION NUMBER:</b>	0002	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	2/7/1996	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	261.5(g)(3)	<b>RESOLVED:</b>	5/10/1996
<b>TYPE:</b>	GOR - GENERATOR OTHER REQUIREMENTS		

<b>VIOLATION NUMBER:</b>	0003	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	2/7/1996	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	22a-449(c)-101(b)(1)	<b>RESOLVED:</b>	5/10/1996
<b>TYPE:</b>	GOR - GENERATOR OTHER REQUIREMENTS		

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 45

**DIST/DIR:** 0.24 NE

**MAP ID:** 47

**NAME:** SAA  
**ADDRESS:** 405 MAIN STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200305074  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/7/2003  
**TIME OF RELEASE:**  
**ACTION:** REMOVED

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/7/2003  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 7/7/2003 1:06:35 PM  
**REPORTED BY:** MITCH HOWARD  
**REPORTER S PHONE:** 5245914

**MATERIAL RELEASED:** HYDRAULIC OIL  
**QUANTITY SPILLED:** 0.25 GAL

**CAUSE OF INCIDENT:** HOSE FAILURE

**EMERGENCY MEASURES:** HYDRAULIC LINE FAILED, SPEEDI DRI

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 32

**DIST/DIR:** 0.24 NE

**MAP ID:** 30

**NAME:** CHURCH OF HOLLY TRINITY  
**ADDRESS:** 381 MAIN ST.  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200002786  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 4/28/2000  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISCHARGER:** CHURCH OF HOLLY TRINITY  
CT

**DISCHARGER S PHONE:** 3430096  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 4/28/2000  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISCHARGER:** CHURCH OF HOLLY TRINITY  
CT

**DISCHARGER S PHONE:** 3430096  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 4/28/2000 8:46:23 AM  
**REPORTED BY:** JEFF MARK  
**REPORTER S PHONE:** 3421559

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 8 YARDS

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** TANK OUT OF SERVICE FOR TWO YEARS/1K UST REMOVAL/SAMPLE RESULTS PENDING

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 29

**DIST/DIR:** 0.24 NE

**MAP ID:** 27

**NAME:** ANATO S  
**ADDRESS:** 395 MAIN ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200203212  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** EMANUELSON, BRIAN

**SITE INFORMATION**

**DATE OF RELEASE:** 5/16/2002  
**TIME OF RELEASE:**  
**ACTION:** OTHER

**DISHCHARGER:** ANATO S  
ABOVE  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 5/16/2002 4:22:28 PM  
**REPORTED BY:** DALE  
**REPORTER S PHONE:** 3471893

**MATERIAL RELEASED:** POSSIBLE SULFUR DIOXIDE  
**CAUSE OF INCIDENT:** CONTAINER FAILURE

**EMERGENCY MEASURES:** REPORTER WAS CHIPPING ICE FROM OLD FREEZER AND FOUL ODOR ENSUED, EVAC D BLDG (3 EMPLOYEES) AND OPENED WINDOWS, CALLING FD

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 34

**DIST/DIR:** 0.24 NE

**MAP ID:** 33

**NAME:** FORD NEWS  
**ADDRESS:** 358 MAIN ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 952915  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** FORD NEWS

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 916  
**REPORT DATE:** 06/05/95  
**ACTUAL TIME:** 0  
**REPORTER:** GARY OULETTE  
FIRE DEPT

**REPORT TIME:** 16

**WORK PHONE:** 203 343 8012  
**HOME PHONE:**  
**POLE NUMBER:**  
**INCIDENT TYPE:** PETROLEUM  
**GALLONS:** 12  
**POUNDS:**  
**DRUMS:**  
**CERCLA:**  
**EMERGENCY CLEANUP:**  
**TOTAL POUNDS:**

**DISCHARGED:** COOKING OIL  
**YARDS:**  
**CON:**  
**FEDRAL:**  
**ACROSS PROPERTY LINES:**  
**REP QUAN:**

**DESCRIPTION:**

**DATE:** 06/05/95  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:** REPEAT OFFENSE RESTAURANT DUMPING USED COOKING GREASE INTO STORM  
SYSTEM - FORD NEWS REAR OF PROPERTY

**WATERBODY:**  
**LIS:**  
**CATCH BASIN:** Y  
**AIR:**  
**GROUND WATER:**  
**INSIDE BUILDING:**  
**TOTAL IN WATER:**  
**TOTAL RECOVERED:**  
**RESPONSIBLE PARTY:** FORD NEWS  
358 MAIN ST  
MIDDLETOWN CT 6457

**RIVER:**  
**TRIBUTARY:**  
**POND:**  
**SURFACE WATER:** Y  
**GROUND SURFACE:** Y  
**OTHER AREA:**  
**TOTAL RECOVERED FROM WATER:**

**PHONE:**  
**POLLUTER UNKNOWN:**  
**CLEANUP ACTION TAKEN:**  
**DUN BRAD:**  
**NOTIFIED COAST GAURD:**  
**NOTIFIED LOCAL FIRE DEPT:**

**ACCEPT RESPONSIBILITY:** Y  
  
**NOTIFIED FEDERAL GOVERNMENT:**  
**NOTIFIED FIRE MARSHALL:**  
**NOTIFIED POLICE:**

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 34

**DIST/DIR:** 0.24 NE

**MAP ID:** 33

**NAME:** FORD NEWS  
**ADDRESS:** 358 MAIN ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 952915  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** FORD NEWS

**NOTIFIED ATTORNEY GENERAL:**  
**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**CAUSE:** DUMPING

**CORRECTIVE ACTION TAKEN:** CONTAINED/REMOVED

**CONTRACTOR:**  
**DID DEP HIRE CONT:**  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** TORRES  
**ASSIGNED DATE:**  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**NOTIFIED AQUACULTURE:**  
**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CONT NAME:**  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 916  
**ASSIGNED TIME:**  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:** 06/05/95  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y  
**COPY:** 2

**MISCELLANEOUS INFORMATION:** EMPLOYEE DUMPED COOKING GREASE INTO STORM BASIN OWNER & PROPERTY MGR  
WERE DIRECTED TO HAVE THE BASIN CLEANED OUT & TO DISPOSE OF COOKING GREASE PROPERLY



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 57

**DIST/DIR:** 0.24 NE

**MAP ID:** 58

**NAME:** VALLEY OIL  
**ADDRESS:** 393 MAIN STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9706778  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 11/21/1997  
**TIME OF RELEASE:** 10:05:00 AM  
**ACTION:** REMOVED

**DISCHARGER:** VALLEY OIL  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 11/21/1997  
**TIME OF RELEASE:** 10:05:00 AM  
**ACTION:** CONTAINED

**DISCHARGER:** VALLEY OIL  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 10:49:00 AM  
**REPORTED BY:** NEIL MANLON  
**REPORTER S PHONE:** 3423500

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 5 GAL

**CAUSE OF INCIDENT:** OVERFILL

**EMERGENCY MEASURES:** LOOSE CAP ON DIRECT FILL, OIL CO. FILLING FROM REMOTE FILL, OIL DISCHARGED TO PAVEMENT. SPEEDI DRI APPLIED AND REMOVED.

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 49

**DIST/DIR:** 0.24 NE

**MAP ID:** 54

**NAME:** SCHOOL BUS  
**ADDRESS:** CORNER OF MAIN STREET& COLLEGE  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200103959  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 6/6/2001  
**TIME OF RELEASE:**  
**ACTION:** CONTAINED

**DISCHARGER:** SCHOOL BUS  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** NO

**REPORT TIME:** 6/6/2001 9:51:11 AM  
**REPORTED BY:** DISPATCHER MISSY  
**REPORTER S PHONE:** 3472541

**MATERIAL RELEASED:** DIESEL FUEL  
**QUANTITY SPILLED:** 1 GAL

**CAUSE OF INCIDENT:** SADDLE TANK FAILURE

**EMERGENCY MEASURES:** REPORTED DISCHARGE OF APPROXIMATELY 1 - GALLON OF DIESEL FUEL FROM A SCHOOL BUS -  
RESPONSE REQUESTED BY FIRE DEPARTMENT-INSPECTOR 923 CONTACTED FD AND THEY TOLD HIM NO RESPONSE NEEDED

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 83                      **DIST/DIR:** 0.24 NE                      **MAP ID:** 27

**NAME:** AMATO S INC.  
**ADDRESS:** 395 MAIN ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 01521  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 1

**TANK ID:** 1  
**TANK STATUS:** PERMANENTLY OUT OF USE-TANK REMOVED FROM GROUND

<b>DATE INSTALLED:</b>	6/1/1965	<b>DATE LAST USED:</b>	9/1/1996
<b>SUBSTANCE STORED:</b>	HEATING OIL	<b>CAPACITY (GALS):</b>	3000
<b>TANK MATERIAL:</b>	ASPHALT COATED OR BARE STEEL	<b>TANK PROTECTION:</b>	DOUBLE-WALLED
<b>PIPE MATERIAL:</b>	UNKNOWN	<b>PIPE PROTECTION:</b>	NONE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 36

**DIST/DIR:** 0.25 NE

**MAP ID:** 35

**NAME:** LEPIETAS BUILDING  
**ADDRESS:** 392 MAIN ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 951812  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** LEPIETAS BUILDING

**SITE INFORMATION**

**INSPECTOR S BADGE NUMBER:** 916  
**REPORT DATE:** 04/11/95  
**ACTUAL TIME:** 50  
**REPORTER:** DISPATCHER  
FIRE DEPT  
MAIN ST  
MIDDLETOWN CT 6457

**REPORT TIME:** 13

**WORK PHONE:** 203 346 8623

**HOME PHONE:**

**POLE NUMBER:**

**INCIDENT TYPE:** PETROLEUM

**GALLONS:**

**POUNDS:**

**DRUMS:**

**CERCLA:**

**EMERGENCY CLEANUP:**

**TOTAL POUNDS:**

**DISCHARGED:** #2 FUEL OIL

**YARDS:**

**CON:**

**FEDRAL:**

**ACROSS PROPERTY LINES:**

**REP QUAN:**

**DESCRIPTION:**

**DATE:** 04/11/95  
**CONTINUOUS SPILL:**  
**RELEASE TERMINATED:** Y  
**UNKNOWN:**

**DATE UNKNOWN:**  
**SPILL TIME:**  
**ONGOING RELEASE:**  
**CONTAINED:**

**ADDITIONAL INFORMATION:**

**WATERBODY:**

**LIS:**

**CATCH BASIN:**

**AIR:**

**GROUND WATER:**

**INSIDE BUILDING:**

**TOTAL IN WATER:**

**TOTAL RECOVERED:**

**RESPONSIBLE PARTY:**

LEPIETAS BUILDING  
392 MAIN ST  
MIDDLETOWN CT 6457

**RIVER:**

**TRIBUTARY:**

**POND:**

**SURFACE WATER:**

**GROUND SURFACE:** Y

**OTHER AREA:**

**TOTAL RECOVERED FROM WATER:**

**PHONE:**

**POLLUTER UNKNOWN:**

**CLEANUP ACTION TAKEN:**

**DUN BRAD:**

**NOTIFIED COAST GAURD:**

**NOTIFIED LOCAL FIRE DEPT:**

**NOTIFIED ATTORNEY GENERAL:**

TANKS/SOIL REMOVED

**ACCEPT RESPONSIBILITY:**

**NOTIFIED FEDERAL GOVERNMENT:**

**NOTIFIED FIRE MARSHALL:**

**NOTIFIED POLICE:**

**NOTIFIED AQUACULTURE:**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 36

**DIST/DIR:** 0.25 NE

**MAP ID:** 35

**NAME:** LEPIETAS BUILDING  
**ADDRESS:** 392 MAIN ST  
MIDDLETOWN CT

**REV:** 3/13/01  
**ID1:** 951812  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** LEPIETAS BUILDING

**NOTIFIED STATE DOHS:**  
**NOTIFIED STATE AIR BUREAU:**  
**NOTIFIED WEED HAZ WASTE:**  
**PERMITTING NOTIFIED:**  
**NOTIFIED SOLID WASTE RECOVERY:**  
**NOTIFIED P-F:**  
**NOTIFIED OPS:**  
**NOTIFIED STATE AGENCIES:**  
**NOTIFICATION TIME:**  
**DISCHARGE CLASS:**

COMMERCIAL

**NOTIFIED STATE WATER BUREAU:**  
**NOTIFIED STATE WASTE BUREAU:**  
**NOTIFIED WEED SOLID WASTE:**  
**NOTIFIED UST UNIT:**  
**NOTIFIED ENVIRONMENTAL CONSERVATION:**  
**NOTIFIED F-W:**  
**NOTIFIED OTHER:**  
**NOTIFICATION DATE:**

**CAUSE:** INGROUND TANK FAILURE

**CORRECTIVE ACTION TAKEN:** REMOVED TANK SOIL REMOVAL

**CONTRACTOR:** Y  
**DID DEP HIRE CONT:** N  
**WHEN CONT REQUESTED:**  
**ARRIVED:**  
**RECEIVED BY:** ACETO  
**ASSIGNED DATE:** 04/11/95  
**NOT 911 EMERGENCY:**  
**CT EMERGENCY SPILLFUND USED:**  
**CASE NUMBER 2:**  
**PIN:**  
**INC CODE:**  
**OTHER OWNER:**  
**PROP NAME:**

**CONT NAME:** MULCHREEST CONSTR  
**HIRE DATE:**  
**SECOND REQUEST:**  
**ARRIVED SECOND TIME:**  
**BADGE NUMBER:** 916  
**ASSIGNED TIME:** 13 50  
**NOTIFICATION STATUS:**  
**CASE NUMBER:**  
**FED GOV PAID:**  
**COST RECOVERY EXPENDITURE:**  
**PROPERTY OWNER:**

**WAS POLLUTER A TRUCK:**  
**OWNER OF TRUCK/TRAILER:**  
**OPERATORS NAME:**  
**VEHICLE MODEL:**  
**TRAILER REGISTRATION:**  
**DATE UPDATED:** 04/11/95  
**QUAN FET:**

**WAS POLLUTER A TRAILER:**  
**OWNERS NAME:**  
**MAKE OF VEHICLE:**  
**TRUCK REGISTRATION:**  
**UPDATED WITH INSPECTORS REPORT:** Y  
**COPY:** 2

**MISCELLANEOUS INFORMATION:** (1) 2K (1) 5K LUST REMOVED W 10 YDS CONTAMSOIL CONFIRMATION SAMPLES TAKEN

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE			
<b>SEARCH ID:</b> 70		<b>DIST/DIR:</b> 0.25 NW	<b>MAP ID:</b> 74
<b>NAME:</b>	WESLYAN	<b>REV:</b>	11/1/01
<b>ADDRESS:</b>	95 PEARL ST MIDDLETOWN CT	<b>ID1:</b>	200106388
		<b>ID2:</b>	
		<b>STATUS:</b>	CLOSED
<b>CONTACT:</b>	0- NO RESPONSE	<b>PHONE:</b>	
<b>CAUSE OF INCIDENT:</b> INGROUND TANK FAILURE			

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SPILLS SITE

**SEARCH ID:** 76

**DIST/DIR:** 0.25 SE

**MAP ID:** 84

**NAME:**  
**ADDRESS:** 41 HOTCHKISS STREET  
MIDDLETOWN CT

**REV:** 3/16/04  
**ID1:** 9606589  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** 0

**SITE INFORMATION**

**DATE OF RELEASE:** 12/15/1996  
**TIME OF RELEASE:** 11:50:00 AM  
**ACTION:** OTHER

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**SITE INFORMATION**

**DATE OF RELEASE:** 12/15/1996  
**TIME OF RELEASE:** 11:50:00 AM  
**ACTION:** CONTAINED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**REPORT TIME:** 12:16:00 PM  
**REPORTED BY:** VLADIMIR GRAPEYEU  
**REPORTER S PHONE:** 3449447

**MATERIAL RELEASED:** MERCURY - THERMOMETER  
**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:** 1THERMOMETER/ PICKED UP AND REMOVED

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 56

**DIST/DIR:** 0.25 SE

**MAP ID:** 57

**NAME:** UNKNOWN SOURCE  
**ADDRESS:** HUBBARD STREET  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9903347  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 5/24/1999  
**TIME OF RELEASE:**  
**ACTION:** SANDED

**DISCHARGER:** UNKNOWN SOURCE  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** NO

**REPORT TIME:** 5/24/1999 2:58:58 PM  
**REPORTED BY:** DISPATCHER STEVE  
**REPORTER S PHONE:** 3468623

**MATERIAL RELEASED:** DIESEL FUEL  
**QUANTITY SPILLED:** 5 GAL

**CAUSE OF INCIDENT:** SEEPAGE

**EMERGENCY MEASURES:** SHEEN DISCOVERED IN PARKING LOT/ SANDED BY FIRE DEPARTMENT



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**REGISTERED UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 91

**DIST/DIR:** 0.25 SE

**MAP ID:** 93

**NAME:** NATIONAL GUARD ARMORY  
**ADDRESS:** 70 MAIN ST  
MIDDLETOWN CT 06457

**REV:** 1/11/05  
**ID1:** 09079  
**ID2:**  
**STATUS:**  
**PHONE:**

**CONTACT:**

**TOTAL NUMBER OF TANKS:** 2

**TANK ID:** 1  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 1/1/1955  
**SUBSTANCE STORED:** HEATING OIL  
**TANK MATERIAL:** ASPHALT COATED OR BARE STEEL  
**PIPE MATERIAL:** BARE STEEL

**DATE LAST USED:**  
**CAPACITY (GALS):** 5000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**TANK ID:** 2  
**TANK STATUS:** CURRENTLY IN USE-

**DATE INSTALLED:** 3/1/1990  
**SUBSTANCE STORED:** HEATING OIL  
**TANK MATERIAL:** ASPHALT COATED OR BARE STEEL  
**PIPE MATERIAL:** FIBERGLASS REINFORCED PLASTIC

**DATE LAST USED:**  
**CAPACITY (GALS):** 5000  
**TANK PROTECTION:** NONE  
**PIPE PROTECTION:** NONE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 118                      **DIST/DIR:** 0.25 SW                      **MAP ID:** 64

**NAME:** WESLEYAN UNIV.  
**ADDRESS:** WESLEYAN UNIV./156 HIGH ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 9805125  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/5/1998  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN UNIV.  
156 HIGH ST  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 2222222  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 1000

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 11:46:00 AM  
**REPORTED BY:** GARY IADAROCA  
**REPORTER S PHONE:** 2829924

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF 1K UST AND CONTAMINATED SOIL

**MEDIA AFFECTED:** 3 - GROUND WATER

**WATERBODY AFFECTED:** 4 - GROUNDWATER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 59

**DIST/DIR:** 0.25 SW

**MAP ID:** 64

**NAME:** WESLEYAN UNIV.  
**ADDRESS:** WESLEYAN UNIV./156 HIGH ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 9805125  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/5/1998  
**TIME OF RELEASE:**  
**ACTION:** SOIL REMOVED

**DISHCHARGER:** WESLEYAN UNIV.  
156 HIGH ST  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 2222222  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 8/5/1998  
**TIME OF RELEASE:**  
**ACTION:** REMOVED TANK

**DISHCHARGER:** WESLEYAN UNIV.  
156 HIGH ST  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 2222222  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 11:46:00 AM  
**REPORTED BY:** GARY IADAROCA  
**REPORTER S PHONE:** 2829924

**MATERIAL RELEASED:** #2 FUEL OIL  
**QUANTITY SPILLED:** 1000 GAL

**CAUSE OF INCIDENT:** INGROUND TANK FAILURE

**EMERGENCY MEASURES:** REMOVAL OF 1K UST AND CONTAMINATED SOIL

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SPILLS SITE**

**SEARCH ID:** 82

**DIST/DIR:** 0.25 SW

**MAP ID:** 88

**NAME:**  
**ADDRESS:** WESLEYAN UNIVERSITY - C-LOT / CHURCH ST  
MIDDLETOWN CT

**REV:** 3/16/05  
**ID1:** 200105371  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/18/2001  
**TIME OF RELEASE:**  
**ACTION:** SANDED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**SITE INFORMATION**

**DATE OF RELEASE:** 7/18/2001  
**TIME OF RELEASE:**  
**ACTION:** CLEANED

**DISCHARGER:**

CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**REPORT TIME:** 7/18/2001 5:54:30 PM  
**REPORTED BY:** JEFF MILLER  
**REPORTER S PHONE:** 3017409

**MATERIAL RELEASED:** OIL  
**QUANTITY SPILLED:** 1 GAL

**CAUSE OF INCIDENT:** OTHER

**EMERGENCY MEASURES:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 13

**DIST/DIR:** 0.27 NE

**MAP ID:** 14

**NAME:** GILLETTI GARAGE & AUTO BODY  
**ADDRESS:** 310 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4483  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** GILLETTI GARAGE & AUTO BODY  
**SELLER:** DONALD GILLETTI, JR.  
**BUYER:** ANTHONY C. FONDA

<b>FORM:</b>	FORM 1	<b>RECEIVED:</b>	5/27/1997
<b>ACKNOWLEDGED:</b>	10/10/1997	<b>RETURNED:</b>	7/29/1997
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:** ROBINSON, R.

**CERTIFIER:** DONALD GILLETTI, JR., TRANSFEROR

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 13

**DIST/DIR:** 0.27 NE

**MAP ID:** 14

**NAME:** GILLETTI GARAGE & AUTO BODY  
**ADDRESS:** 310 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4483  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>RECEIVED:</b>	5/27/1997
<b>STAFF:</b>	ROBINSON, R.
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	5/27/1997
<b>OUTCOME:</b>	PTP

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 136

**DIST/DIR:** 0.27 SW

**MAP ID:** 78

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 159 HIGH ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106386  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/21/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLYAN UNIVERSITY  
186 COLLEGE ST  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/21/2001 12:15:19 PM  
**REPORTED BY:** SIDNEY NEEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**

**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** 1K LUST, NO FREE PRODUCT, GROUNDWATER NOT ENCOUNTERED,

**RELEASE CLASS:** 6 - PRIVATE

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 6 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 108

**DIST/DIR:** 0.28 NW

**MAP ID:** 53

**NAME:** SAME  
**ADDRESS:** 172 WASHINGTON STREET - WESLYAN UNIVERSI  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200206396  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 9/12/2002  
**TIME OF RELEASE:**

**DISCHARGER:** SAME  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL & WATER 30

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 9/12/2002 8:47:40 AM  
**REPORTED BY:** WILLIAM NELLIGAN  
**REPORTER S PHONE:** 6852771

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 2 - REMOVED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 11 - CLEANED  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**EMERGENCY MEASURES:** UNCOVERED AN ABANDONED LUST WHILE DIGGING A FOUNDATION. FLEET ONSITE TO PUMP OUT AND ENVIRONMENTAL CONMPANY.

**RELEASE CLASS:** 6 - PRIVATE



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 129                      **DIST/DIR:** 0.30 SW                      **MAP ID:** 72

**NAME:** WESLEYAS UNIVERSITY  
**ADDRESS:** 132 HIGH ST.  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105318  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/17/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAS UNIVERSITY  
CT

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 7/17/2001 2:27:36 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7219424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** T550 UST, THIS SPILL WAS REPORTED EARLIER.

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 115

**DIST/DIR:** 0.30 SW

**MAP ID:** 60

**NAME:** WESELYAN UNIVERSITY  
**ADDRESS:** 34 LAWN AVENUE  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106650  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/29/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESELYAN UNIVERSITY  
34 LAWN AVENUE  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/29/2001 4:03:10 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**EMERGENCY MEASURES:** 2 - INGROUND FUEL OIL TANKS - 1 - 500 GALLON AND 1 - 1,000 GALLON L.U.S.T REMOVED  
- MINIMAL SOIL CONTAMINATION - NO FREE PRODUCT - FIRE MARSHAL ON SITE

- Continued on next page -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 115

**DIST/DIR:** 0.30 SW

**MAP ID:** 60

**NAME:** WESELYAN UNIVERSITY  
**ADDRESS:** 34 LAWN AVENUE  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106650  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 131

**DIST/DIR:** 0.30 SW

**MAP ID:** 80

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 48-50 WYLLYS AVE/WESLYAN UNIVERSITY  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106681  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/30/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLYAN UNIVERSITY  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/30/2001 4:15:56 PM  
**REPORTED BY:** SIDNEY NEER  
**REPORTER S PHONE:** 7211424

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVBVSL OF 2000 GAL UST AND IMPACTED SOIL

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 117                      **DIST/DIR:** 0.32 NW                      **MAP ID:** 62

**NAME:** WESLEYAN U  
**ADDRESS:** 240 WASHINGTON ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106514  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/24/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN U  
CT

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/24/2001 11:35:01 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 5 - TEST WELLS  
**OTHER:**

**EMERGENCY MEASURES:** TANK REMOVED SOME YEARS AGO (1K), SITE ASSESSMENT REVEALED CONTAM SOIL,  
TPH 14000PPM, NO FREE PRODUCT, FURTHER ASSESSMENT

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 130

**DIST/DIR:** 0.32 NW

**MAP ID:** 73

**NAME:** WESLEYN UNIVERSITY  
**ADDRESS:** 128 PEARL STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106445  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYN UNIVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:**

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/23/2001 9:36:59 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 20 - OTHER  
**OTHER:** None

**EMERGENCY MEASURES:** 5K #2 UST 1989 - SUBSURFACE INVESTIGATION. POLLUTANT MOBILITY NOT EXCEEDED  
**AT 750 PPM. 4 FOOT CLEAN COVER**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**WATERBODY AFFECTED:** 4 - GROUNDWATER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 114                      **DIST/DIR:** 0.33 NW                      **MAP ID:** 59

**NAME:** WESELEYAN UNIVERSITY  
**ADDRESS:** 256 WASHINGTON STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205237  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/1/2002  
**TIME OF RELEASE:**

**DISHCHARGER:** WESELEYAN UNIVERSITY  
56 HAMLIN STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/1/2002 12:55:07 PM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 5298882

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**

**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF A 1,000 - GALLON LUST / NO FREE PRODUCT / FIRE MARSHAL ON SITE / GA  
**AREA**

- Continued on next page -

***Environmental FirstSearch***  
***Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 114

**DIST/DIR:** 0.33 NW

**MAP ID:** 59

**NAME:** WESELEYAN UNIVERSITY  
**ADDRESS:** 256 WASHINGTON STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205237  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 116

**DIST/DIR:** 0.34 NW

**MAP ID:** 61

**NAME:** WESLEYAN U  
**ADDRESS:** 130 MOUNT VERNON ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106512  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/24/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN U  
186 COLLEGE ST  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 6852787  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/24/2001 11:25:09 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 5 - TEST WELLS  
**OTHER:**

**EMERGENCY MEASURES:** LUST REMOVED IN 1995 (550 GAL.), CONTAM SOIL FOUND DURING SITE ASSESSMENT  
**(BORINGS), FURTHER ASSESSMENT**

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 4 - GROUNDWATER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 120

**DIST/DIR:** 0.34 NW

**MAP ID:** 32

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 202 WASHINGTON STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105535  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 7/24/2001  
**TIME OF RELEASE:**

**DISCHARGER:** WESLEYAN UNIVERSITY  
202 WASHINGTON STREET  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 7/24/2001 4:39:03 PM  
**REPORTED BY:** SIDNEY NEER  
**REPORTER S PHONE:** 9560665

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF A 550 - GALLON L.U.S.T / NO FREE PRODUCT / FIRE MARSHAL ON SITE / GB  
**AREA**

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 120

**DIST/DIR:** 0.34 NW

**MAP ID:** 32

**NAME:** WESLEYAN UNIVERSITY  
**ADDRESS:** 202 WASHINGTON STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105535  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 98

**DIST/DIR:** 0.36 SE

**MAP ID:** 5

**NAME:** MIDDLESEX HOSPITAL /TIM KAVANAUGH  
**ADDRESS:** 8 CRESCENT ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200207145  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/10/2002  
**TIME OF RELEASE:**

**DISHCHARGER:** MIDDLESEX HOSPITAL /TIM KAVANAUGH  
28 crescent st  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:** 860 3446590  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 10/10/2002 3:39:26 PM  
**REPORTED BY:** TIM WASIELEWSKI  
**REPORTER S PHONE:** 3493559

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** REMOVED 550 LUST, SAMPLED SOILS

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 102                      **DIST/DIR:** 0.37 NW                      **MAP ID:** 51

**NAME:** SAA  
**ADDRESS:** WESLEYAN UNIVERSITY 125 MOUNT VERNON  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200404030  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 6/17/2004  
**TIME OF RELEASE:**

**DISCHARGER:** SAA  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 6/17/2004 3:20:36 PM  
**REPORTED BY:** BILL NELLIGAN  
**REPORTER S PHONE:** 6852771

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** 550 LUST REMOVAL

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 112

**DIST/DIR:** 0.38 NE

**MAP ID:** 46

**NAME:** TOWN  
**ADDRESS:** TOWN HALL  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200008459  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** EMANUELSON, BRIAN

**SITE INFORMATION**

**DATE OF RELEASE:** 11/7/2000  
**TIME OF RELEASE:** 1:21:00 PM

**DISCHARGER:** TOWN  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 11/7/2000 1:21:13 PM  
**REPORTED BY:** MAURA  
**REPORTER S PHONE:** 3443479

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** SUSPECTED LUST BEING REMOVED 11-9-00.

**RELEASE CLASS:** 5 - GOVERNMENTAL

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 100

**DIST/DIR:** 0.42 NW

**MAP ID:** 40

**NAME:** MR. SARACENO  
**ADDRESS:** 143 LIBERTY ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200107179  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 9/19/2001  
**TIME OF RELEASE:**

**DISCHARGER:** MR. SARACENO  
ABOVE  
CT

**DISCHARGER S PHONE:** 860 3466205  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 9/19/2001 11:36:23 AM  
**REPORTED BY:** MARTIN MCKINNEY  
**REPORTER S PHONE:** 8482278

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVED 550 LUST, REMOVING SOIL FOR STOCKPILE

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 135                      **DIST/DIR:** 0.43 SW                      **MAP ID:** 77

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 36 MANSFIELD TERRACE  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200305734  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/5/2003  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLYAN UNIVERSITY  
CT

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/5/2003 10:32:18 AM  
**REPORTED BY:** CARTER  
**REPORTER S PHONE:** 7443477

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**EMERGENCY MEASURES:** 1K LUST, SLIGHT SHEEN FROM SOIL TO GROUND WATER,

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 4 - GROUNDWATER



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

LEAKING UNDERGROUND STORAGE TANKS

**SEARCH ID:** 103

**DIST/DIR:** 0.45 SW

**MAP ID:** 50

**NAME:** SAA  
**ADDRESS:** 48 HOME AVE  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106450  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/23/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** SAA  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/23/2001 10:31:23 AM  
**REPORTED BY:** SYDNEY NEER  
**REPORTER S PHONE:** 7211424

**AGENCY NOTIFIED:** 8 - DEP DISPATCH  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 3 - CONTAINED  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**ACTION TAKEN:** 2 - REMOVED  
**OTHER:**

**ACTION TAKEN:** 11 - CLEANED  
**OTHER:**

**EMERGENCY MEASURES:** 1K UST - NO TPH

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 127

**DIST/DIR:** 0.46 NW

**MAP ID:** 70

**NAME:** WESLEYAN UNIVERSITY(DAVID HALL)  
**ADDRESS:** 346 WASHINGTON ST  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200105900  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/7/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLEYAN UNIVERSITY(DAVID HALL)  
CT

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/7/2001 11:04:14 AM  
**REPORTED BY:** PETE CANOVA  
**REPORTER S PHONE:** 5842085

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVED 550 LUST, REMOVING SOIL

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

**WATERBODY AFFECTED:** 9 - OTHER

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 15                      **DIST/DIR:** 0.46 NW                      **MAP ID:** 16

**NAME:** JAS MUFFLER, INC.  
**ADDRESS:** 380 WASHINGTON STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4484  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** JAS MUFFLER, INC.  
**SELLER:** WEBSTER ASSOCIATES  
**BUYER:** BUTON, LLC

<b>FORM:</b>	FORM 1	<b>RECEIVED:</b>	1/6/1998
<b>ACKNOWLEDGED:</b>	4/22/1998	<b>RETURNED:</b>	2/27/1998
<b>CERTIFIED:</b>		<b>REVISED:</b>	3/30/1998
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:**

**CERTIFIER:** WEBSTER ASSOCIATES, TRANSFEROR

**FIRST PAYMENT:** \$200                      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -

***Environmental FirstSearch  
Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 15

**DIST/DIR:** 0.46 NW

**MAP ID:** 16

**NAME:** JAS MUFFLER, INC.  
**ADDRESS:** 380 WASHINGTON STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4484  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>RECEIVED:</b>	1/6/1998
<b>STAFF:</b>	
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	1/6/1998
<b>OUTCOME:</b>	PTP

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 19                      **DIST/DIR:** 0.46 SE                      **MAP ID:** 6

**NAME:** MIDDLETOWN PRESS PUBLISHING  
**ADDRESS:** 2 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4488  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

THE DORMERS CORPORATION  
CONNECTICUT NEWSPAPERS INC  
CONNECTICUT NEWSPAPERS INC  
THE DORMERS CORPORATION

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** MIDDLETOWN PRESS/CT NEWSPAPER  
**SELLER:** CONNECTICUT NEWSPAPERS IN  
**BUYER:** MIDLDTOWN ACQUISITION

<b>FORM:</b>	FORM I	<b>RECEIVED:</b>	9/18/1995
<b>ACKNOWLEDGED:</b>	10/24/1995	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:**

**CERTIFIER:** CONNECTICUT NEWSPAPERS, TRANSFEROR

**FIRST PAYMENT:** \$200                      **SECOND PAYMENT:** \$

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 19

**DIST/DIR:** 0.46 SE

**MAP ID:** 6

**NAME:** MIDDLETOWN PRESS PUBLISHING  
**ADDRESS:** 2 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4488  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** MIDDLETOWN PRESS PUBLISHING  
**SELLER:** THE DORMERS CORPORATION  
**BUYER:** MIDDLETOWN ACQUISITION

<b>FORM:</b>	FORM I	<b>RECEIVED:</b>	9/18/1995
<b>ACKNOWLEDGED:</b>	10/24/1995	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:**

**CERTIFIER:** THE DORMERS CORP., TRANSFEROR

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** MIDDLETOWN PRESS PUBLISHING  
**SELLER:** MIDDLETOWN PRESS PUB CO  
**BUYER:** CONNECTICUT NEWSPAPERS

<b>FORM:</b>	FORM I	<b>RECEIVED:</b>	9/11/1995
<b>ACKNOWLEDGED:</b>	12/14/1995	<b>RETURNED:</b>	10/30/1995
<b>CERTIFIED:</b>		<b>REVISED:</b>	11/17/1995
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:**

**CERTIFIER:** MIDDLETOWN PRESS, TRANSFEROR

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 19

**DIST/DIR:** 0.46 SE

**MAP ID:** 6

**NAME:** MIDDLETOWN PRESS PUBLISHING  
**ADDRESS:** 2 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4488  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** MIDDLETOWN PRESS/DORMERS CORP  
**SELLER:** THE DORMERS CORP.  
**BUYER:** MIDDLETOWN PRESS PUB. CO.

**FORM:** FORM I  
**ACKNOWLEDGED:** 11/27/1991  
**CERTIFIED:**  
**ECAF RECEIVED:**

**RECEIVED:** 10/15/1991  
**RETURNED:**  
**REVISED:**  
**ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:** DORMERS CORPORATION, TRANSFEROR

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** 2 MAIN STREET  
**SELLER:** MIDDLETOWN PRESS CORP.  
**BUYER:** CT NEWSPAPERS, INC.

**FORM:** FORM I  
**ACKNOWLEDGED:**  
**CERTIFIED:**  
**ECAF RECEIVED:**

**RECEIVED:** 9/11/1995  
**RETURNED:**  
**REVISED:**  
**ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:**

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

- More Details Exist For This Site; Max Page Limit Reached -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 134

**DIST/DIR:** 0.47 SW

**MAP ID:** 76

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 69 HIGH S/WESLYAN UNIV.  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205602  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/14/2002  
**TIME OF RELEASE:**

**DISCHARGER:** WESLYAN UNIVERSITY  
MIDDLETOWN CT 06457

**DISCHARGER S PHONE:**  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/14/2002 4:18:00 PM  
**REPORTED BY:** CHRISTINE MATHERLY  
**REPORTER S PHONE:** 5298882

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 18 - SOIL REMOVED  
**OTHER:**

**EMERGENCY MEASURES:** REMOVAL OF 1K UST

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 107

**DIST/DIR:** 0.48 SW

**MAP ID:** 52

**NAME:** SAINT PAUL LUTHERAN CHURCH  
**ADDRESS:** 76 HIGH STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200407828  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 11/12/2004  
**TIME OF RELEASE:**

**DISHCHARGER:** SAINT PAUL LUTHERAN CHURCH  
CT

**DISCHARGER S PHONE:** 860 3469107  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 11/12/2004 3:52:33 PM  
**REPORTED BY:** JEFF MERK  
**REPORTER S PHONE:** 2502050

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISIPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 4 - CONTRACTED  
**OTHER:**

**EMERGENCY MEASURES:** 1000 GAL LUST, NO FREE PRODUCT OR GROUNDWATER, REMEDIATION TO OCCUR

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 6 - OTHER

***Environmental FirstSearch***  
***Site Detail Report***

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 109                      **DIST/DIR:** 0.49 NE                      **MAP ID:** 17

**NAME:** THE CONNECTION INC.  
**ADDRESS:** 605 MAIN STREET  
MIDDLETOWN CT 06457

**REV:**  
**ID1:** 4418  
**ID2:**  
**STATUS:** YES  
**PHONE:**

**CONTACT:**

**REPORT DATE:** 03-05-95  
**MATERIAL:** STEEL  
**LOW CAPACITY:** 2000  
**PRODUCT:** HF2

**FED REG:** NO  
**NUMBER OF TANKS:** 1  
**HIGH CAPACITY:** 2000

**TANK REMOVED:** YES  
**TANK RELEASE:** YES

**UNCONTROLLED RELEASE:** YES  
**PIPING RELEASE:** YES

**EMERGENCY:**  
**OVERFILL RELEASE:**

**REMEDICATION:**  
**REFERRED:**  
**COMMENT:**

**COMPLETE:** YES

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 16

**DIST/DIR:** 0.49 NE

**MAP ID:** 17

**NAME:** LIBERTY LTD. PARTNERSHIP  
**ADDRESS:** 605 MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 2526  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** HYDRO/OIL - HYDROCARBONS AND/OR FUEL OIL  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:** UST

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:** MCDANIEL, M.

**UPDATED PROGRAM:** D&A

**UPDATED:** 7/27/1995

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

LIBERTY STREET REALTY, INC  
LIBERTY STREET REALTY, INC

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** SPILLS  
**RECEIVED:** 7/26/1995  
**STAFF:**  
**PROGRAM:**  
**ASSIGNED:**  
**COMPLETED:**  
**OUTCOME:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 128

**DIST/DIR:** 0.49 NW

**MAP ID:** 71

**NAME:** WESLEYAN UNIVERSITY--DAVE HALL  
**ADDRESS:** 356 WASHINGTON STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200205379  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/6/2002  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLEYAN UNIVERSITY--DAVE HALL  
CT

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/6/2002 4:12:20 PM  
**REPORTED BY:** CHRISTINE MATERLY  
**REPORTER S PHONE:** 5298882

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** REMOVED UST REMOVED, 110 PPM TPH

**RELEASE CLASS:** 6 - PRIVATE

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 110

**DIST/DIR:** 0.49 NW

**MAP ID:** 41

**NAME:** TILLER ASSOCIATES  
**ADDRESS:** 127 GRAND STREET  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200108767  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 10/26/2001  
**TIME OF RELEASE:**

**DISCHARGER:** TILLER ASSOCIATES  
CT

**DISCHARGER S PHONE:** 860 3474481  
**ACCEPTS RESPONSIBILITY:**

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 10/26/2001 3:57:05 PM  
**REPORTED BY:** TOM  
**REPORTER S PHONE:** 3474481

**AGENCY NOTIFIED:** 3 - LOCAL FIRE MARSHAL  
**OTHER:**  
**DEP BUREAU:**  
**DEP DIVISIPN:**

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**ACTION TAKEN:** 12 - PUMPED OUT  
**OTHER:**

**EMERGENCY MEASURES:** 3000K LUST NO FREE PRODUCT OR GROUNDWATER

**RELEASE CLASS:** 8 - COMMERCIAL

**MEDIA AFFECTED:** 4 - GROUND SURFACE

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**LEAKING UNDERGROUND STORAGE TANKS**

**SEARCH ID:** 132

**DIST/DIR:** 0.50 SW

**MAP ID:** 79

**NAME:** WESLYAN UNIVERSITY  
**ADDRESS:** 49 BRAINARD AVE  
MIDDLETOWN CT 06457

**REV:** 3/7/05  
**ID1:** 200106226  
**ID2:**  
**STATUS:** CLOSED  
**PHONE:**

**CONTACT:** NO RESPONSE

**SITE INFORMATION**

**DATE OF RELEASE:** 8/15/2001  
**TIME OF RELEASE:**

**DISHCHARGER:** WESLYAN UNIVERSITY  
SAA  
CT

**DISCHARGER S PHONE:** 860 6853764  
**ACCEPTS RESPONSIBILITY:** YES

**MATERIAL RELEASED (GAL):** #2 FUEL OIL 0

**CAUSE OF INCIDENT:** 3 - INGROUND TANK FAILURE  
**OTHER:**

**REPORT TIME:** 8/15/2001 11:29:10 AM  
**REPORTED BY:** TRISHA  
**REPORTER S PHONE:** 8829391

**AGENCY NOTIFIED:** 9 - DEP  
**OTHER:**  
**DEP BUREAU:** BUREAU OF WASTE MANAGEMENT  
**DEP DIVISPN:** OIL AND CHEMICAL SPILL RESPONSE

**ACTION TAKEN:** 17 - REMOVED TANK  
**OTHER:**

**EMERGENCY MEASURES:** 1K LUST, NO FREE PRODUCT, GROUNDWATER NOT ENCOUNTERED

**RELEASE CLASS:** 5 - GOVERNMENTAL

**MEDIA AFFECTED:** 6 - OTHER

**JOB:** 40990.00

Site Details Page - 153

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 6                      **DIST/DIR:** 0.56 SE                      **MAP ID:** 8

**NAME:** C. B. STONE INC.  
**ADDRESS:** 53 WARWICK STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4477  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** C. B. STONE INC.  
**SELLER:** C.B. STONE INC.  
**BUYER:** MAXWHALE CORP.

**FORM:** FORM 1  
**ACKNOWLEDGED:** 5/10/1988  
**CERTIFIED:**  
**ECAF RECEIVED:**

**RECEIVED:** 3/28/1988  
**RETURNED:**  
**REVISED:**  
**ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:**

**FIRST PAYMENT:** \$                      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -



*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 6                      **DIST/DIR:** 0.56 SE                      **MAP ID:** 8

**NAME:** C. B. STONE INC.  
**ADDRESS:** 53 WARWICK STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4477  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

**SOURCE:** PTP - PROPERTY TRANSFER PROGRAM  
**RECEIVED:** 3/28/1988  
**STAFF:**  
**PROGRAM:** PTP - PROPERTY TRANSFER PROGRAM  
**ASSIGNED:**  
**COMPLETED:** 3/28/1988  
**OUTCOME:** PTP

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 7

**DIST/DIR:** 0.59 NE

**MAP ID:** 9

**NAME:** CL&P  
**ADDRESS:** DEKOVEN DRIVE  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 1007  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** COAL TAR  
**WASTE TYPE2:** VOC - VOLATILE ORGANIC COMPOUNDS  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

HARTFORD ELECTRIC  
NORTHEAST UTILITIES  
NORTHEAST UTILITIES  
HARTFORD ELECTRIC

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** SUPERFUND - DEP WASTE BUREAU - SUPERFUND SITE DISCOVERY  
**RECEIVED:** 4/3/1991  
**STAFF:**  
**PROGRAM:**  
**ASSIGNED:**  
**COMPLETED:**  
**OUTCOME:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA COR SITE**

**SEARCH ID:** 2                      **DIST/DIR:** 0.64 SW                      **MAP ID:** 3

**NAME:** NORTH & JUDD INC  
**ADDRESS:** 56 PAMEACHA AVE  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD021814207  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2036322600

**CONTACT:** KAREN HARSELL

**SITE INFORMATION**

**UNIVERSE INFORMATION:**

<b>SNC:</b>	N - NO
<b>BOYSNC:</b>	N - NO
<b>GPRA PERMIT:</b>	N - NO
<b>GPRA POSTCLOSURE:</b>	+
<b>GPRA CA:</b>	N - NO
<b>GPRA CME:</b>	N - NO
<b>PERM PROG:</b>	L----
<b>PREM WRKLD:</b>	-----
<b>CLOSURE WRKLD:</b>	-----
<b>P C WRKLD:</b>	-----
<b>SUBJCA:</b>	Y - SUBJECT TO CORRECTIVE ACTION
<b>SUBJCA TSD 3004:</b>	N - NO
<b>SUBJCA NON TSD:</b>	N - NO
<b>CA WRKLD:</b>	N - NO
<b>GEN STATUS:</b>	N

<b>IMPORTER ACTIVITY:</b>	U - UNKNOWN	<b>MIX WASTE GEN:</b>	U - UNKNOWN
<b>RECYCLER ACT:</b>	U - UNKNOWN	<b>TRANS ACT:</b>	U - UNKNOWN
<b>TSD ACT:</b>	N - NO	<b>U GRND INJ ACT:</b>	U - UNKNOWN
<b>UNIV WASTE FAC:</b>	U	<b>TRANSFER FAC:</b>	U - UNKNOWN
<b>OS BURNER EXEMPT:</b>	U - UNKNOWN	<b>FURNACE EXEMP:</b>	U - UNKNOWN

<b>IMPORTER ACTIVITY:</b>	U - UNKNOWN	<b>MIX WASTE GEN:</b>	U - UNKNOWN
<b>RECYCLER ACT:</b>	N - NO	<b>TRANS ACT:</b>	N - NO
<b>TSD ACT:</b>	Y - YES	<b>U GRND INJ ACT:</b>	N - NO
<b>UNIV WASTE FAC:</b>		<b>TRANSFER FAC:</b>	U - UNKNOWN
<b>OS BURNER EXEMPT:</b>	U - UNKNOWN	<b>FURNACE EXEMP:</b>	U - UNKNOWN

**USED OIL INFORMATION**

<b>BURNER:</b>	U - UNKNOWN	<b>PROCESSOR:</b>	U - UNKNOWN
<b>REFINER:</b>	U - UNKNOWN	<b>MARKET BURNER:</b>	U
<b>SPEC MARKETER:</b>	U - UNKNOWN	<b>TRANSFER FAC:</b>	U - UNKNOWN
<b>TRANSPORTER:</b>	U - UNKNOWN		

<b>BURNER:</b>	N - NO	<b>PROCESSOR:</b>	N - NO
<b>REFINER:</b>	N - NO	<b>MARKET BURNER:</b>	N
<b>SPEC MARKETER:</b>	N - NO	<b>TRANSFER FAC:</b>	N - NO
<b>TRANSPORTER:</b>	N - NO		

<b>SECOND ID:</b>		<b>OFF SITE RECEIPT:</b>	U - UNKNOWN
<b>ACCESSIBILITY:</b>		<b>COUNTY OWNER:</b>	
<b>FED WSTE GEN OWNER:</b>	HQ	<b>FED WASTE GEN:</b>	N
<b>STATE WSTE GEN OWNER:</b>	HQ	<b>STATE WSTE GEN:</b>	N - NO

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### RCRA COR SITE

**SEARCH ID:** 2                      **DIST/DIR:** 0.64 SW                      **MAP ID:** 3

**NAME:** NORTH & JUDD INC  
**ADDRESS:** 56 PAMEACHA AVE  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD021814207  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2036322600

**CONTACT:** KAREN HARSELL

<b>SECOND ID:</b> <b>ACCESSIBILITY:</b> <b>FED WSTE GEN OWNER:</b> HQ <b>STATE WSTE GEN OWNER:</b>	<b>OFF SITE RECEIPT:</b> U - UNKNOWN <b>COUNTY OWNER:</b> <b>FED WASTE GEN:</b> 1 <b>STATE WSTE GEN:</b>
---	---

**NAIC INFORMATION**

331511 - IRON FOUNDRIES  
 331524 - ALUMINUM FOUNDRIES (EXCEPT DIE-CASTING)  
 331511 - IRON FOUNDRIES  
 331511 - IRON FOUNDRIES

**ENFORCEMENT INFORMATION:**

<b>AGENCY:</b>	S - STATE	<b>DATE:</b>	9/20/1988
<b>TYPE:</b>	310 - FINAL 3008(A) COMPLIANCE ORDER		
<b>AGENCY:</b>	S - STATE	<b>DATE:</b>	5/20/1992
<b>TYPE:</b>	510 - CIVIL ACTION FOR COMPLIANCE		
<b>AGENCY:</b>	S - STATE	<b>DATE:</b>	6/21/1994
<b>TYPE:</b>	622 - STIPULATED JUDICIAL ORDER, WITH PENALTY		

**VIOLATION INFORMATION:**

<b>VIOLATION NUMBER:</b>	0001	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	9/23/1987	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>		<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	DFR - TSD FINANCIAL RESPONSIBILITY REQUIREMENTS		
<b>VIOLATION NUMBER:</b>	0002	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	6/3/1988	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>		<b>RESOLVED:</b>	12/22/1988
<b>TYPE:</b>	DOT - TSD OTHER REQUIREMENTS (OVERSIGHT LEVEL)		
<b>VIOLATION NUMBER:</b>	0003	<b>RESPONSIBLE:</b>	S - STATE
<b>DETERMINED:</b>	6/3/1988	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>		<b>RESOLVED:</b>	12/22/1988
<b>TYPE:</b>	DOT - TSD OTHER REQUIREMENTS (OVERSIGHT LEVEL)		
<b>VIOLATION NUMBER:</b>	0006	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>		<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	DLB - TSD LAND BAN REQUIREMENTS		
<b>VIOLATION NUMBER:</b>	0008	<b>RESPONSIBLE:</b>	S - STATE

- Continued on next page -

# Environmental FirstSearch

## Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

### RCRA COR SITE

**SEARCH ID:** 2

**DIST/DIR:** 0.64 SW

**MAP ID:** 3

**NAME:** NORTH & JUDD INC  
**ADDRESS:** 56 PAMEACHA AVE  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD021814207  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2036322600

**CONTACT:** KAREN HARSELL

<b>DETERMINED:</b>	1/26/1993	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.11	<b>RESOLVED:</b>	
<b>TYPE:</b>	GHW		
<b>VIOLATION NUMBER:</b>	0009	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.11	<b>RESOLVED:</b>	
<b>TYPE:</b>	GHW		
<b>VIOLATION NUMBER:</b>	0010	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.34(a)(1)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GMC - GENERATOR SATELITE ACCUMULATION AREA CONTAINER MANAGEMENT		
<b>VIOLATION NUMBER:</b>	0011	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.23(a)(3) 262.40(a)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GMR - GENERATOR MANIFEST REQUIREMENTS		
<b>VIOLATION NUMBER:</b>	0012	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.34(a)(2)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GMC - GENERATOR SATELITE ACCUMULATION AREA CONTAINER MANAGEMENT		
<b>VIOLATION NUMBER:</b>	0013	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.20(a)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GMR - GENERATOR MANIFEST REQUIREMENTS		
<b>VIOLATION NUMBER:</b>	0014	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	22a-449(c)-11(a)&(b)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	TOR - TRANSPORTER OTHER REQUIREMENTS		
<b>VIOLATION NUMBER:</b>	0015	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	22a-449(c)-102(b)(2)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GIS		
<b>VIOLATION NUMBER:</b>	0016	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	22a-449(c)-102(b)(2)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GIS		
<b>VIOLATION NUMBER:</b>	0017	<b>RESPONSIBLE:</b>	E - EPA
<b>DETERMINED:</b>	7/26/1990	<b>DETERMINED BY:</b>	S - STATE
<b>CITATION:</b>	262.34(a)	<b>RESOLVED:</b>	1/26/1993
<b>TYPE:</b>	GMC - GENERATOR SATELITE ACCUMULATION AREA CONTAINER MANAGEMENT		
<b>VIOLATION NUMBER:</b>	0018	<b>RESPONSIBLE:</b>	E - EPA

- More Details Exist For This Site; Max Page Limit Reached -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 20

**DIST/DIR:** 0.64 SW

**MAP ID:** 3

**NAME:** NORTH & JUDD FOUNDRY  
**ADDRESS:** 56 PAMEACHA AVENUE  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 236  
**ID2:** CTD021814207  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** METALS  
**WASTE TYPE2:** SOLVENTS  
**WASTE TYPE3:**

**DISPOSAL METHOD:** LANDFILL SEPTIC

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:** UNK  
**OTHER DEP:** RCRA - DEP WASTE BUREAU - WASTE ENGINEERING & ENFORCEMENT DIVISION  
**UPDATED BY:** NEVILLE, T.  
**UPDATED PROGRAM:** FPPE  
**UPDATED:** 5/29/1992  
**SW CLASSIFICATION:** A  
**GW CLASSIFICATION:** GB - HIGH YIELD - N.P.P.

**COMMENTS:** AKA: NORTH & JUDD/G & W WASTE DISPOSAL: WASTE PILE, TO GROUND. COMPANY IN OPERATION SINCE 1890. OLD SEPTIC SYSTEM EXCAVATED; SOIL REMOVED UNDER DEP SUPERVISION. GROUNDWATER MONITORING WELLS INSTALLED. ORDER HM-534 - 9/20/88

**SITE NAMES**

GULF & WESTERN  
GULF & WESTERN

**COMMENTS:**

**FEDERAL INFORMATION**

<b>ON CERCLIS:</b>	YES	<b>EPI SITE:</b>	YES
<b>ARCHIVE:</b>	NO	<b>ARCHIVE DATE:</b>	
<b>EPA REMOVAL:</b>	NO	<b>DEFERRED:</b>	YES
<b>ON NPL:</b>	NO	<b>PART NPL:</b>	NO
<b>RCRA STAT:</b>	LD	<b>RCRA PERMIT:</b>	
<b>FED FAC:</b>	NO		

**INVENTORY INFORMATION**

<b>REQUEST STAFF:</b>	DEP	<b>PROGRAM:</b>	SUPERFUND
<b>DATE ADDED:</b>	7/6/1987	<b>ON INVENTORY:</b>	YES
<b>ASSESSED:</b>	YES	<b>87 GROUP:</b>	RI
<b>87 ORIGIN:</b>	INVENTORY	<b>ON 87:</b>	YES

**REMEDIAL INFORMATION**

**TYPE:** SRP

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 20                      **DIST/DIR:** 0.64 SW                      **MAP ID:** 3

**NAME:** NORTH & JUDD FOUNDRY  
**ADDRESS:** 56 PAMEACHA AVENUE  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 236  
**ID2:** CTD021814207  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

<b>PROGRAM:</b>	USP - DEP WATER BUREAU - URBAN SITES REMEDIAL ACTION PROGRAM		
<b>ENTERED:</b>			
<b>STAFF:</b>	HATHAWAY, R.	<b>COMPLETE:</b>	
<b>ASSIGNED:</b>		<b>PHASE:</b>	GWM
<b>ORDER ISSUED:</b>	NO	<b>ORDER NUMBER:</b>	
<b>ORDER DATE:</b>		<b>INVESTIGATION START:</b>	
<b>COMPLETED:</b>		<b>DESIGN START:</b>	
<b>DESIGN DONE:</b>		<b>ACTION START:</b>	
<b>ACTION DONE:</b>		<b>OPERATION START:</b>	
<b>GW MONITORING:</b>	NO		

**REFERRAL INFORMATION**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	SUPERFUND - DEP WASTE BUREAU - SUPERFUND SITE DISCOVERY
<b>RECEIVED:</b>	7/6/1987
<b>STAFF:</b>	DEP
<b>PROGRAM:</b>	SUPERFUND - DEP WASTE BUREAU - SUPERFUND SITE DISCOVERY
<b>ASSIGNED:</b>	7/6/1987
<b>COMPLETED:</b>	7/6/1987
<b>OUTCOME:</b>	INVENTORY

<b>SOURCE:</b>	PCB PROG - DEP WASTE BUREAU - PCB PROGRAM
<b>RECEIVED:</b>	7/5/1994
<b>STAFF:</b>	
<b>PROGRAM:</b>	D&A
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	
<b>OUTCOME:</b>	

**ASSESS INFORMATION**

<b>TYPE:</b>	PA	<b>STAFF:</b>	EPA
<b>PROGRAM:</b>	FPRE	<b>ASSIGNED:</b>	
<b>DRAFT:</b>	5/12/1992	<b>REVIEWER:</b>	NEVILLE, T.
<b>REVIEWED:</b>	6/18/1992	<b>FINAL:</b>	7/29/1992
<b>NFA:</b>	NO		

# Environmental FirstSearch Site Detail Report

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

## STATE SITE

**SEARCH ID:** 18                      **DIST/DIR:** 0.71 SE                      **MAP ID:** 1

<b>NAME:</b> MARINO PROPERTY <b>ADDRESS:</b> 50 WALNUT STREET MIDDLETOWN CT  <b>CONTACT:</b>	<b>REV:</b> 2/22/05 <b>ID1:</b> 950 <b>ID2:</b> CTD062199369 <b>STATUS:</b> SUSPECTED <b>PHONE:</b>
--	---

### SITE INFORMATION

**WASTE TYPE1:** CHEMICAL LIQUIDS  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:** SPILL/DUMP

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:** MCDANIEL, M.

**UPDATED PROGRAM:** FPRE

**UPDATED:** 5/10/1995

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:** DISPOSAL ACTIVITIES: LIQUID CHEMICALS TO GROUND, DRUM BURIAL REFERRED TO EPA FOR REMOVAL ASSESSMENT. NO PA DONE. (5/95)

### SITE NAMES

**COMMENTS:**

### FEDERAL INFORMATION

<b>ON CERCLIS:</b>	YES	<b>EPI SITE:</b>	NO
<b>ARCHIVE:</b>	NO	<b>ARCHIVE DATE:</b>	
<b>EPA REMOVAL:</b>	NO	<b>DEFERRED:</b>	NO
<b>ON NPL:</b>	NO	<b>PART NPL:</b>	NO
<b>RCRA STAT:</b>		<b>RCRA PERMIT:</b>	
<b>FED FAC:</b>	NO		

### GAO INFORMATION

<b>SURVEY STAFF:</b>	MCDANIEL, M.	<b>GAO RANK:</b>	H
<b>DEP STATUS:</b>		<b>COMMENTS:</b>	YES
<b>PTP FORM:</b>		<b>FORM RECEIVED:</b>	
<b>PTP STAT:</b>		<b>PTP STAFF:</b>	
<b>ECAF RECEIVED:</b>		<b>OVERSIGHT:</b>	
<b>DETERMINATION DATE:</b>		<b>ON SPL:</b>	NO
<b>SRP STATUS:</b>		<b>SRP STAFF:</b>	
<b>ORDER:</b>	NO	<b>USP SITE:</b>	NO
<b>USP STAFF:</b>		<b>RA DONE:</b>	
<b>REMEDIED:</b>		<b>133Y SITE:</b>	NO
<b>133Y STAFF:</b>		<b>BROWNFIELD SA:</b>	NO

- Continued on next page -



**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 18

**DIST/DIR:** 0.71 SE

**MAP ID:** 1

**NAME:** MARINO PROPERTY  
**ADDRESS:** 50 WALNUT STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 950  
**ID2:** CTD062199369  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**TBSA STAFF:**

**PWP SITE:**

NO

**REFERRAL INFORMATION**

<b>SOURCE:</b>	COMPLAINT - RECEIVED FROM OR SUBMITTED BY AN OUTSIDE PARTY
<b>RECEIVED:</b>	8/7/1990
<b>STAFF:</b>	MCDANIEL, M.
<b>PROGRAM:</b>	D&A
<b>ASSIGNED:</b>	8/7/1990
<b>COMPLETED:</b>	9/8/1992
<b>OUTCOME:</b>	EPA

**ASSESS INFORMATION**

<b>TYPE:</b>	SI	<b>STAFF:</b>	EPA
<b>PROGRAM:</b>	FPRE	<b>ASSIGNED:</b>	
<b>DRAFT:</b>	2/24/1995	<b>REVIEWER:</b>	MCDANIEL, M.
<b>REVIEWED:</b>	5/5/1995	<b>FINAL:</b>	5/5/1995
<b>NFA:</b>	NO		

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 17

**DIST/DIR:** 0.75 NW

**MAP ID:** 18

**NAME:** LONGWORTH-CARLSON INC.  
**ADDRESS:** 55 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4485  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** LONGWORTH-CARLSON INC.  
**SELLER:** ROBINA S. LEIBMAN  
**BUYER:** RICHARD AND MARIA BERGAN

**FORM:** FORM I  
**ACKNOWLEDGED:** 3/5/1995  
**CERTIFIED:**  
**ECAF RECEIVED:**

**RECEIVED:** 1/4/1995  
**RETURNED:**  
**REVISED:**  
**ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:**

**FIRST PAYMENT:** \$200      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 17

**DIST/DIR:** 0.75 NW

**MAP ID:** 18

**NAME:** LONGWORTH-CARLSON INC.  
**ADDRESS:** 55 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4485  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

**SOURCE:** PTP - PROPERTY TRANSFER PROGRAM  
**RECEIVED:** 1/4/1995  
**STAFF:**  
**PROGRAM:** PTP - PROPERTY TRANSFER PROGRAM  
**ASSIGNED:**  
**COMPLETED:** 1/4/1995  
**OUTCOME:** PTP

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 9                      **DIST/DIR:** 0.75 NW                      **MAP ID:** 11

**NAME:** CT VALLEY COACH & FRAME, LTD.  
**ADDRESS:** 52 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4479  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** CT VALLEY COACH & FRAME, LTD.  
**SELLER:** ELAINE H. O CONNOR  
**BUYER:** RED WING DEPOT

<b>FORM:</b>	FORM I	<b>RECEIVED:</b>	8/8/1995
<b>ACKNOWLEDGED:</b>	12/18/1995	<b>RETURNED:</b>	10/10/1995
<b>CERTIFIED:</b>		<b>REVISED:</b>	10/31/1995
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:**

**STAFF:**

**CERTIFIER:**

**FIRST PAYMENT:** \$200                      **SECOND PAYMENT:** \$

**COMMENTS:**

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 9

**DIST/DIR:** 0.75 NW

**MAP ID:** 11

**NAME:** CT VALLEY COACH & FRAME, LTD.  
**ADDRESS:** 52 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4479  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**REFERRAL INFORMATION**

**SOURCE:** PTP - PROPERTY TRANSFER PROGRAM  
**RECEIVED:** 8/8/1995  
**STAFF:**  
**PROGRAM:** PTP - PROPERTY TRANSFER PROGRAM  
**ASSIGNED:**  
**COMPLETED:** 8/8/1995  
**OUTCOME:** PTP

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 22

**DIST/DIR:** 0.77 NW

**MAP ID:** 20

**NAME:** REMINGTON RAND FACILITY  
**ADDRESS:** 180 JOHNSON STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 2595  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:** MILLAR, L.

**UPDATED PROGRAM:** USP - DEP WATER BUREAU - URBAN SITES REMEDIAL ACTION PROGRAM

**UPDATED:** 9/25/1995

**SW CLASSIFICATION:** BC/C/B

**GW CLASSIFICATION:** GB - HIGH YIELD - N.P.P.

**COMMENTS:** REVIEW OF PHASE I, REQUEST FOR QUOTATION FOR PHASE II (9/95)

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** USP - DEP WATER BUREAU - URBAN SITES REMEDIAL ACTION PROGRAM

**RECEIVED:** 9/25/1995

**STAFF:**

**PROGRAM:**

**ASSIGNED:**

**COMPLETED:** 9/26/1995

**OUTCOME:** USP

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 11                      **DIST/DIR:** 0.78 NW                      **MAP ID:** 13

**NAME:** EGETER BATTERY CO.  
**ADDRESS:** 90 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4481  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

CONNECTICUT NEWSPAPERS INC  
THE DORMERS CORPORATION

**COMMENTS:**

**INFORMATION**

**ESTABLISHMENT:** EGETER BATTERY CO.  
**SELLER:** ROY TATRO, JR.  
**BUYER:** DALE T. CLEGG, SR.

**FORM:** FORM I                      **RECEIVED:** 9/2/1988  
**ACKNOWLEDGED:** 11/9/1988                      **RETURNED:**  
**CERTIFIED:**                      **REVISED:**  
**ECAF RECEIVED:**                      **ECAF REVIEWED:**

**STATUS:**

**STAFF:**

**CERTIFIER:**

**FIRST PAYMENT:** \$0                      **SECOND PAYMENT:** \$

- Continued on next page -

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 11

**DIST/DIR:** 0.78 NW

**MAP ID:** 13

**NAME:** EGETER BATTERY CO.  
**ADDRESS:** 90 NORTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 4481  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**COMMENTS:**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>RECEIVED:</b>	9/2/1988
<b>STAFF:</b>	
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	9/2/1988
<b>OUTCOME:</b>	PTP



*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 24

**DIST/DIR:** 0.81 SE

**MAP ID:** 22

**NAME:** SHUCK PETROLEUM  
**ADDRESS:** 405 SOUTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 2689  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** HYDRO/OIL - HYDROCARBONS AND/OR FUEL OIL  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:** UST

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:** SPILL, TANK

**UPDATED BY:** DORAN, E.

**UPDATED PROGRAM:** CORE

**UPDATED:** 11/24/1995

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:** CITY OWNED GAS STATION OPERATED BY SHUCK. SPILLS RESONDED TO REPORT OF LOSS OF >500 GAL OF GAS DISCOVERED DURING TANK TESTING ON 9/23/95. 3 OF 5 TANKS FOUND TO BE LEAKING AND WERE REMOVED. FREE PRODUCT ON GW. CONTRACTOR WORKING ON REMEDIATION. ALSO REFERRED TO TANKS. (11/95)

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** SPILLS

**RECEIVED:** 10/2/1995

**STAFF:**

**PROGRAM:**

**ASSIGNED:**

**COMPLETED:**

**OUTCOME:**

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 21

**DIST/DIR:** 0.85 SW

**MAP ID:** 19

**NAME:** PALMER FIELD  
**ADDRESS:** BERNIE O ROURKE DRIVE  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 754  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** INDUSTRIAL  
**WASTE TYPE2:** HYDROCARBONS  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** RCRA - DEP WASTE BUREAU - WASTE ENGINEERING & ENFORCEMENT DIVISION  
**RECEIVED:** 5/3/1989  
**STAFF:**  
**PROGRAM:**  
**ASSIGNED:**  
**COMPLETED:**  
**OUTCOME:**

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 10

**DIST/DIR:** 0.85 SW

**MAP ID:** 12

**NAME:** CUMBERLAND FARMS PROPERTY  
**ADDRESS:** 533 WASHINGTON STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 1948  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** CHLR VOC - CHLORINATED VOLATILE ORGANIC COMPOUNDS  
**WASTE TYPE2:** HYDRO/OIL - HYDROCARBONS AND/OR FUEL OIL  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:** POST, M.

**UPDATED PROGRAM:** CORE

**UPDATED:** 8/17/1994

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:** HAZARDOUS WASTE SITE ASSESSMENT 1/89 (8/94)

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** REMEDIAL - DEP WATER BUREAU - REMEDIATION SECTION  
**RECEIVED:** 8/17/1994  
**STAFF:**  
**PROGRAM:**  
**ASSIGNED:**  
**COMPLETED:**  
**OUTCOME:**

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 26

**DIST/DIR:** 0.88 SE

**MAP ID:** 24

**NAME:** SUNOCO # 0266-2138  
**ADDRESS:** 427 SOUTH MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 2282  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:** POST, M.  
**UPDATED PROGRAM:** CORE  
**UPDATED:** 3/27/1995  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

**SOURCE:** REMEDIAL - DEP WATER BUREAU - REMEDIATION SECTION  
**RECEIVED:** 3/27/1995  
**STAFF:**  
**PROGRAM:**  
**ASSIGNED:**  
**COMPLETED:**  
**OUTCOME:**

*Environmental FirstSearch*  
*Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 27

**DIST/DIR:** 0.90 SW

**MAP ID:** 25

**NAME:** TOWN YARD  
**ADDRESS:** THAMES STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 790  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO  
**LOCATION METHOD:**  
**OTHER DEP:**  
**UPDATED BY:**  
**UPDATED PROGRAM:**  
**UPDATED:**  
**SW CLASSIFICATION:**  
**GW CLASSIFICATION:**

**COMMENTS:**

**SITE NAMES**

**COMMENTS:**

**REFERRAL INFORMATION**

<b>SOURCE:</b>	COMPLAINT - RECEIVED FROM OR SUBMITTED BY AN OUTSIDE PARTY
<b>RECEIVED:</b>	2/22/1990
<b>STAFF:</b>	MCDANIEL, M.
<b>PROGRAM:</b>	D&A
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	3/29/1990
<b>OUTCOME:</b>	SOLID

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 14                      **DIST/DIR:** 0.92 NE                      **MAP ID:** 15

**NAME:** JACKSON CORRUGATED CONTAINER  
**ADDRESS:** RIVER ROAD  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 233  
**ID2:**  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** SOLVENTS  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:** SEPTIC TO GROUND

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:** CONTAMINATED SOILS REMOVED FROM OLD DISPOSAL SYSTEM. OTHER DISPOSAL  
AREAS UNDER STATE SUPERVISION.(7/87)

**SITE NAMES**

**COMMENTS:**

**INVENTORY INFORMATION**

<b>REQUEST STAFF:</b>	DEP	<b>PROGRAM:</b>	SUPERFUND
<b>DATE ADDED:</b>	7/6/1987	<b>ON INVENTORY:</b>	YES
<b>ASSESSED:</b>	YES	<b>87 GROUP:</b>	RI
<b>87 ORIGIN:</b>	INVENTORY	<b>ON 87:</b>	YES

**REFERRAL INFORMATION**

<b>SOURCE:</b>	SUPERFUND - DEP WASTE BUREAU - SUPERFUND SITE DISCOVERY
<b>RECEIVED:</b>	7/6/1987
<b>STAFF:</b>	DEP
<b>PROGRAM:</b>	SUPERFUND - DEP WASTE BUREAU - SUPERFUND SITE DISCOVERY
<b>ASSIGNED:</b>	7/6/1987
<b>COMPLETED:</b>	7/6/1987
<b>OUTCOME:</b>	INVENTORY

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA COR SITE**

**SEARCH ID:** 1                      **DIST/DIR:** 0.98 SE                      **MAP ID:** 2

**NAME:** FENNER AMERICAN LTD  
**ADDRESS:** 400 E MAIN ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD052542669  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2033467721

**CONTACT:** MARK-S STEPHENS

**SITE INFORMATION**

**UNIVERSE INFORMATION:**

<b>SNC:</b>	N - NO
<b>BOYSNC:</b>	N - NO
<b>GPRA PERMIT:</b>	N - NO
<b>GPRA POSTCLOSURE:</b>	N - NO
<b>GPRA CA:</b>	N - NO
<b>GPRA CME:</b>	N - NO
<b>PERM PROG:</b>	---S-
<b>PREM WRKLD:</b>	----
<b>CLOSURE WRKLD:</b>	---S-
<b>P C WRKLD:</b>	----
<b>SUBJCA:</b>	Y - SUBJECT TO CORRECTIVE ACTION
<b>SUBJCA TSD 3004:</b>	Y - TSDFS POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004
<b>SUBJCA NON TSD:</b>	N - NO
<b>CA WRKLD:</b>	Y - CORRECTIVE ACTION WORKLOAD
<b>GEN STATUS:</b>	N

<b>IMPORTER ACTIVITY:</b>	U - UNKNOWN	<b>MIX WASTE GEN:</b>	U - UNKNOWN
<b>RECYCLER ACT:</b>	N - NO	<b>TRANS ACT:</b>	N - NO
<b>TSD ACT:</b>	Y - YES	<b>U GRND INJ ACT:</b>	N - NO
<b>UNIV WASTE FAC:</b>		<b>TRANSFER FAC:</b>	U - UNKNOWN
<b>OS BURNER EXEMPT:</b>	U - UNKNOWN	<b>FURNACE EXEMP:</b>	U - UNKNOWN

**USED OIL INFORMATION**

<b>BURNER:</b>	N - NO	<b>PROCESSOR:</b>	N - NO
<b>REFINER:</b>	N - NO	<b>MARKET BURNER:</b>	N
<b>SPEC MARKETER:</b>	N - NO	<b>TRANSFER FAC:</b>	N - NO
<b>TRANSPORTER:</b>	N - NO		

**NAIC INFORMATION**

<b>SECOND ID:</b>		<b>OFF SITE RECEIPT:</b>	U - UNKNOWN
<b>ACCESSIBILITY:</b>		<b>COUNTY OWNER:</b>	
<b>FED WSTE GEN OWNER:</b>	HQ	<b>FED WASTE GEN:</b>	N
<b>STATE WSTE GEN OWNER:</b>	HQ	<b>STATE WSTE GEN:</b>	N - NO

333922 - CONVEYOR AND CONVEYING EQUIPMENT MANUFACTURING  
313221 - NARROW FABRIC MILLS

**ENFORCEMENT INFORMATION:**

**AGENCY:** S - STATE                      **DATE:** 8/27/1985

- Continued on next page -

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA COR SITE**

**SEARCH ID:** 1                      **DIST/DIR:** 0.98 SE                      **MAP ID:** 2

**NAME:** FENNER AMERICAN LTD  
**ADDRESS:** 400 E MAIN ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD052542669  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2033467721

**CONTACT:** MARK-S STEPHENS

**TYPE:** 211 - UNILATERAL ORDER, NO PENALTIES

**AGENCY:** S - STATE                      **DATE:** 8/29/1985  
**TYPE:** 310 - FINAL 3008(A) COMPLIANCE ORDER

**VIOLATION INFORMATION:**

**VIOLATION NUMBER:** 0001                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 11/2/1984                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 2/5/1986  
**TYPE:** DCL - TSD CLOSURE/POST CLOSURE REQUIREMENTS

**VIOLATION NUMBER:** 0002                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 11/2/1984                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 2/5/1986  
**TYPE:** DFR - TSD FINANCIAL RESPONSIBILITY REQUIREMENTS

**VIOLATION NUMBER:** 0003                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 11/2/1984                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 2/5/1986  
**TYPE:** DOT - TSD OTHER REQUIREMENTS (OVERSIGHT LEVEL)

**VIOLATION NUMBER:** 0004                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 11/2/1984                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 3/3/1986  
**TYPE:** DOT - TSD OTHER REQUIREMENTS (OVERSIGHT LEVEL)

**VIOLATION NUMBER:** 0005                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 9/18/1989                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 4/7/1998  
**TYPE:** DCL - TSD CLOSURE/POST CLOSURE REQUIREMENTS

**VIOLATION NUMBER:** 0009                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 9/18/1989                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 4/7/1998  
**TYPE:** DCL - TSD CLOSURE/POST CLOSURE REQUIREMENTS

**VIOLATION NUMBER:** 0011                      **RESPONSIBLE:** S - STATE  
**DETERMINED:** 2/28/1991                      **DETERMINED BY:** S - STATE  
**CITATION:**                      **RESOLVED:** 4/7/1998  
**TYPE:** DCL - TSD CLOSURE/POST CLOSURE REQUIREMENTS

**CORRECTIVE ACTION INFORMATION**

**CA EVENT:** CA075ME

**HAZARDOUS WASTE INFORMATION:**

Heavy ends from the distillation of vinyl chloride in vinyl chloride monomer production.

- Continued on next page -



**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**RCRA COR SITE**

**SEARCH ID:** 1

**DIST/DIR:** 0.98 SE

**MAP ID:** 2

**NAME:** FENNER AMERICAN LTD  
**ADDRESS:** 400 E MAIN ST  
MIDDLETOWN CT 06457

**REV:** 2/14/05  
**ID1:** CTD052542669  
**ID2:**  
**STATUS:** CA  
**PHONE:** 2033467721

**CONTACT:** MARK-S STEPHENS

P117

Ethane, 1,1,1-trichloro- (OR) Methyl chloroform

D000

Methane, dichloro- (OR) Methylene chloride

Tank bottoms (lead) from the petroleum refining industry.

The following spent halogenated solvents used in degreasing: Tetrachloroethylene, trichloroethylene, methylene chloride, 1,1,1-trichloroethane, carbon tetrachloride and chlorinated fluorocarbons; all spent solvent mixtures/bl

The following spent non-halogenated solvents: toluene, methyl ethyl ketone, carbon disulfide, isobutanol, pyridine, benzene, 2-ethoxyethanol, and 2-nitropropane; all spent solvent mixtures/blends containing, before use, a to

Acetic acid ethyl ester (I) (OR) Ethyl acetate (I)

<1,1 -Biphenyl>-4,4 -diamine, 3,3 -dichloro- (OR) 3,3 -Dichlorobenzidine

1,2-Benzenedicarboxylic acid, dibutyl ester (OR) Dibutyl phthalate

2-Imidazolidinethione (OR) Ethylenethiourea

2-Butanone (I,T) (OR) Methyl ethyl ketone (MEK) (I,T)

2-Propanone (I) (OR) Acetone (I)

U013

Auramine (OR) Benzenamine, 4,4 -carbonimidoylbis<N,N-dimethyl-

Benzene, methyl- (OR) Toluene

Carbamic acid, ethyl ester (OR) Ethyl carbamate (urethane)

Cyclohexanone (I)

The following spent non-halogenated solvents: Xylene, acetone, ethyl acetate, ethyl benzene, ethyl ether, methyl isobutyl ketone, n-butyl alcohol, cyclohexanone, and methanol; all spent solvent mixtures/ blends containing, b

1,3-Benzenediol (OR) Resorcinol

**Environmental FirstSearch**  
**Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 12

**DIST/DIR:** 0.98 SE

**MAP ID:** 2

**NAME:** FENNER AMERICA, LTD.  
**ADDRESS:** 400 EAST MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 707  
**ID2:** CTD052542669  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

**SITE INFORMATION**

**WASTE TYPE1:** SOLVENTS  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:** SPILL/DUMP TO GROUND

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:** TRANSFER - DEP WATER BUREAU - PROPERTY TRANSFER PROGRAM

**UPDATED BY:**

**UPDATED PROGRAM:**

**UPDATED:**

**SW CLASSIFICATION:**

**GW CLASSIFICATION:**

**COMMENTS:** SRD-0008

**SITE NAMES**

RUSSELL SQUARE ASSOCIATES  
RUSSELL SQUARE ASSOCIATES

**COMMENTS:**

**FEDERAL INFORMATION**

<b>ON CERCLIS:</b>	YES	<b>EPI SITE:</b>	NO
<b>ARCHIVE:</b>	NO	<b>ARCHIVE DATE:</b>	
<b>EPA REMOVAL:</b>	NO	<b>DEFERRED:</b>	YES
<b>ON NPL:</b>	NO	<b>PART NPL:</b>	NO
<b>RCRA STAT:</b>		<b>RCRA PERMIT:</b>	
<b>FED FAC:</b>	NO		

**INVENTORY INFORMATION**

<b>REQUEST STAFF:</b>	POST, M.	<b>PROGRAM:</b>	D&A
<b>DATE ADDED:</b>	7/25/1990	<b>ON INVENTORY:</b>	YES
<b>ASSESSED:</b>	YES	<b>87 GROUP:</b>	
<b>87 ORIGIN:</b>		<b>ON 87:</b>	NO

**INFORMATION**

**ESTABLISHMENT:** RUSSELL SQUARE ASSOCIATES  
**SELLER:** RUSSELL SQUARE ASSOCIATES  
**BUYER:** ANTHONY FONDA

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 12                      **DIST/DIR:** 0.98 SE                      **MAP ID:** 2

**NAME:** FENNER AMERICA, LTD.  
**ADDRESS:** 400 EAST MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 707  
**ID2:** CTD052542669  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

<b>FORM:</b>	FORM III	<b>RECEIVED:</b>	3/8/1991
<b>ACKNOWLEDGED:</b>	4/8/1991	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	6/23/1997

**STATUS:** LA

**STAFF:** ROBINSON, R.

**CERTIFIER:** ,

**FIRST PAYMENT:** \$4500                      **SECOND PAYMENT:** \$

**COMMENTS:** ECAF REC D 6/5/97

**INFORMATION**

<b>ESTABLISHMENT:</b>	FENNER AMERICA, INC./RUSSELL SQUARE
<b>SELLER:</b>	FENNER AMERICA
<b>BUYER:</b>	RUSSEL SQUARE ASSOCIATES

<b>FORM:</b>	FORM III	<b>RECEIVED:</b>	4/7/1986
<b>ACKNOWLEDGED:</b>	2/13/1987	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:** A

**STAFF:** PARKS, C.

**CERTIFIER:** ,

**FIRST PAYMENT:** \$0                      **SECOND PAYMENT:** \$0

**COMMENTS:** NOT DUE - FEE PAID FOR THE RUSSELL SQUARE III

**INFORMATION**

<b>ESTABLISHMENT:</b>	RUSSELL SQUARE ASSOCIATES
<b>SELLER:</b>	RUSSELL SQUARE ASSOCIATES
<b>BUYER:</b>	HURAND REALTY CO.

- Continued on next page -

**Environmental FirstSearch  
Site Detail Report**

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 12

**DIST/DIR:** 0.98 SE

**MAP ID:** 2

**NAME:** FENNER AMERICA, LTD.  
**ADDRESS:** 400 EAST MAIN STREET  
MIDDLETOWN CT

**REV:** 2/22/05  
**ID1:** 707  
**ID2:** CTD052542669  
**STATUS:** SUSPECTED  
**PHONE:**

**CONTACT:**

<b>FORM:</b>	<b>FORM III</b>	<b>RECEIVED:</b>	2/28/1991
<b>ACKNOWLEDGED:</b>	4/4/1991	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>		<b>ECAF REVIEWED:</b>	

**STATUS:** R

**STAFF:** PARKS, C.

**CERTIFIER:**

**FIRST PAYMENT:** \$4500      **SECOND PAYMENT:** \$8500

**COMMENTS:** SEE FENNER AMERICA

**REMEDIAL INFORMATION**

<b>TYPE:</b>	III		
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM		
<b>ENTERED:</b>	3/1/1990		
<b>STAFF:</b>	PARKS, C.	<b>COMPLETE:</b>	
<b>ASSIGNED:</b>		<b>PHASE:</b>	GWM
<b>ORDER ISSUED:</b>	YES	<b>ORDER NUMBER:</b>	SRD-0008
<b>ORDER DATE:</b>	3/1/1990	<b>INVESTIGATION START:</b>	
<b>COMPLETED:</b>		<b>DESIGN START:</b>	
<b>DESIGN DONE:</b>		<b>ACTION START:</b>	
<b>ACTION DONE:</b>		<b>OPERATION START:</b>	
<b>GW MONITORING:</b>	NO		

**REFERRAL INFORMATION**

<b>SOURCE:</b>	CERCLIS - US EPA CERCLIS
<b>RECEIVED:</b>	1/24/1989
<b>STAFF:</b>	POST, M.
<b>PROGRAM:</b>	D&A
<b>ASSIGNED:</b>	
<b>COMPLETED:</b>	7/25/1990
<b>OUTCOME:</b>	INVENTORY

**ORDERS INFORMATION**

<b>ISSUED:</b>	3/1/1990	<b>STAFF:</b>	WINGFIELD, B.
<b>TYPE:</b>	CO	<b>RESPONDENT:</b>	HURAND REALTY CO. INC.
<b>APPEALLED:</b>		<b>RESOLUTION:</b>	
<b>DATE:</b>		<b>COURT APPEAL:</b>	

- More Details Exist For This Site; Max Page Limit Reached -

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

**STATE SITE**

**SEARCH ID:** 8                      **DIST/DIR:** 0.98 SW                      **MAP ID:** 10

<b>NAME:</b> CONNECTICUT DEPARTMENT OF CHILDREN AND FAMILIES	<b>REV:</b> 2/22/05
<b>ADDRESS:</b> 170 LONG LANE MIDDLETOWN CT	<b>ID1:</b> 3747
	<b>ID2:</b> CTD171268477
	<b>STATUS:</b> SUSPECTED
<b>CONTACT:</b>	<b>PHONE:</b>

**SITE INFORMATION**

**WASTE TYPE1:**  
**WASTE TYPE2:**  
**WASTE TYPE3:**

**DISPOSAL METHOD:**

**SAMPLE AVAILABLE:** NO

**LOCATION METHOD:**

**OTHER DEP:**

**UPDATED BY:** WILCOX, J.

**UPDATED PROGRAM:** PTP - PROPERTY TRANSFER PROGRAM

**UPDATED:** 2/3/2000

**SW CLASSIFICATION:** B

**GW CLASSIFICATION:** GA - MEDIUM YIELD - P.P.

**COMMENTS:**

**SITE NAMES**

DCF/STATE OF CONNECTICUT  
LONG LANE JUVENILE FACILITY  
LONG LANE JUVENILE FACILITY  
DCF/STATE OF CONNECTICUT

**COMMENTS:**

**INFORMATION**

<b>ESTABLISHMENT:</b>	LONG LANE SCHOOL
<b>SELLER:</b>	DCF/STATE OF CONNECTICUT
<b>BUYER:</b>	WESLEYAN UNIVERSITY

<b>FORM:</b>	FORM III	<b>RECEIVED:</b>	2/8/2000
<b>ACKNOWLEDGED:</b>	2/25/2000	<b>RETURNED:</b>	
<b>CERTIFIED:</b>		<b>REVISED:</b>	
<b>ECAF RECEIVED:</b>	2/8/2000	<b>ECAF REVIEWED:</b>	3/8/2000

**STATUS:** D

**STAFF:** WILCOX, J.

**CERTIFIER:** WESLEYAN UNIVERSITY, TRANSFEREE  
ROBERT B. TAYLOR

237 HIGH STREET  
NORTH COLLEGEMIDDLETOWN, CT 06459

<b>FIRST PAYMENT:</b>	\$2000	<b>SECOND PAYMENT:</b>	\$
-----------------------	--------	------------------------	----

- Continued on next page -

*Environmental FirstSearch  
Site Detail Report*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

STATE SITE

**SEARCH ID:** 8                      **DIST/DIR:** 0.98 SW                      **MAP ID:** 10

<b>NAME:</b> CONNECTICUT DEPARTMENT OF CHILDREN AND FAMILIES	<b>REV:</b> 2/22/05
<b>ADDRESS:</b> 170 LONG LANE	<b>ID1:</b> 3747
MIDDLETOWN CT	<b>ID2:</b> CTD171268477
	<b>STATUS:</b> SUSPECTED
<b>CONTACT:</b>	<b>PHONE:</b>

**COMMENTS:**

**REMEDIAL INFORMATION**

<b>TYPE:</b>	III	
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM	
<b>ENTERED:</b>	2/8/2000	
<b>STAFF:</b>	WILCOX, J.	<b>COMPLETE:</b>
<b>ASSIGNED:</b>	2/3/2000	<b>PHASE:</b> D
<b>ORDER ISSUED:</b>	NO	<b>ORDER NUMBER:</b>
<b>ORDER DATE:</b>		<b>INVESTIGATION START:</b>
<b>COMPLETED:</b>		<b>DESIGN START:</b>
<b>DESIGN DONE:</b>		<b>ACTION START:</b>
<b>ACTION DONE:</b>		<b>OPERATION START:</b>
<b>GW MONITORING:</b>	NO	

**REFERRAL INFORMATION**

<b>SOURCE:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>RECEIVED:</b>	2/3/2000
<b>STAFF:</b>	WILCOX, J.
<b>PROGRAM:</b>	PTP - PROPERTY TRANSFER PROGRAM
<b>ASSIGNED:</b>	2/3/2000
<b>COMPLETED:</b>	2/8/2000
<b>OUTCOME:</b>	PTP

**Environmental FirstSearch  
Federal Database Descriptions**

**ASTM Databases:**

**CERCLIS: Comprehensive Environmental Response Compensation and Liability Information System.** The EPA's database of current and potential Superfund sites currently or previously under investigation. Source: Environmental Protection Agency.

Updated quarterly.

**CERCLIS-NFRAP (Archive): Comprehensive Environmental Response Compensation and Liability Information System Archived Sites.** The Archive designation means that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL). This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Updated quarterly.

**ERNS: Emergency Response Notification System.** The EPA's database of emergency response actions. Source: Environmental Protection Agency. Data since January, 2001, has been received from the National Response Center as the EPA no longer maintains this data.

Updated quarterly.

**FINDS: The Facility Index System.** The EPA's Index of identification numbers associated with a property or facility which the EPA has investigated or has been made aware of in conjunction with various regulatory programs. Each record indicates the EPA office that may have files on the site or facility. Source: Environmental Protection Agency.

Updated semi-annually.

**NPL: National Priority List.** The EPA's list of confirmed or proposed Superfund sites. Source: Environmental Protection Agency.

Updated quarterly.

**RCRIS: Resource Conservation and Recovery Information System.** The EPA's database of registered hazardous waste generators and treatment, storage and disposal facilities. Included are RAATS (RCRA Administrative Action Tracking System) and CMEL (Compliance Monitoring & Enforcement List). Source: Environmental Protection Agency.

**RCRA TSD: Resource Conservation and Recovery Information System Treatment, Storage, and Disposal Facilities.** The EPA's database of RCRIS sites which treat, store, dispose, or incinerate hazardous waste. This information is also reported in the standard RCRIS detailed data.

## ASTM Database Descriptions (continued):

**RCRA COR: Resource Conservation and Recovery Information System Corrective Action Sites.** The EPA's database of RCRIS sites with reported corrective action. This information is also reported in the standard RCRIS detailed data.

**RCRA GEN: Resource Conservation and Recovery Information System Large, Small, and Very Small Quantity Generators.** The EPA's database of RCRIS sites that create hazardous waste or meet other RCRA requirements. Included are RAATS (RCRA Administrative Action Tracking System) and CMEL (Compliance Monitoring & Enforcement List).

**RCRA NLR: Resource Conservation and Recovery Information System sites No Longer Regulated.** FirstSearch's proprietary database of Resource Conservation and Recovery Information System's that the EPA cannot categorize.

*All RCRA databases are Updated quarterly*



**Environmental FirstSearch  
Federal Database Descriptions**

**Non-ASTM Databases:**

**HMIRS: Hazardous Materials Incident Response System.** This database contains information from the US Department of Transportation regarding materials, packaging, and a description of events for tracked incidents.

*Updated quarterly.*

**NCDB: National Compliance Database.** The National Compliance Data Base System (NCDB) tracks regional compliance and enforcement activity and manages the Pesticides and Toxic Substances Compliance and Enforcement program at a national level. The system tracks all compliance monitoring and enforcement activities from the time an inspector conducts and inspection until the time the inspector closes or the case settles the enforcement action. NCDB is the national repository of the 10 regional and Headquarters FIFRA/TSCA Tracking System (FTTS). Data collected in the regional FTTS is transferred to NCDB to support the need for monitoring national performance of regional programs.

*Updated quarterly*

**NPDES: National Pollution Discharge Elimination System.** The EPA's database of all permitted facilities receiving and discharging effluents. Source: Environmental Protection Agency.

*Updated semi-annually.*

**NRDB: National Radon Database.** The NRDB was created by the EPA to distribute information regarding the EPA/State Residential Radon Surveys and the National Residential Radon Survey. The data is presented by zipcode in Environmental FirstSearch Reports. Source: National Technical Information Service (NTIS)

*Updated Periodically*

**Nuclear:** The Nuclear Regulatory Commission's (NRC) list of permitted nuclear facilities.

*Updated Periodically*

**PADS: PCB Activity Database System**

The EPA's database PCB handlers (generators, transporters, storers and/or disposers) that are required to notify the EPA, the rules being similar to RCRA. This database indicates the type of handler and registration number. Also included is the PCB Transformer Registration Database.

*Updated semi-annually.*

**Receptors:** 1995 TIGER census listing of schools and hospitals that may house individuals deemed sensitive to environmental discharges due to their fragile immune systems.

*Updated Periodically*

## Non-ASTM Database Descriptions (continued):

**RELEASES:** *Air and Surface Water Releases.* A subset of the EPA's ERNS database which have impacted only air or surface water.

*Updated semi-annually.*

**Soils:** This database includes the State Soil Geographic (STATSGO) data for the conterminous United States from the United States Geographical Survey (USGS).. It contains information regarding soil characteristics such as water capacity, percent clay, organic material, permeability, thickness of layers, hydrological characteristics, quality of drainage, surface, slope, liquid limit, and the annual frequency of flooding. National Resources Conservation Services Soil Survey Geographic (SSURGO) database, and the USGS Digital Data Series bedrock data.

*Updated annually*

**TRIS:** *Toxic Release Inventory System.* The EPA's database of all facilities that have had or may be prone to toxic material releases. Source: Environmental Protection Agency.

*Updated semi-annually.*

**Federal Wells:** The United State Geographic Survey (USGS) Groundwater Inventory Sites

*Updated annually*

**Environmental FirstSearch  
Connecticut Database Descriptions**

1. **State Sites:** Inventory and Suspected Hazardous Waste Sites. The Department of Environmental Protection Agency's database of known and suspected waste sites maintained by the Bureau of Waste Management.  
Updated Quarterly.
2. **Spills:** The Department of Environmental Protection Agency's database of emergency response actions and spill releases maintained by the Oil and Chemical Spill Response Division of the Bureau of Waste Management.  
Updated quarterly.
3. **Solid Waste Landfills:** The Department of Environmental Protection Agency's database of active solid waste landfill facilities maintained by the Solid Waste Program of the Bureau of Waste Management.  
Updated annually.
4. **Permits:** The Department of Environmental Protection Agency's database CPOCS (CT Permits and Order Compliance System) maintained by the Bureau of Water Management. Notices of Violations are included.  
Updated semi-annually.
5. **UST:** Underground Storage Tanks. The Department of Environmental Protection Agency's database of registered underground storage tanks maintained by the Underground Storage Tank Enforcement Program of the Bureau of Waste Management.  
Updated semi-annually.
6. **LUST:** Leaking Underground Storage Tanks. The Department of Environmental Protection Agency's database of leaking underground storage tanks maintained by the Underground Storage Tank Enforcement Program of the Bureau of Waste Management.  
Updated quarterly.
7. **PWS:** Public Water Supplies. The Department of Environmental Protection Agency's public water supply locations maintained by the Bureau of Environmental Services.  
Updated annually.

## **Environmental FirstSearch Federal Database Sources**

**CERCLIS:** The EPA's Comprehensive Environmental Response Compensation and Liability Information System database. Updated quarterly

**CERCLIS NFRAP:** The EPA's Comprehensive Environmental Response Compensation and Liability Information System archived sites. Updated quarterly

**ERNS:** The EPA's Emergency Response Notification System. Updated quarterly

**FED OTHER:** The EPA's Section Seven Tracking System. Updated Quarterly

**FINDS:** The EPA's Facility Index System. Updated as new data becomes available

**HMIRS:** The EPA's hazardous Materials Incident Response System  
Updated quarterly

**NCDB:** The EPA's National Compliance Database. Updated quarterly

**NPDES:** The EPA's National Pollution Discharge Elimination System  
Updated quarterly

**NPL:** The EPA's list of confirmed or proposed Superfund Sites  
Updated quarterly

**NRDB:** The National Technical Information Service's National Radon Database  
Updated as new data becomes available

**NUCLEAR:** The Nuclear Regulatory Commission's list of permitted nuclear facilities. Updated periodically

**PADS:** The EPA's PCB handlers database. Updated quarterly

**RCRA COR:** The EPA's Resource Conservation and Recovery Information System's Corrective Action Sites. Updated quarterly

**RCRA GEN:** The EPA's Resource Conservation and Recovery Information System's Generators and Transporters. Updated quarterly

**RCRA NLR:** FirstSearch's proprietary database of Resource Conservation and Recovery Information System's that the EPA cannot categorize.  
Updated quarterly

**RCRA TSD:** The EPA's Resource Conservation and Recovery Information System's Treatment, Storage, and Disposal facilities. Updated quarterly

**RECEPTORS:** The 2002 Census listing of schools and hospitals  
Updated as new data becomes available

**RELEASES:** The EPA's ERNS air and surface water releases. Updated quarterly

**TRIS:** The EPA's Toxic Release Inventory System. Updated quarterly

## **Environmental FirstSearch Connecticut Database Sources**

### **BROWNFIELDS (BF)**

Not available

### **LEAKING UNDERGROUND STORAGE TANKS (LUST)**

The Connecticut Department of Environmental Protection Agency's  
Database of Leaking Underground Storage Tanks

Updated quarterly

### **OTHER (OT)**

The Connecticut Department of Environmental Protection Agency's  
Database of the Property Transfer Program

Updated quarterly

### **PERMITS (PE)**

The Connecticut Department of Environmental Protection Agency's  
database CPOCS (CT Permits and Order Compliance System)

Updated semi-annually

### **RELEASES (RL)**

Not available

### **90 SPILLS (SP)**

The Connecticut Department of Environmental Protection Agency's  
Database of Emergency Response Actions and Spill Releases

Updated quarterly

### **80 SPILLS (80)**

Not available

### **STATE SITES (ST)**

The Connecticut Department of Environmental Protection Agency's  
Database of Inventoried and Suspected Hazardous Waste Sites

Updated quarterly

### **SOLID WASTE LANDFILLS (SWL)**

The Connecticut Department of Environmental Protection Agency's  
Database of Active Solid Waste Landfill Facilities

Updated annually

### **UNDERGROUND STORAGE TANKS (UST)**

The Connecticut Department of Environmental Protection Agency's  
database of registered underground storage tanks

Updated semi-annually

## **GIS Sources**

### **AREAS OF CRITICAL ENVIRONMENTAL CONCERN (ACEC)**

Not available

### **AQUIFERS (AQ)**

The Connecticut Department of Environmental Protection Agency's  
database of Ground Water Quality Classifications

Updated annually

### **STATE WELLS (PWS)**

The Department of Environmental Protection Agency's public water  
supply

Updated annually



*Environmental FirstSearch*  
*Street Name Report for Streets within .25 Mile(s) of Target Property*

**TARGET SITE:** 56 HAMLIN ST  
MIDDLETOWN CT 06457

**JOB:** 40990.00

Street Name	Dist/Dir	Street Name	Dist/Dir
Broad St	0.11 NE		
Church St	0.15 SE		
College St	0.02 NW		
Court St	0.13 NW		
Hamlin Ct	0.02 SE		
Hamlin St	0.00 --		
High St	0.12 SW		
Hotchkiss St	0.16 SE		
Hubbard St	0.15 SE		
Main St	0.24 NE		
Metro Sq	0.25 NE		
Old Church St	0.19 SE		
Pearl Pl	0.21 NW		
Pearl St	0.05 NE		
Pleasant St	0.24 SE		
S Main St	0.24 SE		
SOUTH Main St	0.24 SE		
William Pl	0.05 NE		
William St	0.06 SE		
Wyllys Ave	0.13 NW		








# Environmental FirstSearch

1 Mile Radius

ASTM Map: NPL, RCRACOR, STATE Sites



56 HAMLIN ST, MIDDLETOWN CT 06457

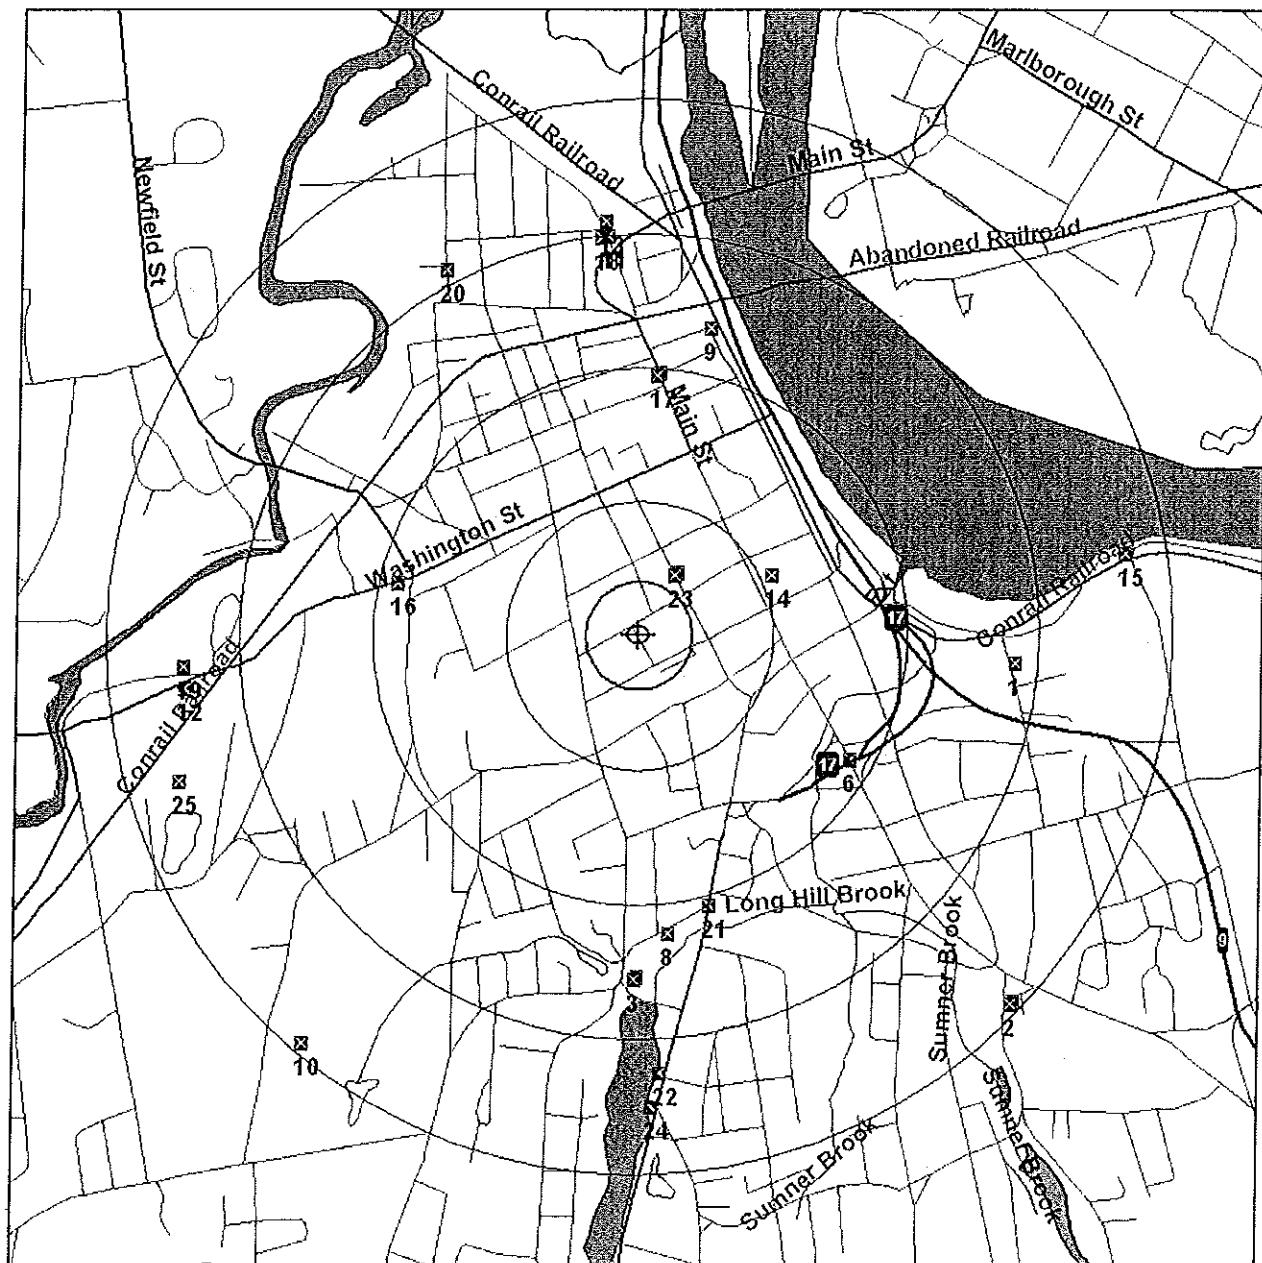

Source: 2002 U.S. Census TIGER Files


Target Site (Latitude: 41.557248 Longitude: -72.65232) .....

Identified Site, Multiple Sites, Receptor .....

NPL, Brownfield, Solid Waste Landfill (SWL) or Hazardous Waste .....

Railroads .....

Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius

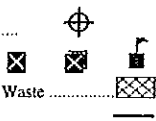






# Environmental FirstSearch

.5 Mile Radius

ASTM Map: CERCLIS, RCRATSD, LUST, SWL



56 HAMLIN ST, MIDDLETOWN CT 06457

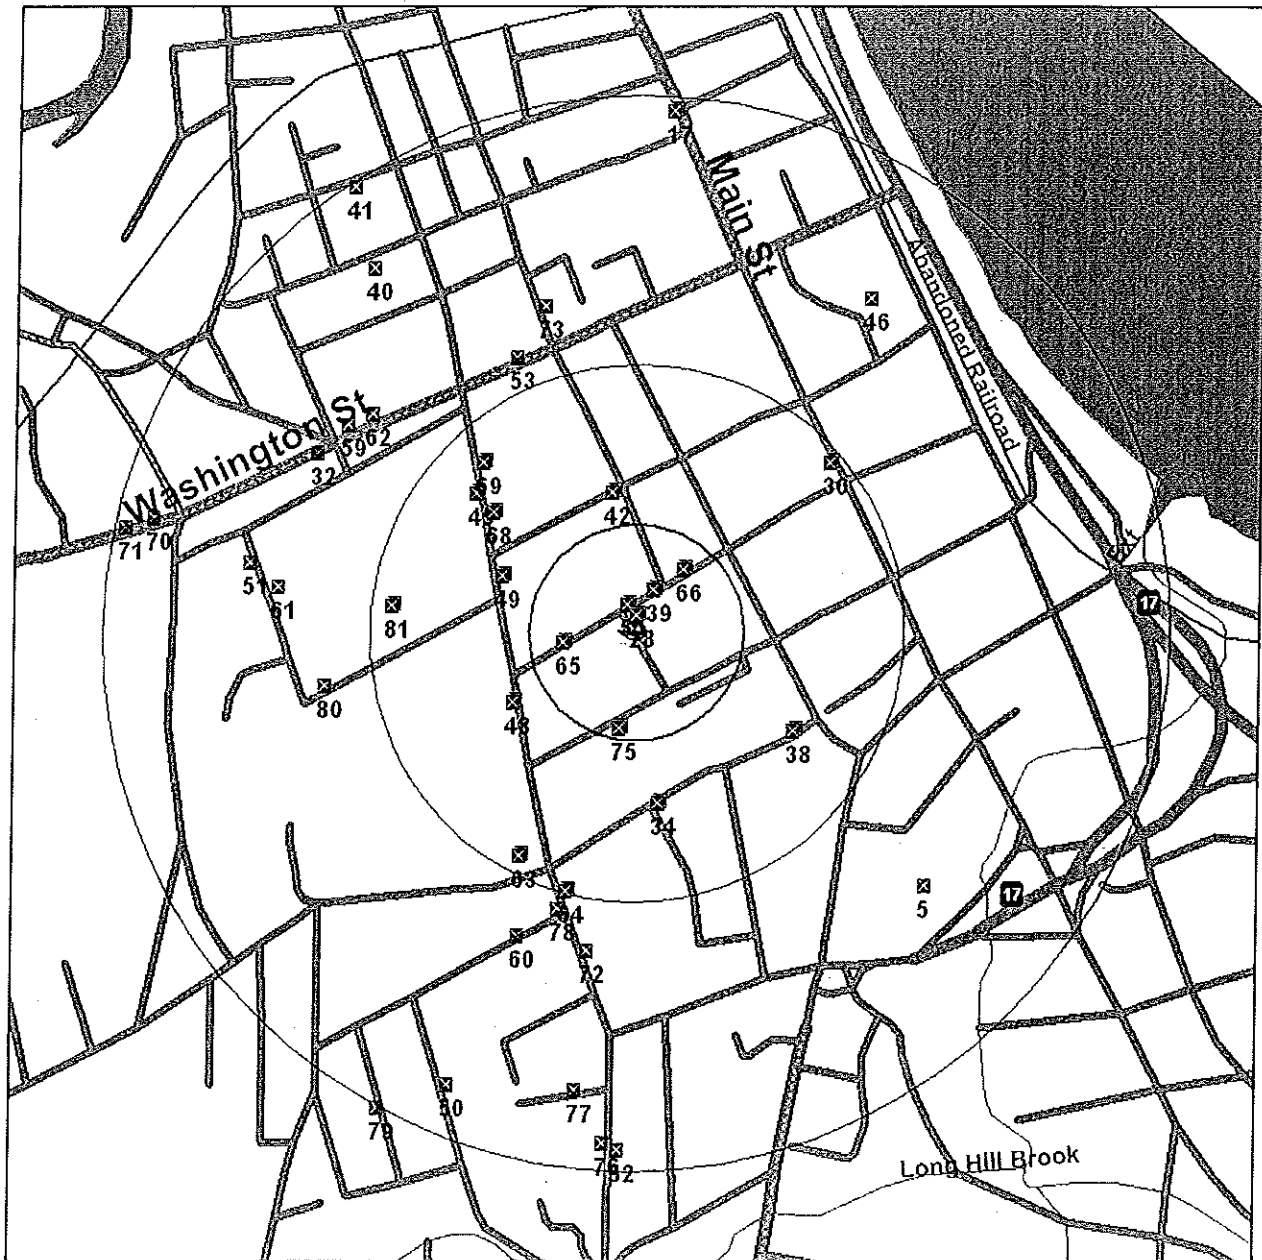

Source: 2002 U.S. Census TIGER Files


Target Site (Latitude: 41.557248 Longitude: -72.65232) .....

Identified Site, Multiple Sites, Receptor .....

NPL, Brownfield, Solid Waste Landfill (SWL) or Hazardous Waste .....

Railroads .....

Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius








## Environmental FirstSearch

.25 Mile Radius  
ASTM Map: RCRAGEN, ERNS, UST



56 HAMLIN ST, MIDDLETOWN CT 06457

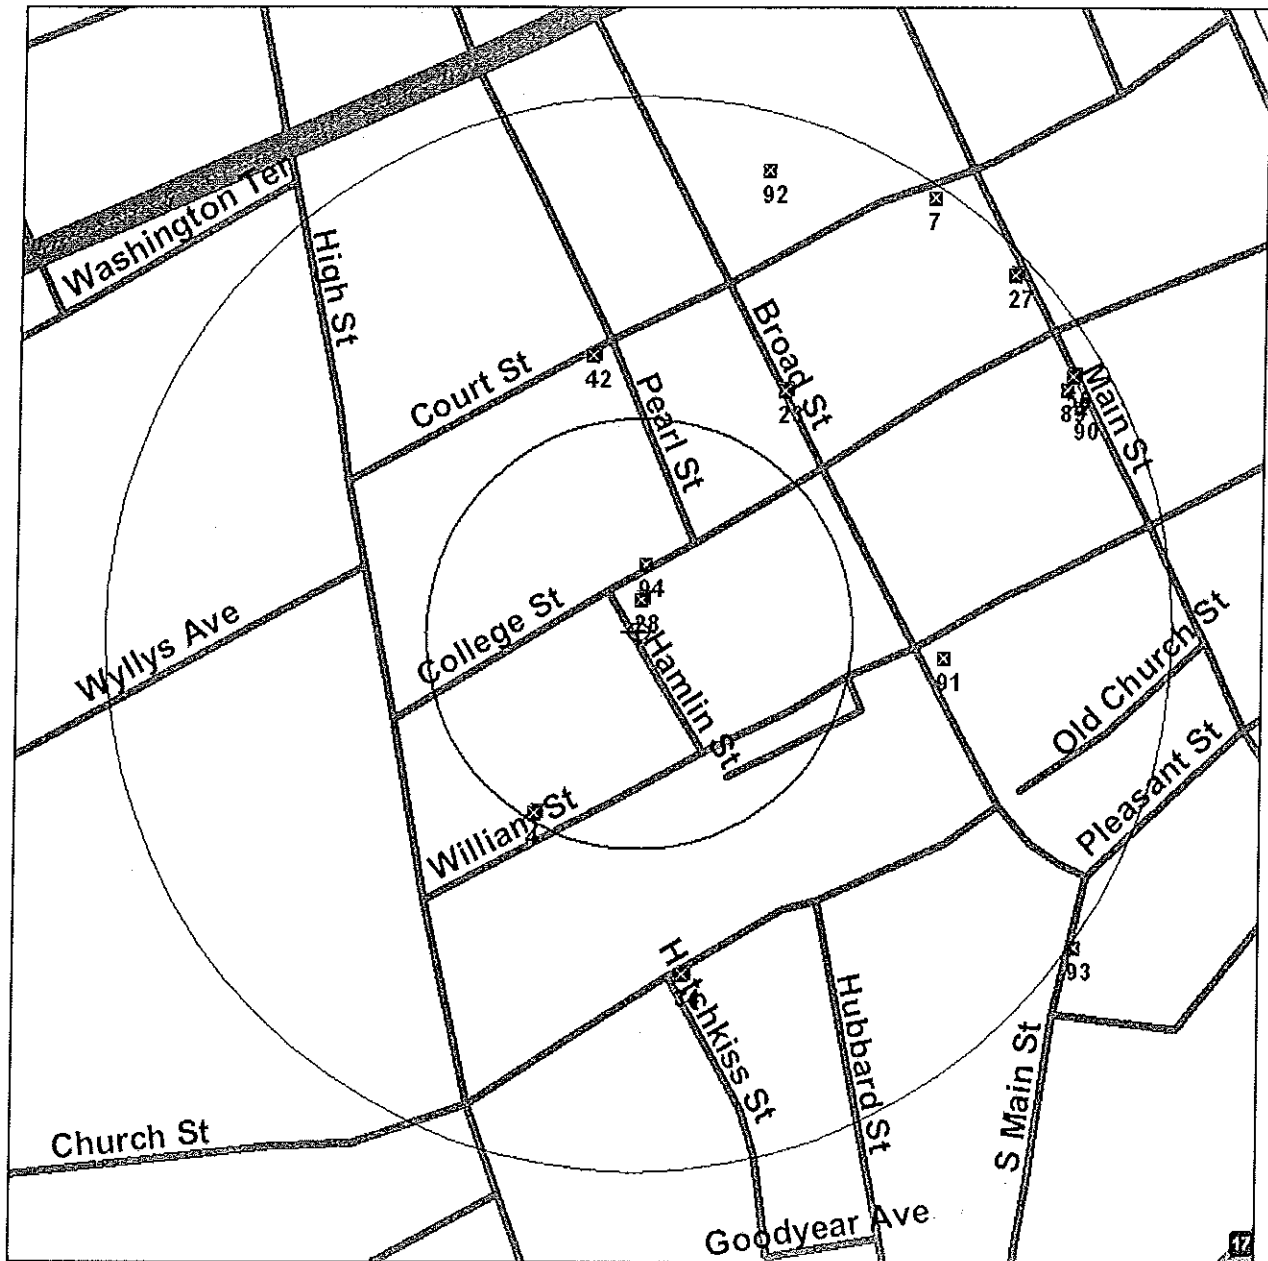

Source: 2002 U.S. Census TIGER Files

Target Site (Latitude: 41.557248 Longitude: -72.65232) .....

Identified Site, Multiple Sites, Receptor .....

NPL, Brownfield, Solid Waste Landfill (SWL) or Hazardous Waste .....

Railroads .....

Black Rings Represent 1/4 Mile Radii; Red Ring Represents 500 ft. Radius



# Appendix C

## File Review Information





# Commercial Property Record Card - MIDDLETOWN CT

Property Location: 56 Hamlin St Account: E30921 Map Block No: 24 23-29 4 Class: E State Class: 904 Printed Mon, Mar 28, 2005 Card 1 of 1


<b>Current Owner</b> Wesleyan University Office Of The Controller 237 High St Middletown Ct 06457		<b>Previous Owner History</b> <table border="1"> <thead> <tr> <th>Name</th> <th>Deed</th> <th>Date</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> <td></td> </tr> </tbody> </table>		Name	Deed	Date				<b>Miscellaneous</b> Deed Info: 280/ 529 Zoning: MX Routing No: 24/384 Neighborhd: 312 Living Units: 0 Census Trct: 5416 District: 1		<b>Assessment Information</b> Appraised Value: * Income: 133,600 Land: 39,200 Bldg: 186,740 Total: 225,940 Assessed Information: Code: 200 Value: 158,160					
Name	Deed	Date															
<b>Notes</b> 00 00		<b>Entrance Information</b> <table border="1"> <thead> <tr> <th>Date</th> <th>Time</th> <th>ID</th> <th>Act</th> <th>Entrance Code</th> <th>Source</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td>Owner</td> </tr> </tbody> </table>		Date	Time	ID	Act	Entrance Code	Source						Owner	Effective DOV: 10/1/2002 Value Flag: COST Manual Override Reason: NO OVERRIDE	
Date	Time	ID	Act	Entrance Code	Source												
					Owner												

Sales History			
Book/Page	Date	Price	Type

Permit Information			
Date	Permit #	Price	Purpose
07/29/1999	24060	1,700	Remove Tank

Land Information				
Type	Size	Grade	Influence Factor and %	Value
Primary	A	0.16	0	39,200
Total Acres for this Parcel 0.16				

Owner/Values: Includes all Land/Buildings/OBYs for this Parcel				
	Current	Cost	Market	Income
Land:	39,200	39,200	0	39,200
Building:	186,740	186,740	0	94,400
Total:	225,940	225,940	0	133,600

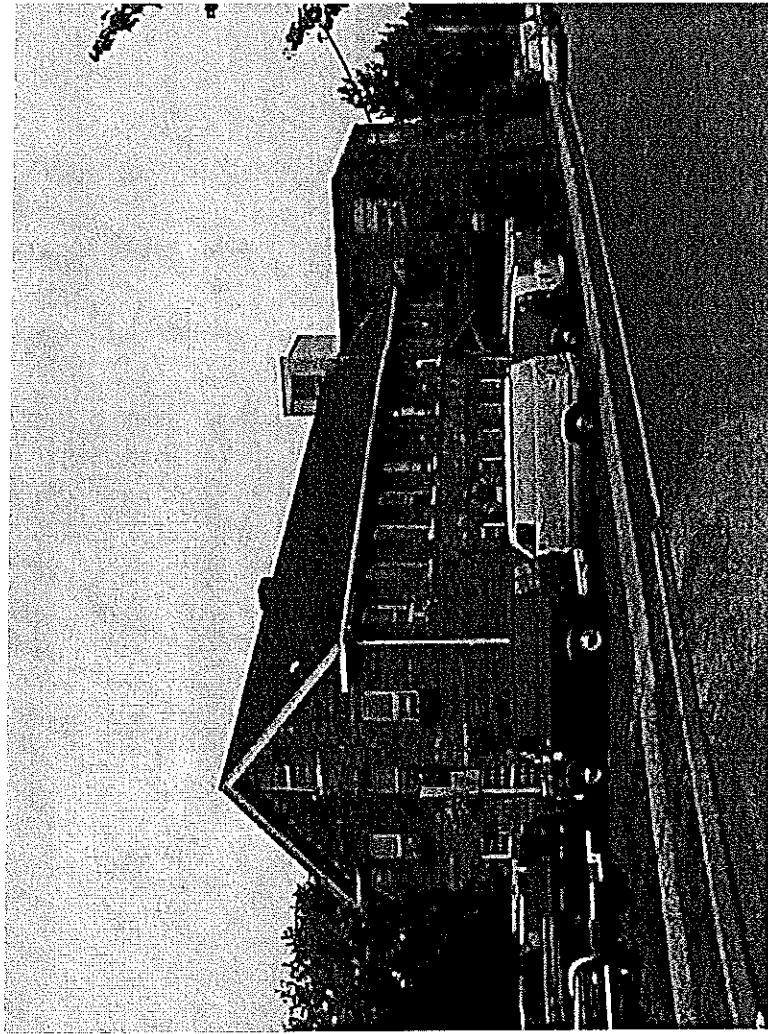

Exterior/Interior Information															
Sec	Levels	Size	Perimeter	Use Type	Exterior		Construction		Heating	A/C	Plumbing	Physical Condition	Functional Utility	%Good Override	Unadjusted RCNLD
					Height	Walls	Type	Finish Partitions							
1	01-01	1x2080	199	Multi-Use Apartment	11		Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	18,240
1	01-01	1x2304	187	Light Manufacturing	11	Brick/Stone	Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	43,460
1	01-01	1x572	52	Light Manufacturing	11	Conc. Block	Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	4,440
1	02-02	1x2080	199	Multi-Use Apartment	11	Brick/Stone	Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	26,150
1	02-02	1x2304	87	Light Manufacturing	11	Brick/Stone	Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	13,710
1	03-03	1x2304	200	Light Manufacturing	11	Brick/Stone	Wood Joist	+02 Normal	Hw/Steam	None	Normal	Fair	Fair	0%	18,490
0	-	0x0	0		0			0 None	None	None	None		None	0%	0
0	-	0x0	0		0			0 None	None	None	None		None	0%	0

Building Information	
Building No:	1
Year Built:	1880
No of Units:	1
Structure Type:	Manufacturing
Grade:	C
Identical Units:	1
Efficiencies:	0
1 Bedroom Apts:	0
2 Bedroom Apts:	0
3 Bedroom Apts:	0
Covered Park:	0
Uncovered Park:	0
Notes	
0 Bldg#42:physical Plant Svc	
0 Aintenance & Warehouse-B2	


Building Summary	
Total Unadjusted RCN:	355,660
Average Percent Good:	.35
Total Unadjusted RCNLD:	186,740
Grade Factor:	1.00
No of Identical Units:	1
Economic Cond Factor:	1.00
RCNLD:	186,740

Income Approach Summary	
Net Rentable Area:	11,644
Efficiencies:	0
1Br:	0
2Br:	0
3Br:	0
# of Units:	0
Pgl:	20,955
Egl:	18,859
Expenses:	2,829

Out Building Information		Lght/ Ident		Physical		Functional		Percent	
StructureCode	+/- Width	SqFt	Units	Gr	Condition	Utility	Year	Good	RCNLD
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0
	0	0	0	0	None		0	0%	0

Net Rentable Area:	11,644
Efficiencies:	0
1BR: 0 2BR: 0 3BR: 0	0
# of Units:	0
PGL:	20,955
EGI:	18,859
Expenses:	2,829
NOI:	16,031
Cap Rate:	12
Residual Land:	
Income Ind Value:	133,600

Line	StructureCode	Building Other Information	+/- Measure 1	Measure 2	Identical/Units
2	Elevator - Elec. Passenger		2000	3	50
2	Sprinkler - Wet		11644	0	1
0			0	0	0
0			0	0	0
0			0	0	0
0			0	0	0
0			0	0	0
0			0	0	0
0			0	0	0

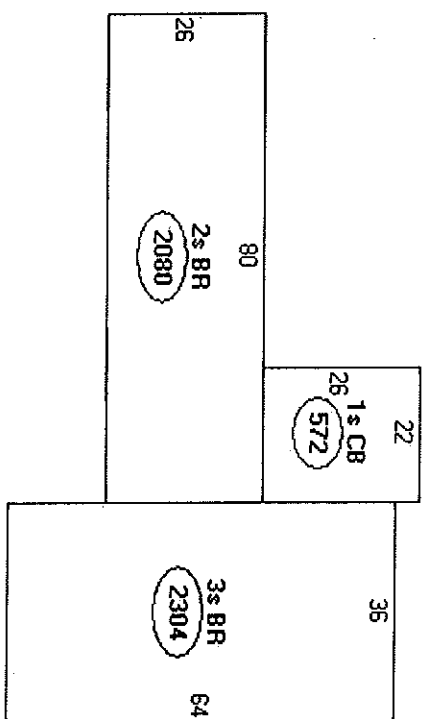

**Descriptor/Area**  
 A: 2s BR  
 2080 sqft  
 B: 1s CB  
 572 sqft  
 C: 3s BR  
 2304 sqft

2. PG of \_\_\_\_\_



3.	FOR STATE AGENCY USE ONLY	A. DATE ENTERED <i>11-27-98</i>
	B. FEE BILLED	C. FEE RECEIVED
INATES Y		E. DOES FACILITY MEET NEW REQUIREMENTS? <input type="checkbox"/> YES <input type="checkbox"/> NO

D. GRID COORDINATES X <u>          </u> Y <u>          </u>	E. DOES FACILITY MEET NEW REQUIREMENTS? <input type="checkbox"/> YES <input type="checkbox"/> NO
--	---

FILED  
83-2879

4. LOCATION OF FACILITY	SITE NAME 56 Hamlin Street	NO. AND STREET	NEAREST INTERSECTING STREET College Street	CITY OR TOWN Middletown	STATE CT	LATITUDE I II		LONGITUDE I II	
6. BUSINESS NAME AND MAILING ADDRESS	NAME Wesleyan University	NO. AND STREET 186 College Street	CITY OR TOWN Middletown	STATE	ZIP CODE 06459	TELEPHONE (860) 685-3758			
7. FACILITY OWNER	NAME	NO. AND STREET	CITY OR TOWN	STATE	ZIP CODE	TELEPHONE ( )			

8. TYPE OF OWNER	<input checked="" type="checkbox"/> PRIVATE	<input type="checkbox"/> STATE	<input type="checkbox"/> MUNICIPAL	<input type="checkbox"/> FEDERAL ( G.S.A. NO. _____ )
------------------	---	--------------------------------	------------------------------------	---

9.	OPERATOR/CONTACT PERSON	NAME Buxley Domingue	NO. AND STREET 255 Pine Street	CITY OR TOWN Middletown	STATE CT	ZIP CODE 06459	TELEPHONE (860) 685-3332
----	-------------------------	-------------------------	-----------------------------------	----------------------------	-------------	-------------------	-----------------------------

10. TANK ID	11a. DATE OF INSTALLATION (Mo./Yr.)	11b. LIFE EXPECTANCY (# of years)	12a. TOTAL CAPACITY (Gals.)	12b. STATUS				13. TYPE OF CONTENTS		14. CONTENTS CHEMICAL NAME OF PRINCIPAL SUBSTANCE (not trade name) (Enter C.A.S. No., if known)	15. CONSTRUCTION MATERIALS				16. PROTECTION						17. INTEGRAL PIPING SYSTEM a. DATE OF INSTALLATION OR REPLACEMENT (Mo./Yr.) b. MONITORING SYSTEM (Specify type from list B)	18. FAILURE DETERMINATION CONDUCTED? (If "YES", enter "DATE" and attach results). (If "NO", enter "NO")				
				IN USE	ABANDONED IN PLACE	EST. QUANTITY LEFT STORED (If any) (Gals.)	REMOVED	DATE TANK LAST USED (Mo./Yr.)	OIL/PETROLEUM PRODUCT		CHEMICAL LIQUID	STEEL	FIBERGLASS REINFORCED PLASTIC	OTHER (Specify from List A)	a. INTERNAL			b. EXTERNAL								
Example	5/75	30	5000	X					X		Heating fuel #2		X			X					H	3	H	5/75	U	NO
Example	7/60	-	8000				X	8/78		X	1,1,1, - Trichloroethane CAS #79016	X			X					E	7	W	7/60	U	-	
	over 20 years		1000			0	X	8/97			1,000 gallon gasoline	X			X											
<div>RECEIVED</div> <div>SEP - 8 1998</div> <div>DEP WASTE MGMT UNDERGROUND STORAGE TANK CEMENT PCC/BA</div>																										

20. HAVE YOU ATTACHED SKETCH OF TANKS AND LOCATION? ☐ YES

21. COMMENTS:

**22. CERTIFICATION:** I certify under penalty of law that I have personally examined the information submitted in this and all attached documents and that, based on my inquiry, the information is true and complete and I am personally responsible for obtaining the information or its accuracy. I believe that the submitted information is true, accurate and complete.

**Penalties:** any owner who knowingly fails to notify shall be subject to a civil penalty not to exceed \$10,000 for each tank for which notification is not given or for which false information is submitted.

22a. SIGNATURE  
Melanie Fogarty  
22b. NAME (Type or Print)  
Melanie Fogarty

22b. DATE SIGNED: 8/31/98

22b. OFFICIAL TITLE (of owner or authorized representative):

**COPY 1:** SEND TO DEP UST Program: 79 Elm Street, Hartford, CT 06106-5127





HIGH STREET

COLLEGE STREET

HAMLIN ST

PARKING  
AREA

56 HAMLIN  
STREET

TRUCK  
STORAGE  
AREA

PARKING AREA

**Bureau of Waste Management, Oil and Chemical Spill Response Division**

**Emergency Incident Report**

Case No.: 2001-05781

Staff Receiving Call: 933 SANTACROCE, JIM

Assigned To: 000 NO RESPONSE

Date Reported: 08/02/2001

Time Reported: 10:49

Date of Release: 08/02/2001

Time of Release: UNKNOWN

Town of Release: MIDDLETOWN

State of Release: CT

Location of Reported Release: 56 HAMLIN ST

Reported By: SIDNEY MEER

Phone: (860) 721-1424

Representing: URF INC

Responsible Party: WESLEYAN UNIVERSITY

Phone:

Street Address: 186 COLLEGE ST

Town: MIDDLETOWN

State: CT

Zip Code: 06457-

Does the Responsible Party Accept Financial Responsibility? YES

Release Type: PETROLEUM

Release Substance: GASOLINE

Media: TANK GRAVE

Total Quantity: 0 Gallons 0 Cubic Yards 0 Cubic Feet 0 Drums 0 Pounds

Emergency Measures: Just removed mid 90's, level below rsr in ppb, 1000g Just, reexcavation and testing showed these previously unreported contaminants

Has the Release Been Terminated?: YES

Type of Waterbody Affected:

Name of Waterbody Affected:

Total Quantity Recovered: 0

Total Quantity in Water: 0

Corrective Actions Taken: REMOVED TANK

Discharge Class: PRIVATE

Cause of Incident: INGROUND TANK FAILURE

Agencies Notified: LOCAL FIRE MARSHAL

Status: CLOSED



## Bureau of Waste Management, Oil and Chemical Spill Response Division

### Emergency Incident Report

Case No.: 2002-05603

Staff Receiving Call: 923 MCCANN, MIKE

Assigned To: 000 NO RESPONSE

Date Reported: 08/14/2002

Time Reported: 16:20

Date of Release: 08/14/2002

Time of Release: UNKNOWN

Town of Release: MIDDLETOWN

State of Release: CT

Location of Reported Release: 56 HANLON ST

Reported By: CHRISTINE MATHERLY

Phone: (860) 529-8882

Representing: URS CORP

Responsible Party: WESLYAN UNIVERSITY

Phone:

Street Address:

Town: MIDDLETOWN

State: CT

Zip Code: 06457-

Does the Responsible Party Accept Financial Responsibility? YES

Release Type: PETROLEUM

Release Substance: #2 FUEL OIL

Media: GROUND SURFACE

Total Quantity: 0 Gallons 0 Cubic Yards 0 Cubic Feet 0 Drums 0 Pounds

Emergency Measures: REMOVAL OF 2K UST

Has the Release Been Terminated?: YES

Type of Waterbody Affected:

Name of Waterbody Affected:

Total Quantity Recovered: 0

Total Quantity in Water: 0

Corrective Actions Taken: REMOVED TANK

Discharge Class: PRIVATE

Cause of Incident: INGROUND TANK FAILURE

Agencies Notified:

Status: CLOSED



Common Identifier: \_\_\_\_\_

CASE NO. 12-6575

CONNECTICUT DEPARTMENT OF ENVIRONMENTAL PROTECTION  
BUREAU OF WASTE MANAGEMENT, OIL AND CHEMICAL SPILL RESPONSE DIVISION  
EMERGENCY INCIDENT REPORT FORM

ASSIGNED TO: NJR

DATE: 1/21/23 1992

TIME: (Military) 09:12

TOWN: Middle town

REPORTED BY: Alexander Bsechnick

TELEPHONE: Business ( 15881200 ) Home ( )

Representing: Automatic TLC

Street 64 Octland Ave

Town East Hartford

State \_\_\_\_\_

Zip Code \_\_\_\_\_

INCIDENT LOCATION: # \_\_\_\_\_

Street 56 Hamlin St.

Town \_\_\_\_\_

Pole No. \_\_\_\_\_

TYPE OF INCIDENT:

LONGITUDE READING: \_\_\_\_\_

LATITUDE READING: \_\_\_\_\_

G.I.S. \_\_\_\_\_

☐ Petroleum ☐ Chemical ☐ Dielect ☐ Gaseous ☐ Hazardous Waste ☐ Sewage related ☐ Biomedical ☐ Algae ☐ Other \_\_\_\_\_

DISCHARGE SUBSTANCE: power steering fluid

QUANTITY: 3 gal

gallon(s)

cubic yards

cubic feet

lb(s)

concentration

drum(s)

If this is a chemical release does this incident constitute a SARA 304 Release? ☐ Yes ☐ No If yes, then you must obtain the following additional information:

☐ SARA 304 Release - Extremely Hazardous Substance ☐ CERCLA Hazardous Substance Federal exceeding R.Q. ☐ Cross property line ☐ Protective actions have been taken

R.Q. #'s: \_\_\_\_\_ Total lb(s) \_\_\_\_\_ lb(s)

SARA Title III: Describe Protective actions and provide medical information:

DATE OF SPILL: 1/21/23 1992 ☐ unknown ☐ on-going

TIME OF SPILL: 09:00  
(Military Time)

HAS THE RELEASE BEEN TERMINATED? ☐ Yes ☐ No ☐ on-going ☐ unknown Release  
HAS THE RELEASE BEEN CONTAINED? ☐ Yes ☐ No ☐ no decision

Misc. info: \_\_\_\_\_

WATER BODY: \_\_\_\_\_

☐ River ☐ L.I.S. ☐ Tributary ☐ Catch Basin/Storm drain ☐ Pond

MEDIA: ☐ air ☐ surface water ☐ ground water ☐ ground surface ☐ inside building ☐ other \_\_\_\_\_

TOTAL IN WATER: \_\_\_\_\_

TOTAL RECOVERED FROM WATER: \_\_\_\_\_

QUANTITY RECOVERED: \_\_\_\_\_  
approximate gallons

POLLUTER NAME: \_\_\_\_\_

Polluter Mailing Address \_\_\_\_\_

Phone \_\_\_\_\_

POLLUTER ACCEPTS FINANCIAL RESPONSIBILITY? ☐ Yes ☐ No ☐ unknown ☐ polluter unknown

CLEAN-UP ACTIONS BEING TAKEN: \_\_\_\_\_

AGENCIES NOTIFIED: ☐ EPA-LEXINGTON ☐ U.S. COAST GUARD ☐ LOCAL FIRE MARSHAL ☐ LOCAL FIRE ☐ LOCAL POLICE ☐ Other \_\_\_\_\_

☐ AQUACULTURE ☐ STATE D.O.H.S. ☐ DEP/EO/WATER ☐ DEP/EO/AIR ☐ DEP/EO/WASTE ☐ WEED/HW ☐ WEED/SW ☐ PMD ☐ UST ☐ SRCD ☐ DEP/AIR  
☐ DEP/EC ☐ P&F ☐ F&W ☐ OPS ☐ OTHER \_\_\_\_\_ State Agencies: \_\_\_\_\_

DATE OF NOTIFICATION: \_\_\_\_\_

Month \_\_\_\_\_ Day \_\_\_\_\_ Year \_\_\_\_\_

TIME OF NOTIFICATION: \_\_\_\_\_

(Military Time)

DISCHARGE CLASS:

1 ☐ Unknown

4 ☐ Industrial

7 ☐ Private

10 ☐ Utility

2 ☐ Marine Terminal

5 ☐ Transportation

8 ☐ Vessel

11 ☐ Natural

3 ☐ Inland Terminal

6 ☐ Governmental

9 ☐ Commercial

12 ☐ Other \_\_\_\_\_

CAUSE OF INCIDENT:

1 ☐ Unknown

7 ☐ Cargo Tank Failure

13 ☐ Fire

19 ☐ Sinking

25 ☐ Road Oiling/Repair

2 ☐ Hose Failure

8 ☐ Fuel Tank Failure

14 ☐ Power Failure

20 ☐ Seepage

26 ☐ Motor Vehicle accident

3 ☐ Transfer Line Failure

9 ☐ Hull Fracture

15 ☐ Pump Failure

21 ☐ Pumping Blige

27 ☐ Trans./Capactor

4 ☐ Inground Tank Failure

10 ☐ Overfill

16 ☐ Pumping

22 ☐ Open Hatch

28 ☐ Natural

5 ☐ Above Ground Tank Failure

11 ☐ Container Failure

17 ☐ Dumping

23 ☐ Vandalism

29 ☐ Leaking UST Report

6 ☐ Saddle Tank Failure

12 ☐ Valve Failure

18 ☐ Illegal Discharge

24 ☐ Blow Back

30 ☐ Other: \_\_\_\_\_

1 <input type="checkbox"/> None	8 <input type="checkbox"/> Dissipated	15 <input type="checkbox"/> Pumped Out	22 <input type="checkbox"/> Soil Removal
2 <input type="checkbox"/> None required	9 <input type="checkbox"/> Evaporated	16 <input type="checkbox"/> Neutralized	23 <input type="checkbox"/> UST Enforcement
3 <input type="checkbox"/> Unknown	10 <input type="checkbox"/> Sanded	17 <input type="checkbox"/> Recovery System	24 <input type="checkbox"/> Other: _____
4 <input type="checkbox"/> Removed	11 <input type="checkbox"/> Foamed	18 <input type="checkbox"/> Repaired Line	
5 <input checked="" type="checkbox"/> Contained/Remove	12 <input type="checkbox"/> Referred	19 <input type="checkbox"/> Repaired Tank	
6 <input type="checkbox"/> Contracted	13 <input type="checkbox"/> Cleaned	20 <input type="checkbox"/> Dispersed	
7 <input type="checkbox"/> Test Wells	14 <input type="checkbox"/> Washed Down	21 <input type="checkbox"/> Removed Tank	

Requested: \_\_\_\_\_ Arrived: \_\_\_\_\_ (Military Time)

RECEIVED BY: PUTER 967 INSPECTOR ASSIGNED: N 112

DATE ASSIGNED: |      |      |      | TIME ASSIGNED: \_\_\_\_\_  
                  Month     Day     Year                         (Military Time)

ESTIMATED TIME OF ARRIVAL: \_\_\_\_\_ STATUS: ☐ Open ☐ Closed ☐ Monitored

[illegible]

**SUPPLEMENTAL INFORMATION**

1. If this is a chemical release and was not reported by 911 emergency response system, does this release require a Notification be sent per Public Act 90-276? ☐ Yes ☐ No

2. Status of notification ☐ sent 3. Is this an 1136 case? ☐ Yes ☐ No 4. 1136 Case No. \_\_\_\_\_ 5. Is this a Federal 311K case? ☐ Yes ☐ No 6. PIN \_\_\_\_\_

7. Has the Cost Recovery Expenditure Summary been Initiated? ☐ Yes ☐ No 8. Incident Code

PROPERTY OWNER: ☐ State ☐ Municipal ☐ Corporation ☐ Private ☐ Federal ☐ Unknown

POLLUTER: ☐ Truck ☐ Trailer ☐ Owner \_\_\_\_\_ ☐ Operator \_\_\_\_\_

POLLUTER: ☐ Truck ☐ Trailer ☐ Owner \_\_\_\_\_  
VEHICLE IDENTIFICATION: MAKE \_\_\_\_\_ MODEL \_\_\_\_\_ REGISTRATION \_\_\_\_\_ OWNER OF VEHICLE \_\_\_\_\_

ADDITIONAL INFORMATION: \_\_\_\_\_

☐ ☐  
 HAS THIS REPORT BEEN UPDATED WITH THE INSPECTOR'S REPORT? No Yes Date: \_\_\_\_\_

# UNDERGROUND STORAGE FACILITY NOTIFICATION

1a. ☐ FIRST NOTIFICATION  
OR  
1b. ☐ SUBSEQUENT NOTIFICATION

SITE ID: 83-2879

(If checked, enter no.)

LOCATION OF FACILITY

SITE NAME

BUSINESS NAME AND MAILING ADDRESS

NAME

FACILITY OWNER

NAME

TYPE OF OWNER

PRIVATE

OPERATOR/CONTACT PERSON

NAME

TANK I.D.

DATE OF INSTALLATION (Mo./Yr.)

LIFE EXPECTANCY (Years)

TOTAL CAPACITY (Gals.)

IN USE

ABANDONED IN PLACE

EST. QUANTITY LEFT STORED (If any) (Gals.)

REMOVED

DATE TANK LAST USED (Mo./Yr.)

OIL/PETRO. PRODUCT

CHEMICAL SUBSTANCE (not trade name) (Enter C.A.S. No. if known)

13. TYPE OF CONTENTS

14. CONTENTS

15. CONSTRUCTION MATERIALS

16. PROTECTION

17. INTL. PIPING

18. STATE

19. CITY OR TOWN

20. HAVE YOU ATTACHED SKETCH OF TANKS AND LOCATION?

21. COMMENTS:

22. CERTIFICATION:

23. SIGNATURE

24. NAME (Print or Print)

25. ADDRESS

26. CITY OR TOWN

27. STATE

28. ZIP

29. PHONE

30. FAX

31. E-MAIL

32. OTHER

33. COMMENTS

34. DATE

35. TIME

36. SIGNATURE

37. NAME (Print or Print)

38. ADDRESS

39. CITY OR TOWN

40. STATE

41. ZIP

42. PHONE

43. FAX

44. E-MAIL

45. OTHER

46. COMMENTS

47. DATE

48. TIME

49. SIGNATURE

50. NAME (Print or Print)

51. ADDRESS

52. CITY OR TOWN

53. STATE

54. ZIP

55. PHONE

56. FAX

57. E-MAIL

58. OTHER

59. COMMENTS

60. DATE

61. TIME

62. SIGNATURE

63. NAME (Print or Print)

64. ADDRESS

65. CITY OR TOWN

66. STATE

67. ZIP

68. PHONE

69. FAX

70. E-MAIL

71. OTHER

72. COMMENTS

73. DATE

74. TIME

75. SIGNATURE

76. NAME (Print or Print)

77. ADDRESS

78. CITY OR TOWN

79. STATE

80. ZIP

81. PHONE

82. FAX

83. E-MAIL

84. OTHER

85. COMMENTS

86. DATE

87. TIME

88. SIGNATURE

89. NAME (Print or Print)

90. ADDRESS

91. CITY OR TOWN

92. STATE

93. ZIP

94. PHONE

95. FAX

96. E-MAIL

97. OTHER

98. COMMENTS

99. DATE

100. TIME

101. SIGNATURE

102. NAME (Print or Print)

103. ADDRESS

104. CITY OR TOWN

105. STATE

106. ZIP

107. PHONE

108. FAX

109. E-MAIL

110. OTHER

111. COMMENTS

112. DATE

113. TIME

114. SIGNATURE

115. NAME (Print or Print)

116. ADDRESS

117. CITY OR TOWN

118. STATE

119. ZIP

120. PHONE

121. FAX

122. E-MAIL

123. OTHER

124. COMMENTS

125. DATE

126. TIME

127. SIGNATURE

128. NAME (Print or Print)

129. ADDRESS

130. CITY OR TOWN

131. STATE

132. ZIP

133. PHONE

134. FAX

135. E-MAIL

136. OTHER

137. COMMENTS

138. DATE

139. TIME

140. SIGNATURE

141. NAME (Print or Print)

142. ADDRESS

143. CITY OR TOWN

144. STATE

145. ZIP

146. PHONE

147. FAX

148. E-MAIL

149. OTHER

150. COMMENTS

151. DATE

152. TIME

153. SIGNATURE

154. NAME (Print or Print)

155. ADDRESS

156. CITY OR TOWN

157. STATE

158. ZIP

159. PHONE

160. FAX

161. E-MAIL

162. OTHER

163. COMMENTS

164. DATE

165. TIME

166. SIGNATURE

167. NAME (Print or Print)

168. ADDRESS

169. CITY OR TOWN

170. STATE

171. ZIP

172. PHONE

173. FAX

174. E-MAIL

175. OTHER

176. COMMENTS

177. DATE

178. TIME

179. SIGNATURE

180. NAME (Print or Print)

181. ADDRESS

182. CITY OR TOWN

183. STATE

184. ZIP

185. PHONE

186. FAX

187. E-MAIL

188. OTHER

189. COMMENTS

190. DATE

191. TIME

192. SIGNATURE

193. NAME (Print or Print)

194. ADDRESS

195. CITY OR TOWN

196. STATE

197. ZIP

198. PHONE

199. FAX

200. E-MAIL

201. OTHER

202. COMMENTS

203. DATE

204. TIME

205. SIGNATURE

206. NAME (Print or Print)

207. ADDRESS

208. CITY OR TOWN

209. STATE

210. ZIP

211. PHONE

212. FAX

213. E-MAIL

214. OTHER

215. COMMENTS

216. DATE

217. TIME

218. SIGNATURE

219. NAME (Print or Print)

220. ADDRESS

221. CITY OR TOWN

222. STATE

223. ZIP

224. PHONE

225. FAX

226. E-MAIL

227. OTHER

228. COMMENTS

229. DATE

230. TIME

231. SIGNATURE

232. NAME (Print or Print)

233. ADDRESS

234. CITY OR TOWN

235. STATE

236. ZIP

237. PHONE

238. FAX

239. E-MAIL

240. OTHER

241. COMMENTS

242. DATE

243. TIME

244. SIGNATURE

245. NAME (Print or Print)

246. ADDRESS

247. CITY OR TOWN

248. STATE

249. ZIP

250. PHONE

251. FAX

252. E-MAIL

253. OTHER

254. COMMENTS

255. DATE

256. TIME

257. SIGNATURE

258. NAME (Print or Print)

259. ADDRESS

260. CITY OR TOWN

261. STATE

262. ZIP

263. PHONE

264. FAX

265. E-MAIL

266. OTHER

267. COMMENTS

268. DATE

269. TIME

270. SIGNATURE

271. NAME (Print or Print)

272. ADDRESS

273. CITY OR TOWN

274. STATE

275. ZIP

276. PHONE

277. FAX

# Shire Corporation

795 Route Thirty-Two, P.O. Box 6  
North Franklin, Connecticut 06254-0006  
Telephone (860) 642-6618

August 11, 1998

Canova Construction Company  
271 New Britain Avenue  
Unionville, CT 06085-1274

Subject: Disposal of Storage Tank

Dear Sirs:

On 7 August 1998 we disposed of one tank that you removed from property located on 56 Hamlin Street in Middletown, Connecticut.

The tank was as follows:

- 1.) one One Thousand gallon underground storage tank.

The tank has been disposed of according to federal, state, and local regulations and rendered unfit for further use. Frequent inspections of the Shire yard by Connecticut Department of Environmental Protection staff insure compliance with all state and federal environmental regulations.

Please feel free to call Len or Sally at 1-800-491-7726 with any questions.

Sincerely yours,



Leonard E. Wiese, Sr.  
President

HIGH STREET

COLLEGE STREET

HAMLIN ST


36 HAMLIN STREET

TRUCK  
STORAGE  
AREA

PARKING  
AREA

PARKING AREA

COLL

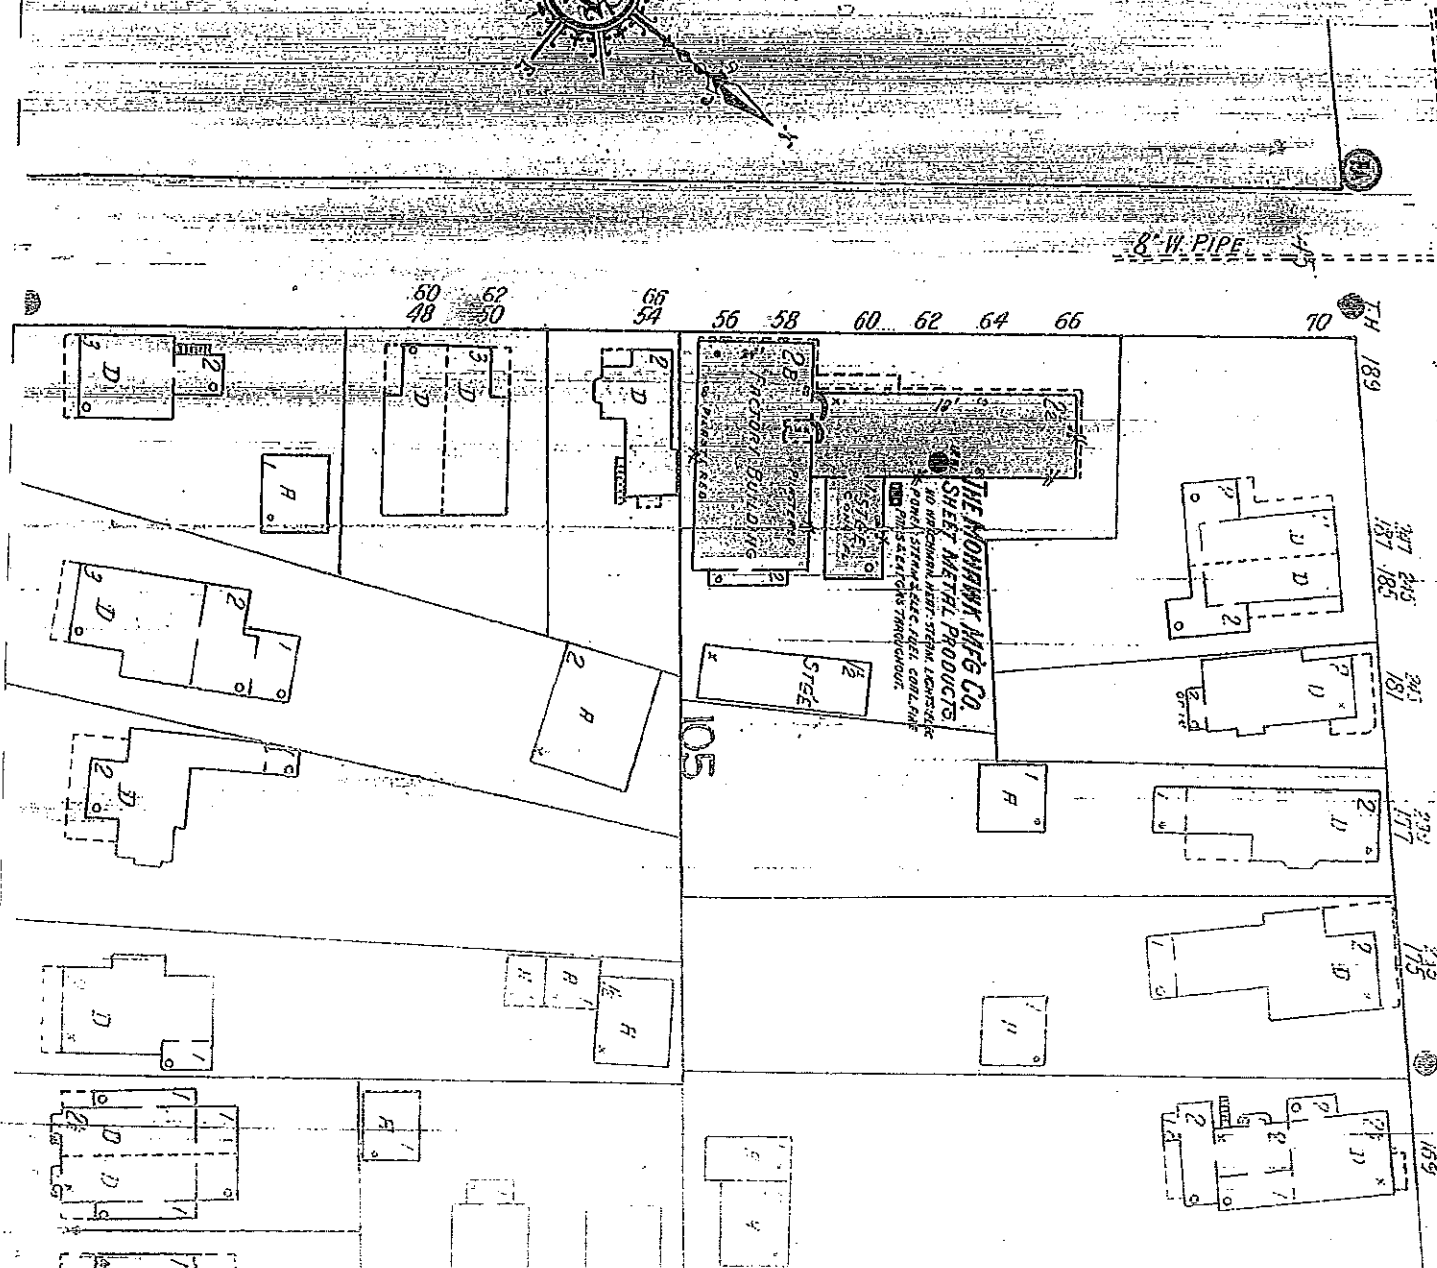

8" W. PIPE

57

187 182


181

2.


175

2	2
---	---

1950

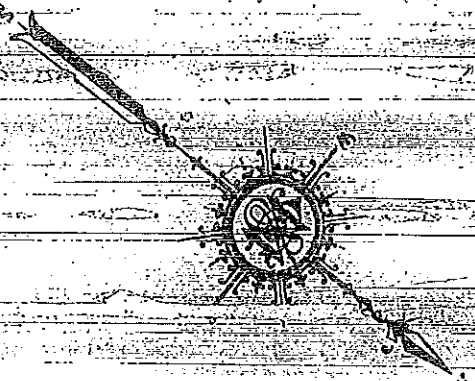


8" W. PIPE

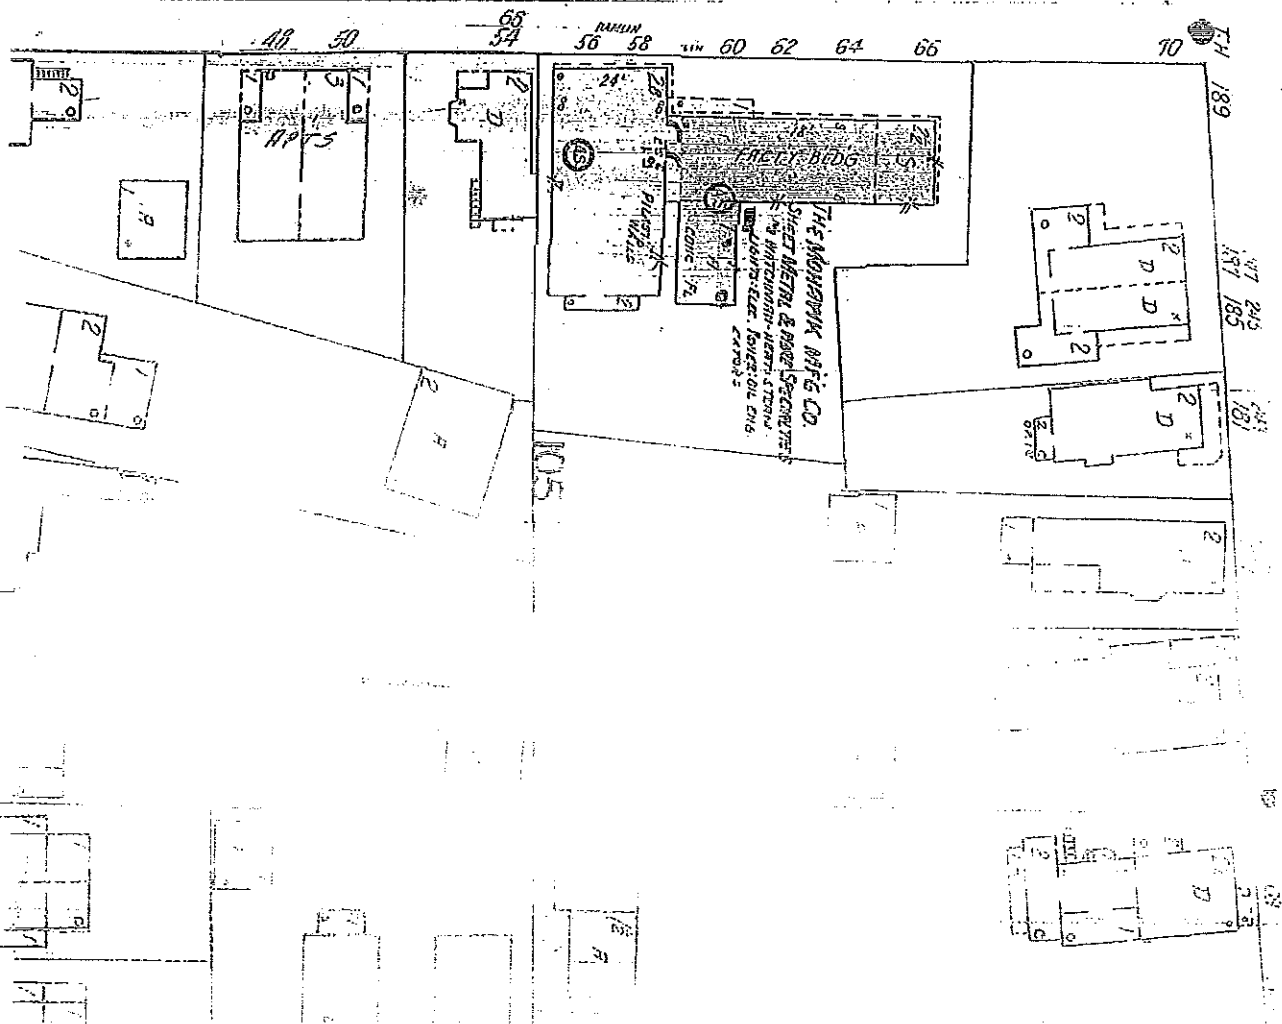

14


COLL

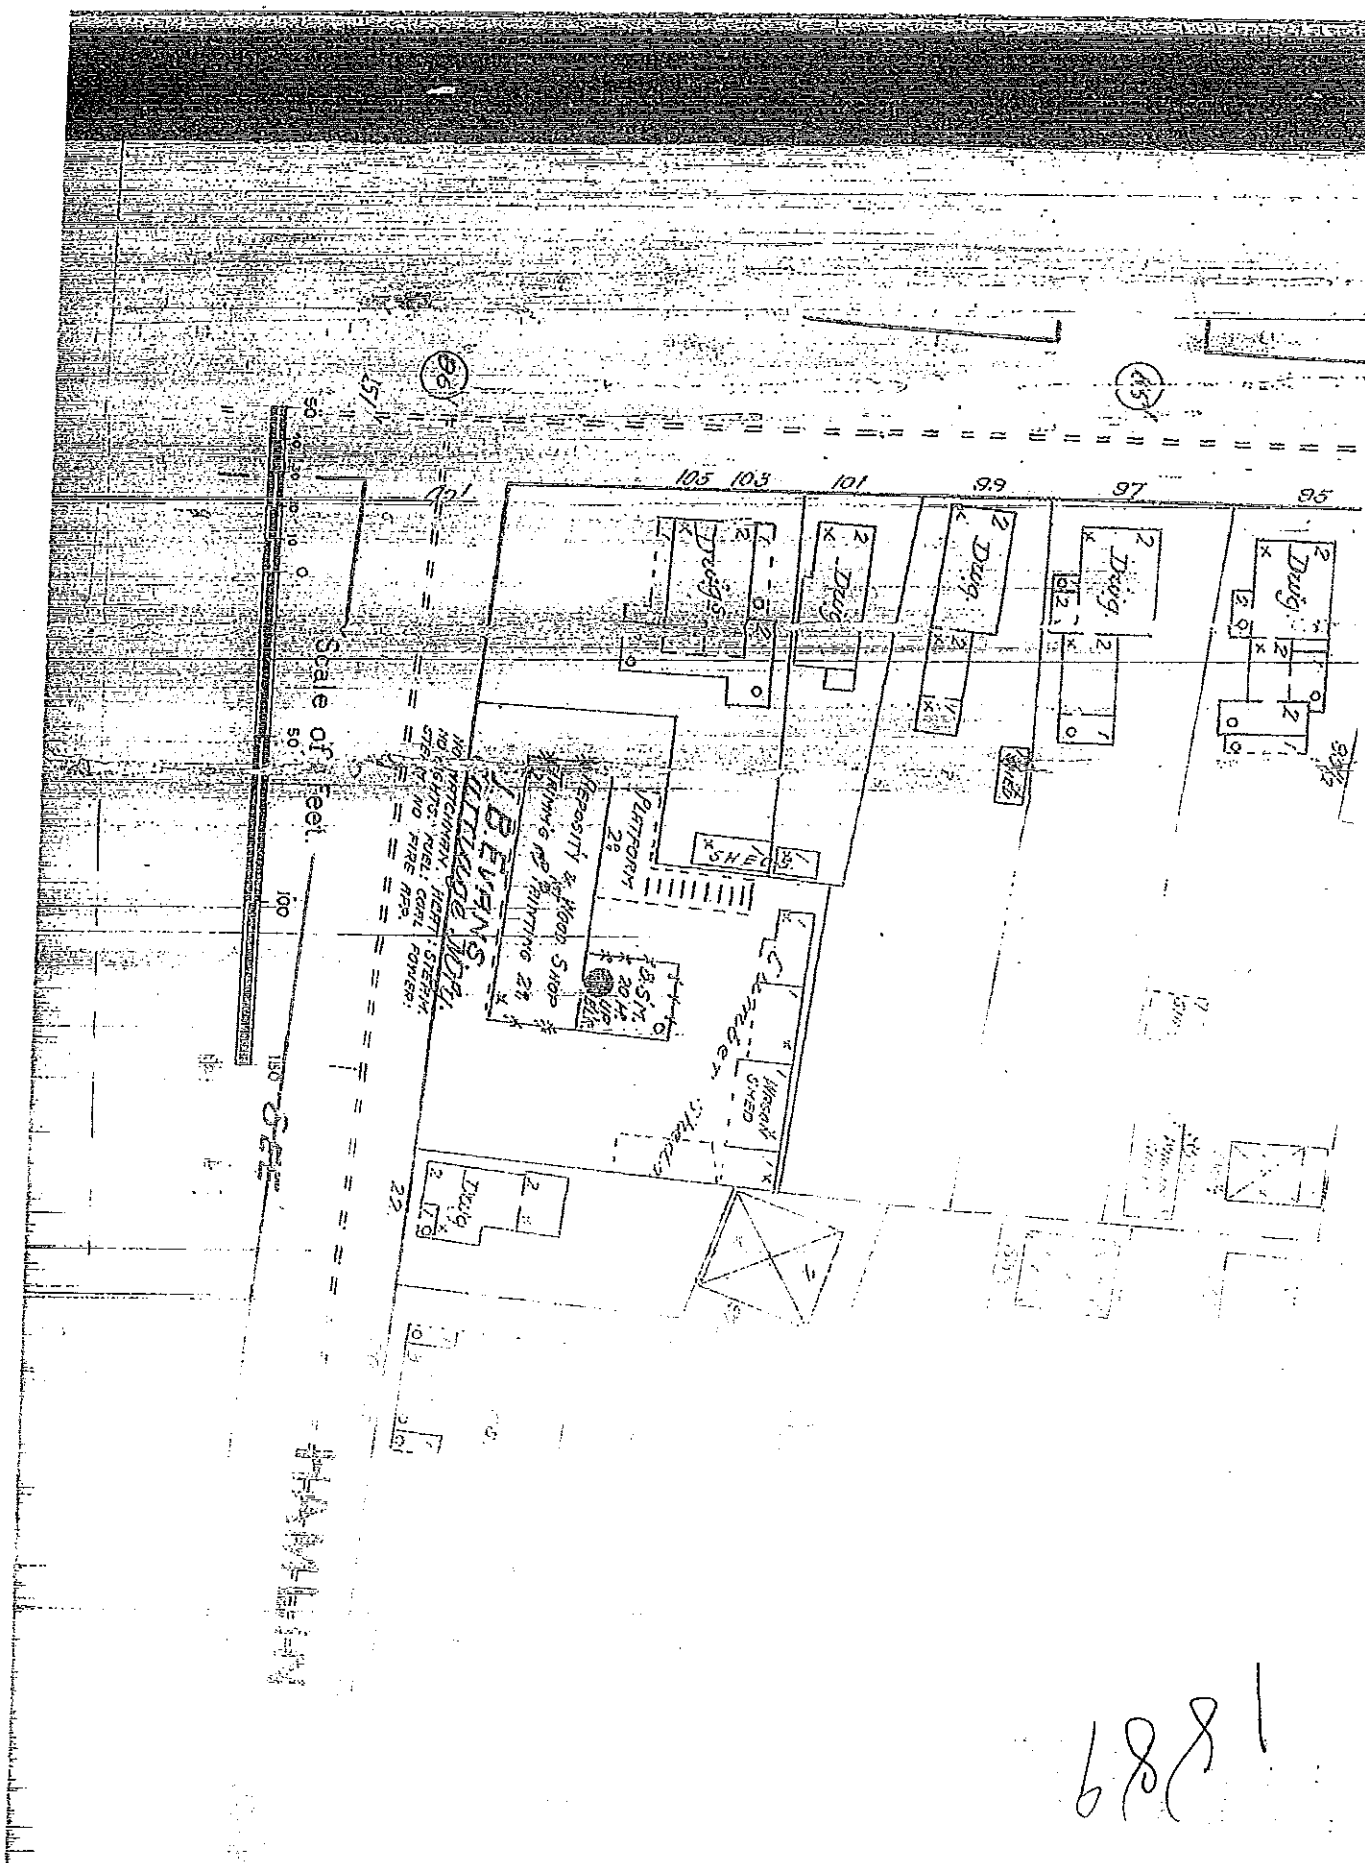




1895

PEARL'S

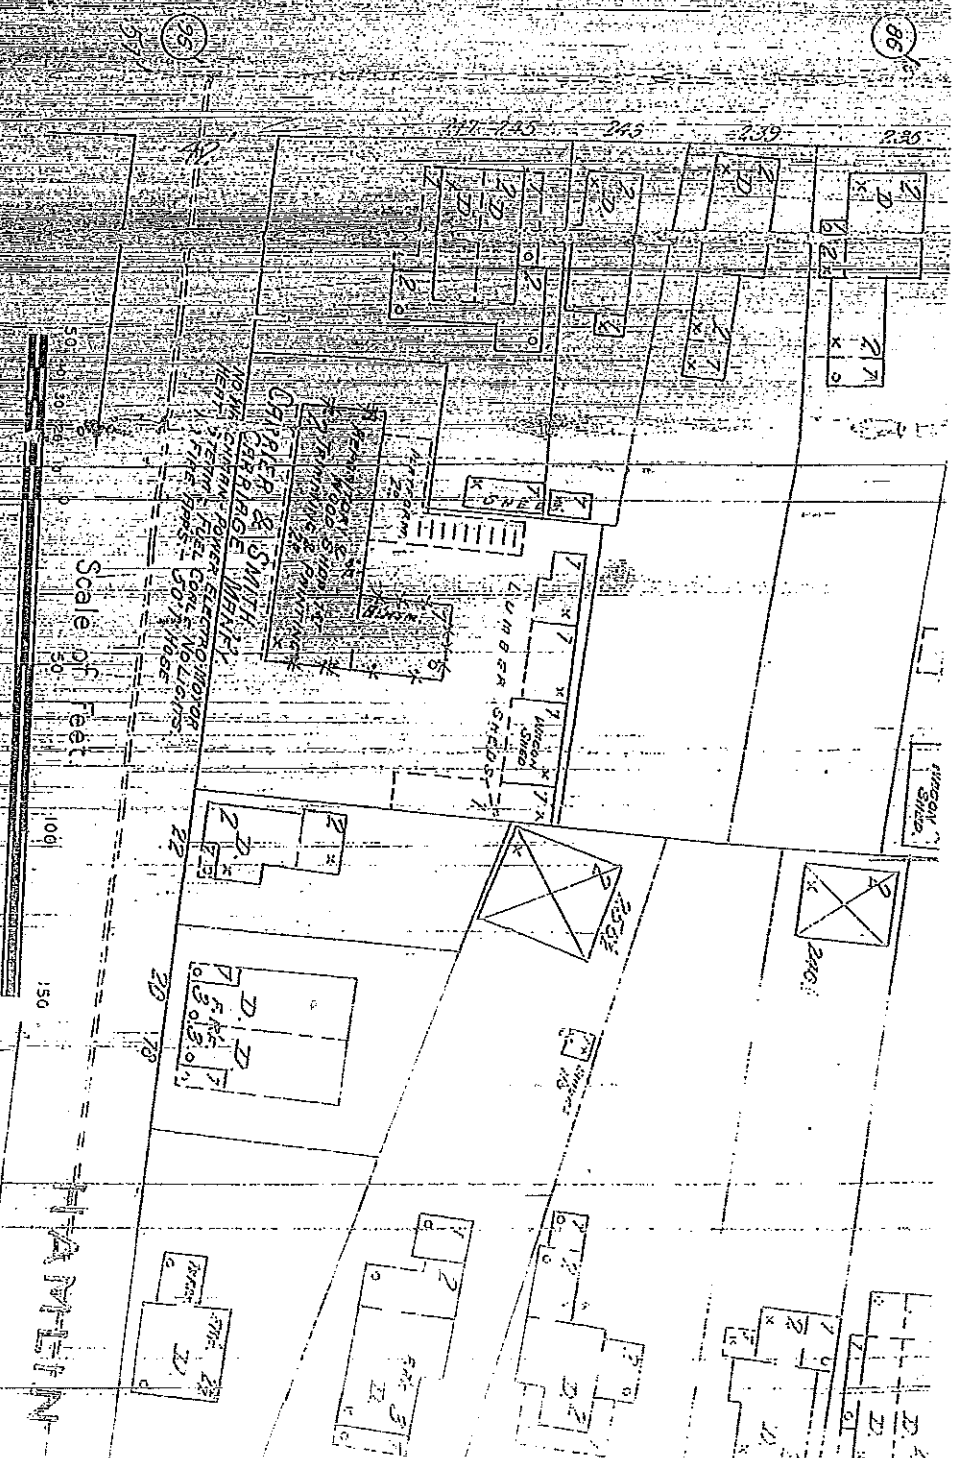

1901

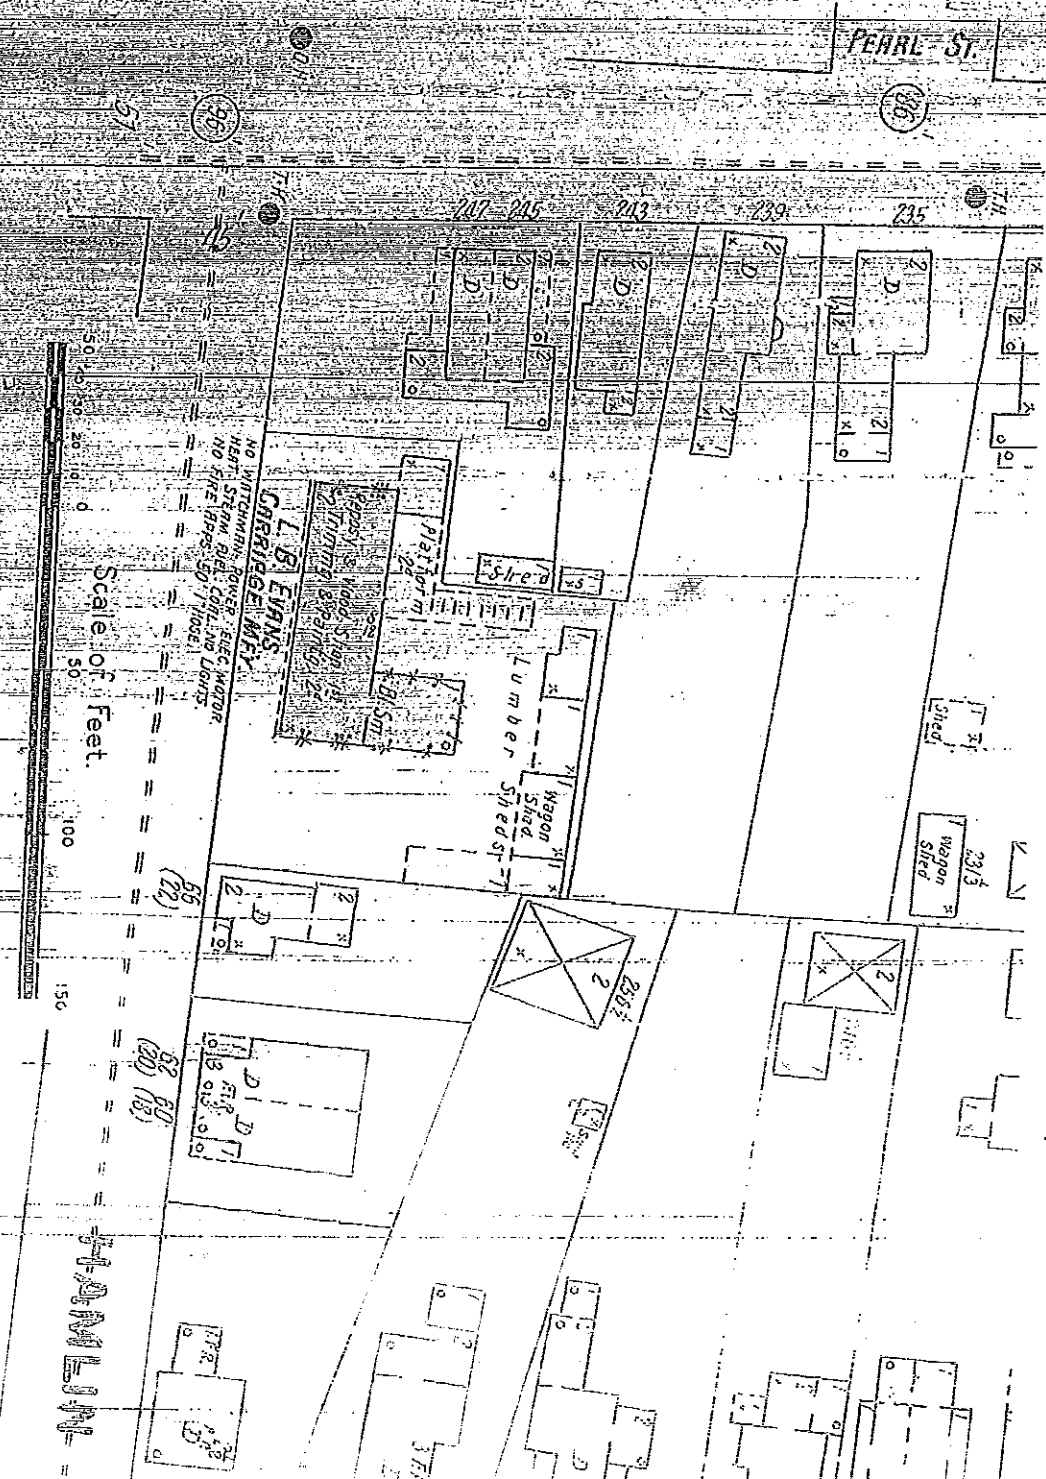

Scale of Feet.

STORM



# FD-302

Scale of Feet

USE HEAT STORE  
NO LIGHT 50% IN NOSE

CHARLES W. HANS  
CARRIAGE MFG. Co.

---

# Appendix D

## Site Photographs

**Vanasse Hangen Brustlin, Inc.**  
**PHOTOLOG DOCUMENTATION**  
56 Hamlin Street  
Middletown, Connecticut




North side of building.




Southeast portion of building.



**Vanasse Hangen Brustlin, Inc.**  
**PHOTOLOG DOCUMENTATION**  
56 Hamlin Street  
Middletown, Connecticut

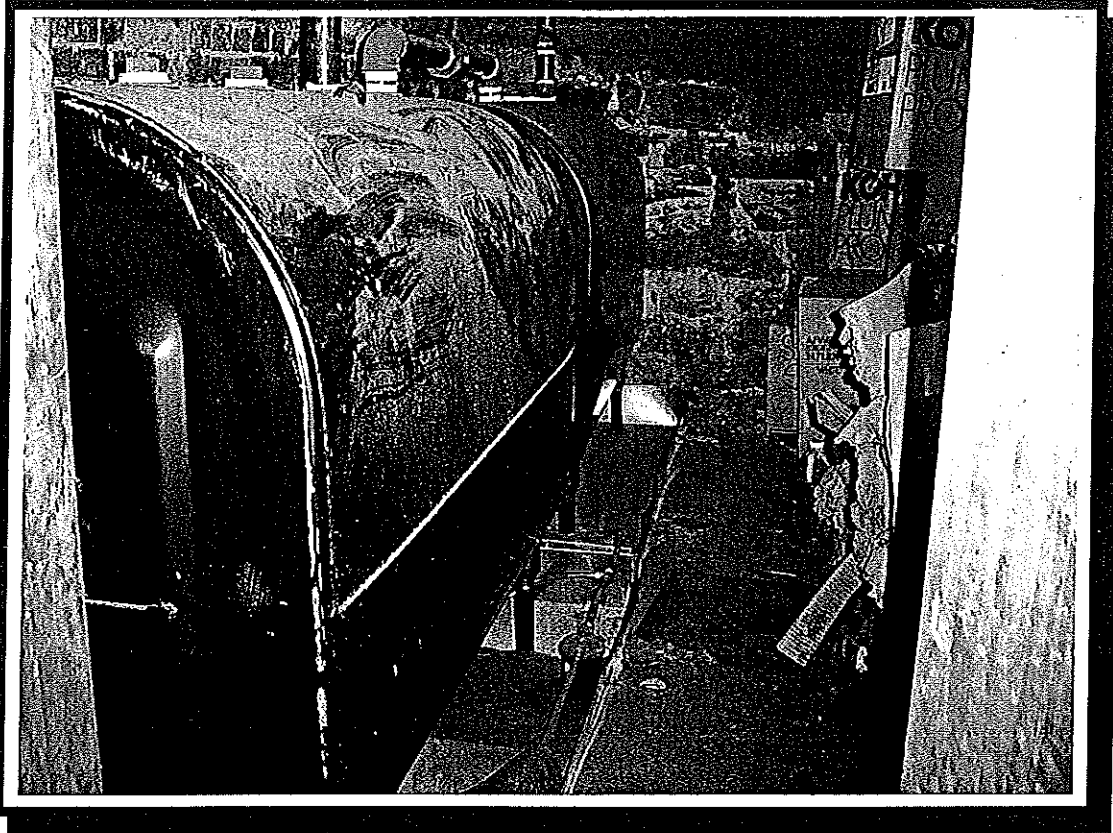

Two 275-gallon ASTs.

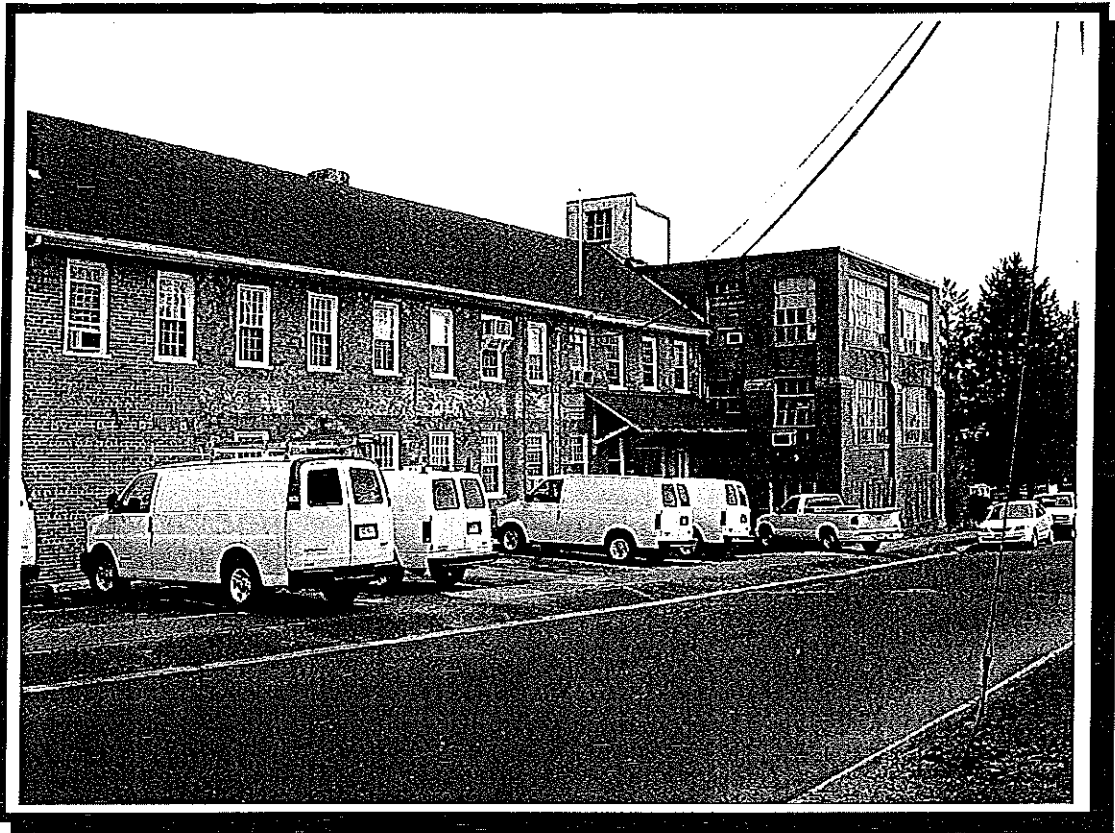


West side of Building.

Vanasse Hangen Brustlin, Inc.  
PHOTOLOG DOCUMENTATION  
56 Hamlin Street  
Middletown, Connecticut




Vent and fill pipes for two ASTs.

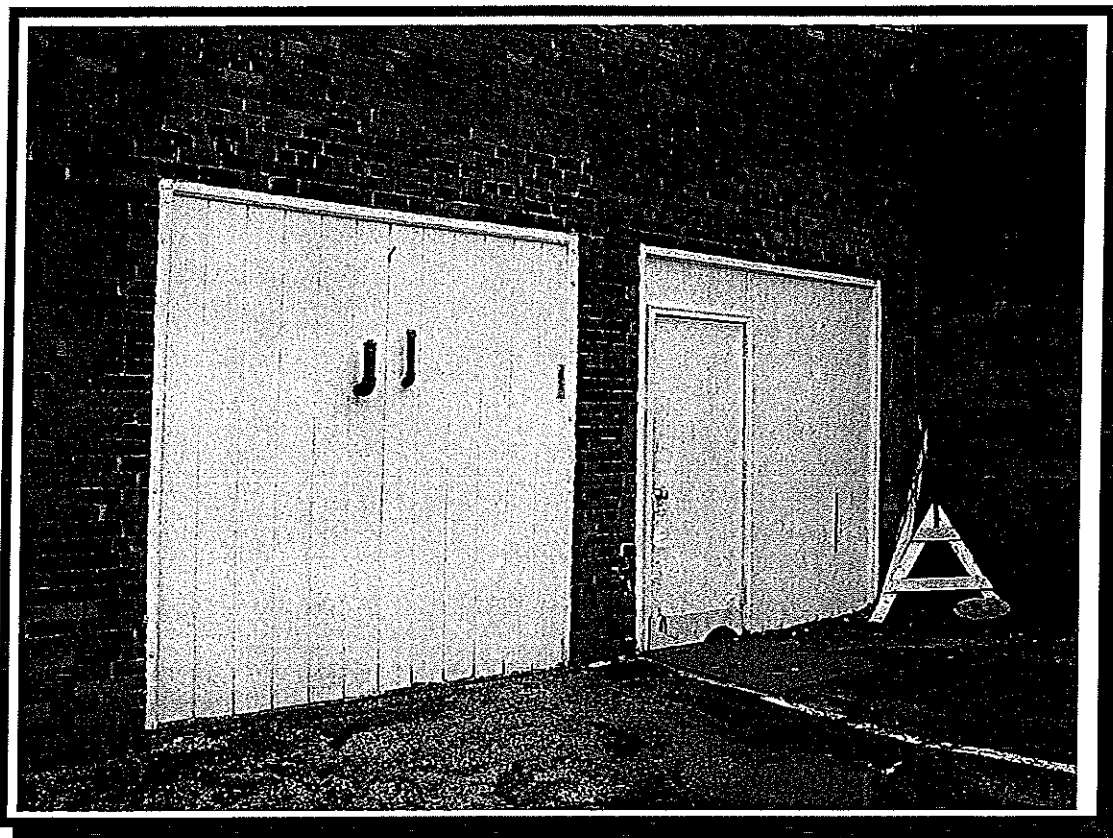


Vent and fill pipes for two ASTs.

Vanasse Hangen Brustlin, Inc.  
PHOTOLOG DOCUMENTATION  
56 Hamlin Street  
Middletown, Connecticut

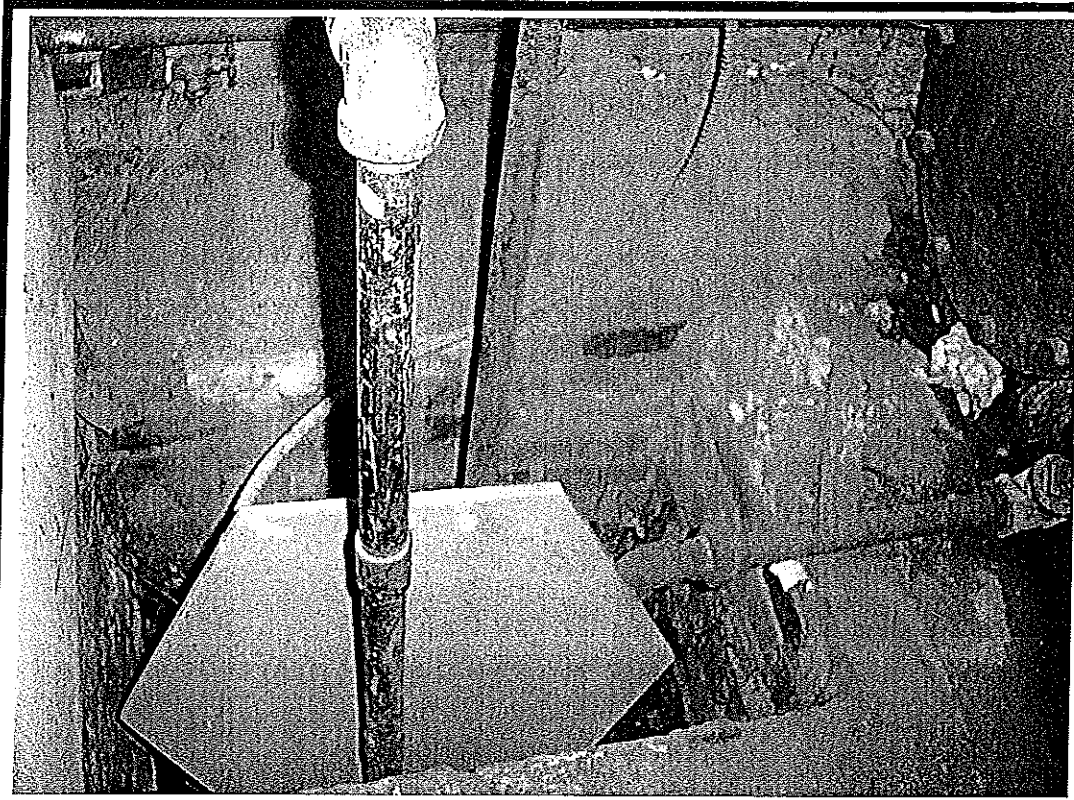

Utility trench in furnace room.

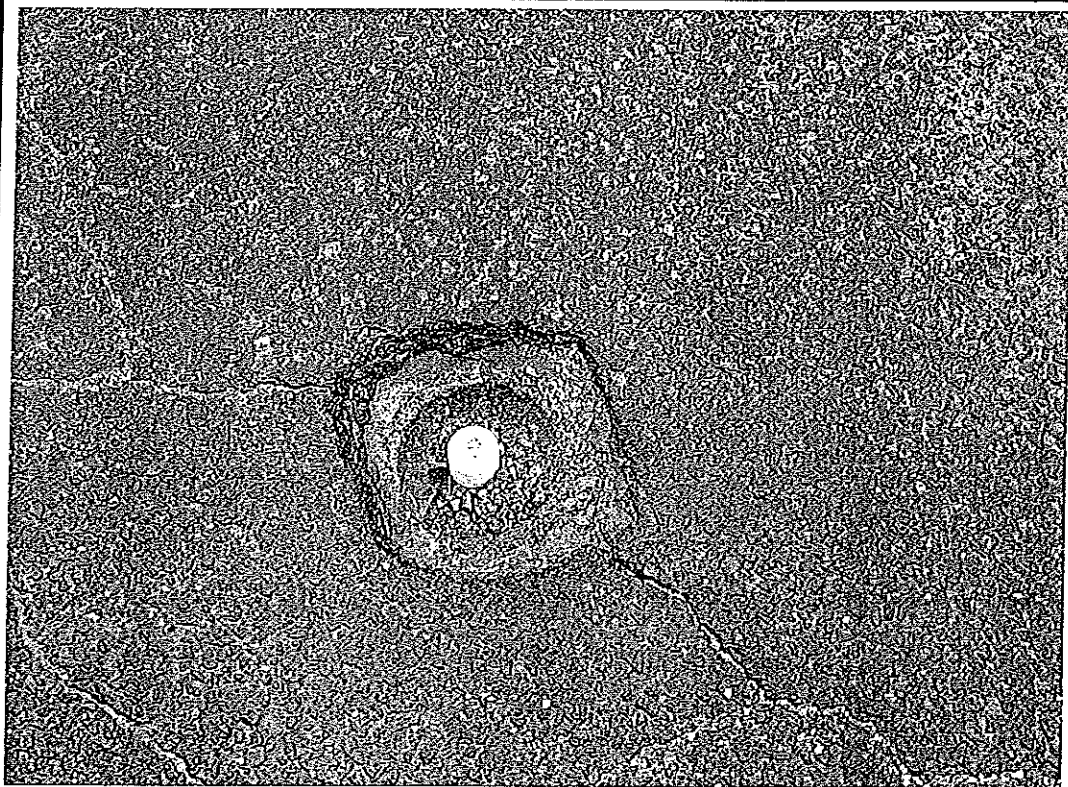

Monitoring well.